

under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

98-01-16 Fokker: Amendment 39-10278. Docket 97-NM-247-AD.

Applicability: Model F27 Mark 050 airplanes; serial numbers 20103 through 20266 inclusive, 20270 through 20292 inclusive, and 20294 through 20304 inclusive; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent failure of the aileron gustlock mechanism and the inboard aileron hinge bolt, which could result in inability to operate the ailerons, and consequent reduced controllability of the airplane, accomplish the following:

(a) Within 16 months after the effective date of this AD, replace the spring tab balance units in the ailerons and the inboard aileron hinge bolts and bearings with improved parts in accordance with Fokker Service Bulletin SBF50-27-036, dated December 28, 1993.

(b) An alternative method of compliance or adjustment of the compliance time that

provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

(d) The actions shall be done in accordance with Fokker Service Bulletin SBF50-27-036, dated December 28, 1993. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Fokker Services B.V., Technical Support Department, P.O. Box 75047, 1117 ZN Schiphol Airport, the Netherlands. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Note 3: The subject of this AD is addressed in Dutch airworthiness directive 94-025 (A), dated February 21, 1994.

(e) This amendment becomes effective on January 28, 1998.

Issued in Renton, Washington, on December 31, 1997.

Darrell M. Pederson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.
[FR Doc. 98-311 Filed 1-12-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 97-NM-314-AD; Amendment 39-10277; AD 98-01-15]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A330 and A340 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule; request for comments.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Airbus Model A330 and A340 series airplanes. This action requires repetitive operational tests of the override mechanism of the

trimmable horizontal stabilizer (THS) to determine if the system functions correctly; and corrective action, if necessary. This amendment is prompted by the issuance of mandatory continuing airworthiness information by a foreign civil airworthiness authority. The actions specified in this AD are intended to prevent uncommanded movement of the THS, which could result in reduced controllability of the airplane.

DATES: Effective January 28, 1998.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of January 28, 1998.

Comments for inclusion in the Rules Docket must be received on or before February 12, 1998.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 97-NM-314-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

The service information referenced in this AD may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT:

Norman B. Martenson, Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2110; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION: The Direction Générale de l'Aviation Civile (DGAC), which is the airworthiness authority for France, recently notified the FAA that an unsafe condition may exist on certain Airbus Model A330 and A340 series airplanes. The DGAC advises that results of simulator testing have indicated that uncommanded movement of the trimmable horizontal stabilizer (THS) can occur, if the manual override switch fails in the open position and the THS control wheel is blocked by either the pilot or a mechanical control jam. Such uncommanded movement of the THS, if not corrected, could result in reduced controllability of the airplane.

Explanation of Relevant Service Information

Airbus has issued Service Bulletins A330-27-3051 (for Model A330 series

airplanes) and A340-27-4058 (for Model A340 series airplanes), both dated February 13, 1997. These service bulletins describe procedures for repetitive operational tests of the override mechanism of the THS to determine if the system functions correctly. The service bulletins also describe procedures for repair, if necessary. The DGAC classified these service bulletins as mandatory and issued French airworthiness directives 97-064-044(B)R2 and 97-065-055(B)R2, both dated November 5, 1997, in order to assure the continued airworthiness of these airplanes in France.

FAA's Conclusions

These airplane models are manufactured in France and are type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.19) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the DGAC has kept the FAA informed of the situation described above. The FAA has examined the findings of the DGAC, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

Explanation of Requirements of the Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, this AD requires accomplishment of the actions specified in the service bulletins described previously, except as described below.

Differences Between this AD and the Service Information

Operators should note that, unlike the procedures described in the referenced service bulletins and French airworthiness directives, this AD does not address compliance times for affected airplanes used in training because the anticipated use of these airplanes in the United States does not include training.

Interim Action

This is considered to be interim action until final action is identified, at which time the FAA may consider further rulemaking.

Cost Impact

None of the airplanes affected by this action is on the U.S. Register. All

airplanes included in the applicability of this rule currently are operated by non-U.S. operators under foreign registry; therefore, they are not directly affected by this AD action. However, the FAA considers that this rule is necessary to ensure that the unsafe condition is addressed in the event that any of these subject airplanes are imported and placed on the U.S. Register in the future.

Should an affected airplane be imported and placed on the U.S. Register in the future, it would require approximately 1 work hour to accomplish the required actions, at an average labor rate of \$60 per work hour. Based on these figures, the cost impact of this AD would be \$60 per airplane.

Determination of Rule's Effective Date

Since this AD action does not affect any airplane that is currently on the U.S. register, it has no adverse economic impact and imposes no additional burden on any person. Therefore, prior notice and public procedures hereon are unnecessary and the amendment may be made effective in less than 30 days after publication in the **Federal Register**.

Comments Invited

Although this action is in the form of a final rule and was not preceded by notice and opportunity for public comment, comments are invited on this rule. Interested persons are invited to comment on this rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified under the caption **ADDRESSES**. All communications received on or before the closing date for comments will be considered, and this rule may be amended in light of the comments received. Factual information that supports the commenter's ideas and suggestions is extremely helpful in evaluating the effectiveness of the AD action and determining whether additional rulemaking action would be needed.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the rule that might suggest a need to modify the rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report that summarizes each FAA-public contact concerned with the substance of this AD will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this rule must

submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 97-NM-314-AD." The postcard will be date stamped and returned to the commenter.

Regulatory Impact

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, in accordance with Executive Order 12612, it is determined that this final rule does not have sufficient federalism implications to warrant the preparation of a Federalism Assessment.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

98-01-15 Airbus Industrie: Amendment 39-10277. Docket 97-NM-314-AD.

Applicability: Model A330-301, -321, -322, -341, and -342 series airplanes on which Airbus Modification 45631 has not been installed; and Model A340-211, -212, -213, -311, -312, and -313 series airplanes

on which Airbus Modification 45485 has not been installed; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent uncommanded movement of the trimmable horizontal stabilizer (THS), which could result in reduced controllability of the airplane, accomplish the following:

(a) Within 500 flight hours after the effective date of this AD, perform an operational test of the THS override mechanism to determine if the override system functions correctly, in accordance with paragraph (a)(1) or (a)(2) of this AD, as applicable. Repeat the operational test thereafter at intervals not to exceed 500 flight hours.

(1) For Model A330 series airplanes: Perform the operational test in accordance with Airbus Service Bulletin A330-27-3051, dated February 13, 1997; and, prior to further flight, repair any discrepancy in accordance with this service bulletin.

(2) For Model A340 series airplanes: Perform the operational test in accordance with Airbus Service Bulletin A340-27-4058, dated February 13, 1997; and, prior to further flight, repair any discrepancy in accordance with this service bulletin.

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

(d) The actions required by this AD shall be done in accordance with Airbus Service Bulletin A330-27-3051, dated February 13, 1997 (for Model A330 series airplanes); or A340-27-4058, dated February 13, 1997 (for Model A340 series airplanes); as applicable. This incorporation by reference was

approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Note 3: The subject of this AD is addressed in French airworthiness directives 97-064-044(B)R2 and 97-065-055(B)R2, both dated November 5, 1997.

(e) This amendment becomes effective on January 28, 1998.

Issued in Renton, Washington, on December 31, 1997.

Darrell M. Pederson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 98-312 Filed 1-12-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 97-NM-179-AD; Amendment 39-10279; AD 98-01-17]

RIN 2120-AA64

Airworthiness Directives; Airbus Model A320 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Airbus Model A320 series airplanes, that requires replacement of a capacitor of the main landing gear (MLG) circuitry with a new electrolytic capacitor having a tantalum casing. This amendment is prompted by the issuance of mandatory continuing airworthiness information by a foreign civil airworthiness authority. The actions specified by this AD are intended to prevent the failure of the landing gear to retract properly as a result of failure of a capacitor in the MLG circuitry and subsequent power interruption.

DATES: Effective February 17, 1998.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of February 17, 1998.

ADDRESSES: The service information referenced in this AD may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex,

France. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Norman B. Martenson, Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2110; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Airbus Model A320 series airplanes was published in the **Federal Register** on November 7, 1997 (62 FR 60193). That action proposed to require replacement of a capacitor of the main landing gear (MLG) circuitry with a new electrolytic capacitor having a tantalum casing.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the single comment received.

The commenter supports the proposed rule.

Conclusion

After careful review of the available data, including the comment noted above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

The FAA estimates that 31 Airbus Model A320 series airplanes of U.S. registry will be affected by this AD, that it will take approximately 2 work hours per airplane to accomplish the required actions, and that the average labor rate is \$60 per work hour. The cost for required parts will be minimal. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$3,720, or \$120 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted.

Regulatory Impact

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or