

doorjamb in accordance with the service bulletin. Prior to the accumulation of 28,000 landings after accomplishment of the modification, perform a high frequency eddy current (HFEC) inspection to detect cracks on the skin adjacent to the modification, in accordance with the service bulletin.

(A) If no crack is detected on the skin adjacent to the modification during the HFEC required by this paragraph, repeat the HFEC inspection thereafter at intervals not to exceed 20,000 landings.

(B) If any crack is detected on the skin adjacent to the modification during any HFEC inspection required by this paragraph, prior to further flight, repair it in accordance with a method approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate.

(2) Group 1, Condition 2. If any crack is found during any LFEC or x-ray inspection required by paragraph (b) of this AD, and the crack is 2 inches or less in length: Prior to further flight, modify/repair the corners of the doorjamb of the forward service door in accordance with the service bulletin. Prior to the accumulation of 28,000 landings after accomplishment of the modification, perform a HFEC inspection to detect cracks on the skin adjacent to the modification, in accordance with the service bulletin.

(i) If no crack is detected during the HFEC inspection required by this paragraph, repeat the HFEC inspection thereafter at intervals not to exceed 20,000 landings.

(ii) If any crack is detected during any HFEC inspection required by this paragraph, prior to further flight, repair it in accordance with a method approved by the Manager, Los Angeles ACO.

(3) Group 1, Condition 3. If any crack is found during any LFEC or x-ray inspection required by paragraph (b) of this AD, and the crack is greater than 2 inches in length: Prior to further flight, repair it in accordance with a method approved by the Manager, Los Angeles ACO.

(c) Group 2, Condition 1. For airplanes identified as Group 2 in McDonnell Douglas Service Bulletin DC9-53-288, dated February 10, 1997: If the visual inspection required by paragraph (a) of this AD reveals that the corners of the forward service door doorjamb *have been modified* previously in accordance with the McDonnell Douglas DC-9 Structural Repair Manual, using a steel doubler, accomplish either paragraph (c)(1) or (c)(2) of this AD in accordance with McDonnell Douglas Service Bulletin DC9-53-288, dated February 10, 1997.

(1) *Option 1.* Prior to the accumulation of 6,000 landings after accomplishment of that modification, or within 3,225 landings after the effective date of this AD, whichever occurs later, perform an HFEC inspection to detect cracks on the skin adjacent to the modification, in accordance with the service bulletin.

(i) If no crack is detected during the HFEC inspection required by paragraph (c)(1) of this AD, repeat the HFEC inspection thereafter at intervals not to exceed 3,000 landings.

(ii) If any crack is detected during any HFEC inspection required by paragraph (c)(1) of this AD, prior to further flight, repair it in

accordance with a method approved by the Manager, Los Angeles ACO.

(2) *Option 2.* Prior to further flight, modify the corner skin of the forward service door doorjamb in accordance with the service bulletin. Prior to the accumulation of 28,000 landings after accomplishment of the modification, perform an HFEC inspection to detect cracks on the skin adjacent to the modification, in accordance with the service bulletin.

(i) If no crack is detected on the skin adjacent to the modification during the HFEC required by this paragraph, repeat the HFEC inspection thereafter at intervals not to exceed 20,000 landings.

(ii) If any crack is detected on the skin adjacent to the modification during any HFEC inspection required by this paragraph, prior to further flight, repair it in accordance with a method approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate.

(d) Group 2, Condition 2. For airplanes identified as Group 2 in McDonnell Douglas Service Bulletin DC9-53-288, dated February 10, 1997: If the visual inspection required by paragraph (a) of this AD reveals that the corners of the forward service door doorjamb *have been modified* previously in accordance with McDonnell Douglas DC-9 Structural Repair Manual, using an aluminum doubler, prior to the accumulation of 28,000 landings after accomplishment of that modification, or within 3,225 landings after the effective date of this AD, whichever occurs later, perform an HFEC inspection to detect cracks on the skin adjacent to the modification, in accordance with McDonnell Douglas Service Bulletin DC9-53-288, dated February 10, 1997.

(1) If no crack is detected on the skin adjacent to the modification during the HFEC required by this paragraph, repeat the HFEC inspection thereafter at intervals not to exceed 20,000 landings.

(2) If any crack is detected on the skin adjacent to the modification during any HFEC inspection required by this paragraph, prior to further flight, repair it in accordance with a method approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate.

(e) Group 2, Condition 3. For airplanes identified as Group 2 in McDonnell Douglas Service Bulletin DC9-53-288, dated February 10, 1997: If the visual inspection required by paragraph (a) of this AD reveals that the corners of the forward service door doorjamb *have been modified* previously, but not in accordance with McDonnell Douglas Structural Repair Manual, prior to further flight, repair the corners in accordance with a method approved by the Manager, Los Angeles ACO.

(f) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles ACO. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 5: Information concerning the existence of approved alternative methods of

compliance with this AD, if any, may be obtained from the Los Angeles ACO.

(g) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on January 20, 1998.

Darrell M. Pederson,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 98-1858 Filed 1-26-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Airspace Docket No. 97-AEA-45]

Proposed Amendment to Class E Airspace; Blacksburg, VA

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking.

SUMMARY: This notice proposes to amend the Class E airspace area at Blacksburg, VA. The development of a new Standard Instrument Approach Procedure (SIAP) based on the Global Positioning System (GPS) at Virginia Tech Airport has made this proposal necessary. Additional controlled airspace extending upward from 700 feet Above Ground Level (AGL) is needed to accommodate the SIAP and for instrument Flight Rules (IFR) operations at the airport.

DATES: Comments must be received on or before February 26, 1998.

ADDRESSES: Send comments on the proposal in triplicate to: Manager, Airspace Branch, AEA-520, Docket No. 97-AEA-45, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy Int'l Airport, Jamaica, NY 11430.

The official docket may be examined in the Office of the Regional Counsel, AEA-7, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy International Airport, Jamaica, New York 11430.

An informal docket may also be examined during normal business hours in the Airspace Branch, AEA-520, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy International Airport, Jamaica, NY 11430.

FOR FURTHER INFORMATION CONTACT: Mr. Francis T. Jordan, Jr., Airspace Specialist, Airspace Branch, AEA-520, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy International

Airport, Jamaica, New York 11430; telephone: (718) 553-4521.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, economic, environmental, and energy-related aspects of the proposal. Communications should identify the airspace docket number and be submitted in triplicate to the address listed above. Commenters wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Airspace Docket No. 97-AEA-45." The postcard will be date/time stamped and returned to the commenter. All communications received on or before the closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this notice may be changed in light of comments received. All comments submitted will be available for examination in the Rules Docket both before and after the closing date for comments. A report summarizing each substantive public contact with the FAA personnel concerned with this rulemaking will be filed in the docket.

Availability of NPRMs

Any person may obtain a copy of this Notice of Proposed Rulemaking (NPRM) by submitting a request to the Office of the Regional Counsel, AEA-7, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy International Airport, Jamaica, NY 11430. Communications must identify the notice number of this NPRM. Persons interested in being placed on a mailing list for future NPRMs should also request a copy of Advisory Circular No. 11-2A, which describes the application procedure.

The Proposal

The FAA is considering an amendment to 14 CFR Part 71 to amend the Class E airspace area at Blacksburg, VA. A GPS RWY 12 SIAP has been developed for the Virginia Tech Airport. Additional controlled airspace extending upward from 700 feet AGL is needed to accommodate the SIAP and for IFR operations at the airport. Class E

airspace designations for airspace areas extending upward from 700 feet or more above the surface of the earth are published in Paragraph 6005 of FAA Order 7400.9E, dated September 10, 1997, and effective September 16, 1997, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designation listed in this document would be published subsequently in the Order.

The FAA has determined that this proposed regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this proposed regulation—(1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that would only affect air traffic procedures and air navigation, it is certified that this proposed rule would not have significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 71

Airspace, Incorporated by reference, Navigation (air).

The Proposed Amendment

In consideration of the foregoing, the Federal Aviation Administration proposes to amend 14 CFR Part 71 as follows:

PART 71—DESIGNATION OF CLASS A, CLASS B, CLASS C, CLASS D, AND CLASS E AIRSPACE AREAS; AIRWAYS; ROUTES; AND REPORTING POINTS

1. The authority citation for Part 71 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959-1963 Comp., p. 389.

§ 71.1 [Amended]

2. The incorporated by reference in 14 CFR 71.1 of Federal Aviation Administration Order 7400.9E, Airspace Designations and Reporting Powers, dated September 10, 1997, and effective September 16, 1997, is amended as follows:

Paragraph 6005 Class E airspace areas extending upward from 700 feet or more above the surface of the earth.

* * * * *

AEA VA E5 Blacksburg, VA [Revised]

Virginia Tech Airport, Blacksburg, VA (Lat. 37°12'28"N., long 80°24'29"W.)

That airspace extending upward from 700 feet above the surface within a 10-mile radius of Virginia Tech Airport and within 4 miles each side of the 297° bearing from the airport extending from the 10-mile radius to 17 miles northwest of the airport, excluding the portions that coincide with the Roanoke, VA, and Dublin, VA, Class E airspace areas.

* * * * *

Issued in Jamaica, New York, on December 9, 1997.

Franklin D. Hatfield,

Manager, Air Traffic Division, Eastern Region.
[FR Doc. 98-1925 Filed 1-26-98; 8:45 am]

BILLING CODE 4910-13-M

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Airspace Docket No. 97-AEA-46]

Proposed Amendment to Class E Airspace; Danville, VA

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking.

SUMMARY: This notice proposes to amend the Class E airspace area at Danville, VA. The amendment of the Instrument Landing System (ILS) and the Very High Frequency Omnidirectional Range (VOR) Standard Instrument Approach Procedures (SIAP) at Danville Regional Airport has made this proposal necessary. Additional controlled airspace extending upward from 700 feet Above Ground Level (AGL) is needed to accommodate the SIAP and for Instrument Flight Rules (IFR) operations at the airport.

DATES: Comments must be received on or before February 26, 1998.

ADDRESSES: Send comments on the proposal in triplicate to: Manager, Airspace Branch, AEA-520, Docket No. 97-AEA-46, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy Int'l Airport, Jamaica, NY 11430.

The official docket may be examined in the Office of the Regional Counsel, AEA-7, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy Int'l Airport, Jamaica, NY 11430.

An informal docket may also be examined during normal business hours in the Airspace Branch, AEA-520, F.A.A. Eastern Region, Federal Building #111, John F. Kennedy Int'l Airport, Jamaica, NY 11430.

FOR FURTHER INFORMATION CONTACT: Mr. Francis T. Jordan, Jr., Airspace