

This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Pratt & Whitney, 400 Main Street, East Hartford, Connecticut 06108. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Note 4: The subject of this AD is addressed in French airworthiness directive 96-020-195(B), dated January 31, 1996.

(f) This amendment becomes effective on July 2, 1998.

Issued in Renton, Washington, on May 18, 1998.

John J. Hickey,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 98-13821 Filed 5-27-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 97-CE-121-AD; Amendment 39-10541; AD 98-11-16]

RIN 2120-AA64

Airworthiness Directives; Dornier Luftfahrt GmbH Models 228-100, 228-101, 228-200, 228-201, 228-202, and 228-212 Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that applies to certain Dornier Luftfahrt GmbH (Dornier) Models 228-100, 228-101, 228-200, 228-201, 228-202, and 228-212 airplanes. This AD requires modifying the logic in the failure detection circuits of the landing gear uplock switches. This AD is the result of mandatory continuing airworthiness information (MCAI) issued by the airworthiness authority for Germany. The actions specified by this AD are intended to prevent a false warning indication of landing gear failure because of the design of the landing gear warning system, which could result in incorrect actions from the pilot based on the warning indications.

DATES: Effective July 11, 1998.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of July 11, 1998.

ADDRESSES: Service information that applies to this AD may be obtained from

Daimler-Benz Aerospace, Dornier, Product Support, P.O. Box 1103, D-82230 Wessling, Federal Republic of Germany; telephone: (08153) 300; facsimile: (08153) 302985. This information may also be examined at the Federal Aviation Administration (FAA), Central Region, Office of the Regional Counsel, Attention: Rules Docket No. 97-CE-121-AD, Room 1558, 601 E. 12th Street, Kansas City, Missouri 64106; or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Mr. Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 1201 Walnut, suite 900, Kansas City, Missouri 64106; telephone: (816) 426-6934; facsimile: (816) 426-2169.

SUPPLEMENTARY INFORMATION:

Events Leading to the Issuance of This AD

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an AD that would apply to certain Dornier Models 228-100, 228-101, 228-200, 228-201, 228-202, and 228-212 airplanes was published in the **Federal Register** as a notice of proposed rulemaking (NPRM) on March 26, 1998 (63 FR 14658). The NPRM proposed to require modifying the logic in the failure detection circuits of the landing gear uplock switches. Accomplishment of the proposed action as specified in the NPRM would be in accordance with Dornier Service Bulletin No. SB-228-215, Revision No. 1, dated January 31, 1995.

The NPRM was the result of mandatory continuing airworthiness information (MCAI) issued by the airworthiness authority for Germany.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposed rule or the FAA's determination of the cost to the public.

The FAA's Determination

After careful review of all available information related to the subject presented above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed except for minor editorial corrections. The FAA has determined that these minor corrections will not change the meaning of the AD and will not add any additional burden upon the public than was already proposed.

Cost Impact

The FAA estimates that 26 airplanes in the U.S. registry will be affected by

this AD, that it will take approximately 32 workhours per airplane to accomplish this action, and that the average labor rate is approximately \$60 an hour. Based on these figures, the total cost impact of this AD on U.S. operators is estimated to be \$49,920, or \$1,920 per airplane.

Regulatory Impact

The regulations adopted herein will not have substantial direct effects on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, in accordance with Executive Order 12612, it is determined that this final rule does not have sufficient federalism implications to warrant the preparation of a Federalism Assessment.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the final evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding a new airworthiness directive (AD) to read as follows:

98-11-16 Dornier Luftfahrt GMBH:

Amendment 39-10541; Docket No. 97-CE-121-AD.

Applicability: Models 228-100, 228-101, 228-200, 228-201, 228-202, and 228-212

airplanes, serial numbers 0001 through 8235, certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required within the next 100 hours time-in-service (TIS) after the effective date of this AD, unless already accomplished.

To prevent a false warning indication of landing gear failure because of the design of the landing gear warning system, which could result in incorrect actions from the pilot based on the warning indications, accomplish the following:

(a) Modify the logic in the failure detection circuits of the landing gear uplock switches in accordance with the ACCOMPLISHMENT INSTRUCTIONS section of Dornier Service Bulletin No. SB-228-215, Revision No. 1, dated January 31, 1995.

(b) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

(c) An alternative method of compliance or adjustment of the compliance time that provides an equivalent level of safety may be approved by the Manager, Small Airplane Directorate, 1201 Walnut, suite 900, Kansas City, Missouri 64016. The request shall be forwarded through an appropriate FAA Maintenance Inspector, who may add comments and then send it to the Manager, Small Airplane Directorate.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Small Airplane Directorate.

(d) Questions or technical information related to Dornier Service Bulletin No. SB-228-215, Revision No. 1, dated January 31, 1995, should be directed to Daimler-Benz Aerospace, Dornier, Product Support, P.O. Box 1103, D-82230 Wessling, Federal Republic of Germany; telephone: (08153) 300; facsimile: (08153) 302985. This service information may be examined at the FAA, Central Region, Office of the Regional Counsel, Room 1558, 601 E. 12th Street, Kansas City, Missouri 64106.

(e) The modification required by this AD shall be done in accordance with Dornier Service Bulletin No. SB-228-215, Revision No. 1, dated January 31, 1995. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from

Daimler-Benz Aerospace, Dornier, Product Support, P.O. Box 1103, D-82230 Wessling, Federal Republic of Germany. Copies may be inspected at the FAA, Central Region, Office of the Regional Counsel, Room 1558, 601 E. 12th Street, Kansas City, Missouri, or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

Note 3: The subject of this AD is addressed in German AD 95-246, dated August 23, 1995.

(f) This amendment becomes effective on July 11, 1998.

Issued in Kansas City, Missouri, on May 15, 1998.

Michael Gallagher,

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 98-13820 Filed 5-27-98; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 98-CE-11-AD; Amendment 39-10542; AD 98-11-17]

RIN 2120-AA64

Airworthiness Directives; Glaser-Dirks Flugzeugbau GmbH Model DG-400 Gliders

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that applies to all Glaser-Dirks Flugzeugbau GmbH (Glaser-Dirks) Model DG-400 gliders. This AD requires replacing the Bosch electrical system regulator, part number (P/N) 0212920001, with a type 4 E 26 regulator. This AD is the result of mandatory continuing airworthiness information (MCAI) issued by the airworthiness authority for Germany. The actions specified by this AD are intended to prevent failure of the electrical system regulator, which could result in smoke entering the cockpit with consequent passenger injury.

DATES: Effective July 10, 1998.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of July 10, 1998.

ADDRESSES: Service information that applies to this AD may be obtained from DG Flugzeugbau GmbH, Postfach 4120, D-76625 Bruchsal 4, Germany; telephone: +49 7257-89-0; facsimile: +49 7257-8922. This information may also be examined at the Federal

Aviation Administration (FAA), Central Region, Office of the Regional Counsel, Attention: Rules Docket No. 98-CE-11-AD, Room 1558, 601 E. 12th Street, Kansas City, Missouri 64106; or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Mr. Mike Kiesov, Aerospace Engineer, Small Airplane Directorate, Aircraft Certification Service, FAA, 1201 Walnut, suite 900, Kansas City, Missouri 64106; telephone: (816) 426-6934; facsimile: (816) 426-2169.

SUPPLEMENTARY INFORMATION:

Events Leading to the Issuance of This AD

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an AD that would apply to all Glaser-Dirks Model DG-400 gliders was published in the **Federal Register** as a notice of proposed rulemaking (NPRM) on March 19, 1998 (63 FR 13381). The NPRM proposed to require replacing the Bosch electrical system regulator, part number (P/N) 0212920001, with a type 4 E 26 regulator. Accomplishment of the proposed action as specified in the NPRM would be in accordance with DG Flugzeugbau GmbH Technical Note No. 826/33, dated July 19, 1996.

The NPRM was the result of mandatory continuing airworthiness information (MCAI) issued by the airworthiness authority for Germany.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposed rule or the FAA's determination of the cost to the public.

The FAA's Determination

After careful review of all available information related to the subject presented above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed except for minor editorial corrections. The FAA has determined that these minor corrections will not change the meaning of the AD and will not add any additional burden upon the public than was already proposed.

Compliance Time of This AD

Although failure of the electrical system regulator will only be unsafe while the glider is in flight, this unsafe condition is not a result of the number of times the glider is operated. The chance of this situation occurring is the same for a glider with 10 hours time-in-service (TIS) as it is for a glider with 500