

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent arcing from occurring under the forward cargo compartment floor as a result of damaged external power feeder cables, a situation that could lead to a fire at this location, accomplish the following:

Restatement of Requirements of AD 94-11-06, Amendment 39-8922

Modification

(a) Within 90 days after June 15, 1994 (the effective date of AD 94-11-06, amendment 39-8922), modify the external power feeder cable clamping installation in accordance with McDonnell Douglas Service Bulletin 24-78, dated May 10, 1994, or McDonnell Douglas Alert Service Bulletin MD11-24A078, Revision 01, dated June 16, 1999.

New Requirements of This AD

Inspection

(b) Within 1 year after the effective date of this AD, perform a detailed visual inspection of the external power cables between stations Y=635.000 and Y=655.000 to detect chafed or damaged wires, in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A078, Revision 01, dated June 16, 1999. If any chafed or damaged wire is found, prior to further flight, repair in accordance with the service bulletin.

Note 2: For the purposes of this AD, a detailed visual inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 3: Information concerning the existence of approved alternative methods of

compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on January 21, 2000.

Vi L. Lipski,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-2005 Filed 1-31-00; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-266-AD]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 series airplanes. This proposal would require a general visual inspection to verify that the circuit breaker panel fully opens, follow-on inspections, and corrective actions, if necessary. This proposal is prompted by an incident of an operator not being able to fully open the observer's upper main circuit breaker panel due to a certain cable being too short. The actions specified by the proposed AD are intended to ensure that the upper main circuit breaker panel opens fully. If the panel does not open fully, maintenance activities may be hindered and cause damage to the circuit breaker panel and wiring, which could result in electrical arcing and consequent smoke and fire in the flight compartment.

DATES: Comments must be received by March 17, 2000.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 99-NM-266-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this

location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this notice may be changed in light of the comments received.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this notice must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 99-NM-266-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the

FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 99-NM-266-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Supplementary Information

As part of its practice of re-examining all aspects of the service experience of a particular aircraft whenever an accident occurs, the FAA has become aware of an instance of an operator not being able to fully open the observer's upper main circuit breaker panel of a McDonnell Douglas Model MD-11 series airplane. Investigation revealed that a direct current (DC) power feeder bus cable was found to be too short, which prevented the panel from being fully opened. If the panel cannot be opened, maintenance activities may be hindered and cause damage to the circuit breaker panel and wiring. Such damage could result in electrical arcing and consequent smoke and fire in the flight compartment.

This incident is not considered to be related to an accident that occurred off the coast of Nova Scotia involving a McDonnell Douglas Model MD-11 series airplane. The cause of that accident is still under investigation.

Other Relevant Rulemaking

The FAA, in conjunction with Boeing and operators of Model MD-11 series airplanes, is continuing to review all aspects of the service history of those airplanes to identify potential unsafe conditions and to take appropriate corrective actions. This proposed airworthiness directive (AD) is one of a series of actions identified during that process. The process is continuing and the FAA may consider additional rulemaking actions as further results of the review become available.

Explanation of Relevant Service Information

The FAA has reviewed and approved McDonnell Douglas Alert Service Bulletin MD11-24A130, Revision 01, dated September 20, 1999, which describes procedures for a general visual inspection to verify that the circuit breaker panel fully opens, follow-on inspections, and corrective actions, if necessary. The follow-on inspections involve a detailed visual inspection of the wires between circuit breakers B1-213 and B1-300 to terminal strip S3-602 to detect chafing damage; and a detailed visual inspection of the route path of the subject area to detect chafing damage and to determine if the wire can be adjusted or if the wire must be replaced; as applicable. The corrective actions include adjusting the wire, replacing the wire with a new wire, and

repairing chafing damage. Accomplishment of the actions specified in the service bulletin is intended to adequately address the identified unsafe condition.

Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other products of this same type design, this proposed AD would require accomplishment of the actions specified in the service bulletin described previously.

Cost Impact

There are approximately 161 airplanes of the affected design in the worldwide fleet. The FAA estimates that 66 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 1 work hour per airplane to accomplish the proposed inspections, and that the average labor rate is \$60 per work hour. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$3,960, or \$60 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

McDonnell Douglas: Docket 99-NM-266-AD.

Applicability: Model MD-11 series airplanes, as listed in McDonnell Douglas Alert Service Bulletin MD11-24A130, Revision 01, dated September 20, 1999; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (e) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To ensure that the upper main circuit breaker panel opens fully, accomplish the following:

Inspection and a Follow-On Inspection

(a) Within 6 months after the effective date of this AD, perform a general visual inspection to verify that the circuit breaker panel fully opens in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A130, Revision 01, dated September 20, 1999.

Note 2: For the purposes of this AD, a general visual inspection is defined as "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or drop-light, and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

(1) If the circuit breaker panel fully opens, prior to further flight, perform a detailed visual inspection of the wires between circuit breakers B1-213 and B1-300 to terminal strip S3-602 to detect chafing damage, in accordance with the service bulletin.

(2) If the circuit breaker panel does not fully open, prior to further flight, perform a detailed visual inspection of the route path from circuit breakers B1-213 and B1-300 to terminal strip S3-602 to detect chafing damage and to determine if the wire can be adjusted or if the wire must be replaced, in accordance with the service bulletin.

Note 3: For the purposes of this AD, a detailed visual inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc., may be used. Surface cleaning and elaborate access procedures may be required."

Corrective Actions

(b) If any wire is found to need adjusting during the inspection required by paragraph (a)(2) of this AD, prior to further flight, adjust the wire in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A130, Revision 01, dated September 20, 1999.

(c) If any wire is found to need replacing during the inspection required by paragraph (a)(2) of this AD, prior to further flight, replace the wire with a new wire in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A130, Revision 01, dated September 20, 1999.

(d) If any chafing damage is found during the inspection required by paragraph (a)(1) or (a)(2) of this AD, prior to further flight, repair in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A130, Revision 01, dated September 20, 1999.

Alternative Methods of Compliance

(e) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 4: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(f) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on January 21, 2000.

Vi L. Lipski,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-2006 Filed 1-31-00; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-267-AD]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 and MD-11F Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 and MD-11F series airplanes. This proposal would require a one-time detailed visual inspection of the generator power feeder wires to detect chafed or damage wires; repair, if necessary; and a modification of the generator power feeder wire installation. This proposal is prompted by reports of generator power feeder wire chafing on the closeout rib of the wing leading edge at a certain station due to insufficient clearance between the generator power feeder wires and the closeout rib. The actions specified by the proposed AD are intended to prevent chafed and burnt generator power feeder wires, which could result in arcing damage to a certain closeout rib of the wing leading edge and fire damage to the wing structure, and consequent reduced structural integrity of the wing.

DATES: Comments must be received by March 17, 2000.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 99-NM-267-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood

Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule.

The proposals contained in this notice may be changed in light of the comments received. Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this notice must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 99-NM-267-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 99-NM-267-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.