

Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

2000-03-16 McDonnell Douglas:

Amendment 39-11575. Docket 99-NM-174-AD.

Applicability: Model MD-11 series airplanes, as listed in McDonnell Douglas Alert Service Bulletin MD11-24A071, Revision 01, dated May 20, 1999; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent the threaded insert connector from pulling free from the casing of the 90 percent brake pedal position switch and burning through the nose wheel steering cable, which could result in reduced aircraft directional control while on the ground, accomplish the following:

(a) For airplanes on which McDonnell Douglas Service Bulletin MD11-24-71, dated June 29, 1994, has not been accomplished: Within 12 months after the effective date of this AD, perform a one-time visual inspection of the 90 percent brake pedal position switch to determine the manufacturer's date code, in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A071, Revision 01, dated May 20, 1999.

(1) If no manufacturer's date code 8944 through 9033 inclusive is found on the 90

percent brake pedal position switch, no further action is required by this AD.

(2) If any manufacturer's date code 8944 through 9033 inclusive is found on the 90 percent brake pedal position switch, prior to further flight, replace the 90 percent brake pedal position switch with a new switch, in accordance with the service bulletin.

(b) As of the effective date of this AD, no person shall install a 90 percent brake pedal switch that has a manufacturer's date code of 8944 through 9033 inclusive, on any airplane.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(d) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(e) The actions shall be done in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A071, Revision 01, dated May 20, 1999. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(f) This amendment becomes effective on March 23, 2000.

Issued in Renton, Washington, on February 10, 2000.

Donald L. Riggins,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-3614 Filed 2-16-00; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-173-AD; Amendment 39-11574; AD 2000-03-15]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 and MD-11F Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas Model MD-11 and MD-11F series airplanes, that requires replacement of the existing terminal strips and supports above the main cabin area; and installation of spacers between terminal strips and mounting brackets in the avionics compartment; as applicable. This amendment is prompted by a report indicating that, during flight, an incident of electrical arcing occurred at a terminal strip located overhead in the main cabin. The actions specified by this AD are intended to prevent electrical arcing caused by power feeder cable terminal lugs grounding against terminal strip support brackets, which could result in smoke and fire in the main cabin or avionics compartment.

DATES: Effective March 23, 2000.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of March 23, 2000.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane

Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 and MD-11F series airplanes was published in the **Federal Register** on October 27, 1999 (64 FR 57823). That action proposed to require replacement of the existing terminal strips and supports above the main cabin area; and installation of spacers between terminal strips and mounting brackets in the avionics compartment; as applicable.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the comments received.

Both commenters support the proposed rule.

Conclusion

After careful review of the available data, including the comment noted above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

There are approximately 136 airplanes listed in McDonnell Douglas Alert Service Bulletin MD11-24A147, dated March 24, 1999, in the worldwide fleet. The FAA estimates that 40 airplanes of U.S. registry will be affected by this AD, that it will take approximately 3 work hours per airplane to accomplish the required installation, and that the average labor rate is \$60 per work hour. Required parts will cost approximately \$445 per airplane. Based on these figures, the cost impact of the installation required by this AD on U.S. operators is estimated to be \$25,000, or \$625 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various

levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

2000-03-15 McDonnell Douglas:

Amendment 39-11574. Docket 99-NM-173-AD.

Applicability: Model MD-11 and MD-11F series airplanes, as listed in McDonnell Douglas Alert Service Bulletin MD11-24A150, dated March 25, 1999, and McDonnell Douglas Alert Service Bulletin MD11-24A147, dated March 24, 1999; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by

this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent electrical arcing caused by power feeder cable terminal lugs grounding against terminal strip support brackets, which could result in smoke and fire in the main cabin or avionics compartment, accomplish the following:

Replacement of Terminal Strips and Supports

(a) For airplanes listed in the effectivity of McDonnell Douglas Alert Service Bulletin MD11-24A150, dated March 25, 1999, on which the modification specified in McDonnell Douglas Service Bulletin MD11-24-085, dated August 1, 1995, has not been accomplished: Within 1 year after the effective date of this AD, replace the existing terminal strips and supports above the main cabin at station Y=5-32.000 with new terminal strips and supports in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A150, dated March 25, 1999.

Installation of Spacers

(b) For airplanes listed in the effectivity of McDonnell Douglas Alert Service Bulletin MD11-24A147, dated March 24, 1999: Within 6 months after the effective date of this AD, install spacers between terminal strips and mounting brackets in the avionics compartment in accordance with the service bulletin.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(d) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(e) The replacement and installation shall be done in accordance with McDonnell Douglas Alert Service Bulletin MD11-24A150, dated March 25, 1999; and McDonnell Douglas Alert Service Bulletin MD11-24A147, dated March 24, 1999; as applicable. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood

Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

(f) This amendment becomes effective on March 23, 2000.

Issued in Renton, Washington, on February 10, 2000.

Donald L. Riggan,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-3615 Filed 2-16-00; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-172-AD; Amendment 39-11573; AD 2000-03-14]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain McDonnell Douglas Model MD-11 series airplanes, that requires modification of the battery ground cable installation in the center accessory compartment. This amendment is prompted by reports of battery ground studs that had arced due to loose ground stud attachments. The actions specified by this AD are intended to prevent such arcing, which could cause smoke and/or fire in the center accessory compartment.

DATES: Effective March 23, 2000.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of March 23, 2000.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). This information may be examined at the Federal

Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Technical Specialist, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 series airplanes was published in the **Federal Register** on October 27, 1999 (64 FR 57820). That action proposed to require modification of the battery ground cable installation in the center accessory compartment.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the single comment received.

The commenter supports the proposed rule.

Conclusion

After careful review of the available data, including the comment noted above, the FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

There are approximately 142 airplanes of the affected design in the worldwide fleet. The FAA estimates that 30 airplanes of U.S. registry will be affected by this AD, that it will take approximately 3 work hours per airplane (for Option 1; bracket assembly modification) or 2 work hours per airplane (for Option 2; bracket assembly replacement) to accomplish the required actions, and that the average labor rate is \$60 per work hour. Required parts will cost approximately \$1,204 per airplane for Option 1, or \$2,115 per airplane for Option 2. Based on these figures, the cost impact of the AD on U.S. operators for Option 1 is estimated to be \$41,520, or \$1,384 per airplane. The cost impact of the AD on U.S. operators for Option 2 is estimated to be \$67,050, or \$2,235 per airplane.

The cost impact figures discussed above are based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. However, the FAA has been advised that manufacturer warranty remedies are available for some labor costs associated with accomplishing the proposed actions. Therefore, the future economic cost impact of this rule on U.S. operators may be less than the cost impact figures indicated above.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) Is not a "significant regulatory action" under Executive Order 12866; (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive: