

(1) Replace the fuel flowmeter to Integrated Drive Generator (IDG) cooler fuel tube, part number (P/N) 1321M42G01, with a serviceable part in accordance with paragraph 2 of GE Alert Service Bulletin (ASB) No. 73-A224, Revision 2, July 9, 1997, and perform a leak check after accomplishing the replacement.

#### Power Management Controls

(2) For engines with Power Management Controls, replace the Main Engine Control (MEC) to fuel flowmeter fuel tube, P/N 1334M88G01, and bolts, P/N MS9557-12, with serviceable parts, in accordance with paragraph 3A of GE ASB 73-A0231, Revision 1, dated May 3, 1999 and perform a leak check after accomplishing the replacement.

#### Full Authority Digital Electronic Controls

(3) For engines with Full Authority Digital Electronic Controls replace the Hydromechanical Unit (HMU) to fuel flowmeter fuel tubes, P/Ns 1383M12G01 and 1374M30G01 with serviceable parts, in accordance with paragraph 3B of GE ASB 73-A0231, Revision 1, dated May 3, 1999 and perform a leak check after accomplishing the replacement.

**Note 2:** Information on performing the leak check can be found in the Aircraft Maintenance Manual, 71-00-00.

#### Definitions

(b) For the purpose of this AD, a shop visit is defined as any time an engine is removed from service and returned to the shop for any maintenance.

(c) For the purpose of this AD, a serviceable part is defined as any part other than tube, P/N 1321M42G01, for the fuel flowmeter to IDG cooler; tube; P/N 1334M88G01, and bolt, P/N MS9557-12, for the MEC to fuel flowmeter tube; and tubes, P/Ns 1383M12G01 and 1374M30G01, for the HMU to fuel flowmeter fuel tubes.

#### Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Engine Certification Office. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Engine Certification Office.

**Note 3:** Information concerning the existence of approved alternative methods of compliance with this airworthiness directive, if any, may be obtained from the Engine Certification Office.

#### Ferry Flights

(e) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the aircraft to a location where the requirements of this AD can be accomplished.

#### Incorporation by Reference

(f) The actions required by this AD shall be done in accordance with the following GE ASBs: 73-A224, Revision 2, July 9, 1997, and 73-A0231, Revision 1, May 3, 1999. This

incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from General Electric Aircraft Engines, c/o Commercial Technical Publications, 1 Neumann Way, Room 230, Cincinnati, OH 45215-1988; telephone 513-552-2005, fax 513-552-2816. Copies may be inspected at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA; or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

(g) This amendment becomes effective on May 1, 2000.

Issued in Burlington, Massachusetts, on February 17, 2000.

**Ronald A. Vavruska,**

*Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 00-4433 Filed 2-28-00; 8:45 am]

**BILLING CODE 4910-13-U**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Airspace Docket No. 99-ACE-52]

#### Amendment to Class E Airspace; Marshalltown, IA

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Direct final rule; confirmation of effective date.

**SUMMARY:** This document confirms the effective date of a direct final rule which revises Class E airspace at Marshalltown, IA.

**DATES:** The direct final rule published at 64 FR 72922 is effective on 0901 UTC, April 20, 2000.

**FOR FURTHER INFORMATION CONTACT:** Kathy Randolph, Air Traffic Division, Airspace Branch, ACE-520C, DOT Regional Headquarters Building, Federal Aviation Administration, 901 Locust, Kansas City, MO 64106; telephone: (816) 329-2525.

**SUPPLEMENTARY INFORMATION:** The FAA published this direct final rule with a request for comments in the **Federal Register** on December 29, 1999 (64 FR 72922). The FAA uses the direct final rulemaking procedure for a non-controversial rule where the FAA believes that there will be no adverse public comment. This direct final rule advised the public that no adverse comments were anticipated, and that unless a written adverse comment, or a written notice of intent to submit such an adverse comment, were received within the comment period, the regulation would become effective on

April 20, 2000. No adverse comments were received, and thus this notice confirms that this direct final rule will become effective on that date.

Issued in Kansas City, MO on February 16, 2000.

**Herman J. Lyons, Jr.,**

*Manager, Air Traffic Division, Central Region.*

[FR Doc. 00-4750 Filed 2-28-00; 8:45 am]

**BILLING CODE 4910-13-M**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Airspace Docket No. 99-ACE-47]

#### Amendment to Class E Airspace; Fredericktown, MO; Correction

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Direct final rule; confirmation of effective date and correction.

**SUMMARY:** This document confirms the effective date of a direct final rule which revises the Class E airspace at Fredericktown, MO, and corrects an error in the coordinates for the Fredericktown Regional Airport, Airport Reference Point (ARP) and the Farmington, MO, VHF Omnidirectional Range/Technical Air Navigation (VORTAC) as published in the **Federal Register** December 29, 1999 (64 FR 72924), Airspace Docket No. 99-ACE-47.

**DATES:** The direct final rule published at 64 FR 72924 is effective on 0901 UTC, April 20, 2000.

This correction is effective on April 20, 2000.

**FOR FURTHER INFORMATION CONTACT:** Kathy Randolph, Air Traffic Division, Airspace Branch, ACE-520C, DOT Regional Headquarters Building, Federal Aviation Administration, 901 Locust, Kansas City, MO 64106; telephone: (816) 329-2525.

#### SUPPLEMENTARY INFORMATION:

#### History

On December 29, 1999, the FAA published in the **Federal Register** a direct final rule; request for comments which revises the Class E airspace at Fredericktown, MO (FR document 99-33795, 64 FR 72924, Airspace Docket No. 99-ACE-47). An error was subsequently discovered in the coordinates for the Fredericktown Regional Airport ARP and the Farmington, MO, VORTAC. This action corrects those errors. After careful review of all available information