

DISAPPROVE (Voting against means other Farm Credit System associations will not be chartered to allow them to lend in your current association's lending area. However, you will be able to continue to borrow from your current association, as explained in the enclosed Information Statement.)

*If I do not direct how this ballot shall be voted, I intend it to be cast to APPROVE the question.*

**Note:** For your vote to count, your Proxy Ballot and Proxy Form must be received in the association office no later than (time) on (date) or delivered to an election official prior to balloting at the stockholders' meeting. You have the right to cancel your proxy at any time prior to the beginning of balloting at the stockholders' meeting.

#### A-5—Brief Summary of the Question

In a July 14, 1998, Philosophy Statement, the FCA Board expressed its view that competition is beneficial for customers and will help ensure that the System will continue to meet the current and future needs of rural America. To facilitate competition and improve services for all farmers, ranchers, and other eligible customers, the FCA Board indicated its support for several measures including the removal of geographical restrictions of System entities.

The FCA Board will accept applications for national charters from System direct lender associations in the near future. Before the FCA can grant applications for full nationwide charters, however, the Agency must carry out two requirements of the Act that call for stockholder voting in certain areas of the country. Congress required stockholder voting in the geographic area in which the Federal Intermediate Credit Bank of Jackson or its successor (AgFirst Farm Credit Bank) is chartered to provide short- and intermediate-term credit and the Farm Credit Bank of Texas is chartered to provide long-term credit. Congress also required the consent of stockholders of three production credit associations in New Mexico pursuant to section 433 of the Agricultural Credit Act of 1987.

Your association serves the [counties/states of xxx], and (insert either (1) has territory that is within the geographic area of the successor to the former Federal Intermediate Credit Bank of Jackson or (2) reaffiliated under section 433.) As a result, you are being asked whether you approve the FCA's issuance of charters to associations that would allow them to make similar loans to you and other eligible customers in the territory of your Association.

Approval of the question does not, however, guarantee that other associations will be chartered to lend in your Association's territory. Following the stockholder vote on the question, the board of directors of the [insert appropriate bank] [and insert associations if this Information Statement refers to section 5.17 (a)(13) and (a)(14)] will also vote on the question. The question must be approved by a majority of the stockholders voting and a majority of the board of directors of the banks [and associations, if appropriate] before another

System lender may be chartered to make similar loans in the territory of your Association. If approved by all parties involved, the FCA may grant requests from other FCS associations to serve the territory currently served by your Association.

#### A-6—Advantages and Disadvantages of Approving the Question

There are advantages and disadvantages of your approval of the question. The following is a brief discussion of the principal advantages and disadvantages to the stockholders of your Association. This discussion does not claim to provide a complete analysis of all the expected outcomes of approval of the question. In addition, there can be no assurance that any expected advantage or disadvantage below will take place in whole or part. The realization of any advantages and disadvantages depends on how each association implements its nationwide charter. You should also consider that the advantages and disadvantages affect not only you but all other eligible FCS customers and potential customers.

#### ADVANTAGES

Allowing other System associations to make loans in the territory of your Association may provide System customers in the [insert geographic area] with more choices for credit. You may have a greater choice of financial products because System lenders offer different loan products, interest rates, and repayment options. If the question is approved, you may have the freedom to select the System lender of your choice.

Competition for loans within a geographic area may also provide associations the opportunity and incentive to become more efficient and more competitive. This competition is likely to lower the cost of credit and improve the quality of service for you and other customers.

System lenders across the country may be better able to develop niche products and thus offer specialized lending services to customers in the territory of your Association and across the country. You may be able to obtain your main source of operational funding from one lender and specialized services from another. Nationwide charters may also enable System lenders to provide seamless credit to agricultural producers regardless of the producer's geographic location. E-commerce services may be enhanced after territorial restrictions are removed.

Finally, approval of this question may heighten awareness of each System lender's public policy mission for service within its original chartered territory. The FCA will continue to ensure that each System association fulfills its responsibility to make services available to all eligible customers within its current chartered territory.

#### DISADVANTAGES

As System lenders compete for customers, some associations may become less viable if added competitive pressures reduce profit margins. In addition, if the challenges associated with greater competition are not met, the capital investment of stockholders may be at a higher risk. There are 165

associations that may request nationwide charters. As a result, the management of your Association may be under increased pressure to provide efficient and cost effective services.

In the long run, some associations may be forced to cut back or eliminate certain services. Also, associations entering new geographic areas may primarily focus on larger or more profitable borrowers while less attention may be given to the more marginal borrowers in the associations' new and existing chartered territories.

Some associations may not be competitive in their present form and may have to merge or take other corporate restructuring actions to remain viable.

#### A-7—X Association Board Statement (Optional)

The Association board of directors may state its views and recommendation on the question and elaborate on the reasons for its recommendation.

#### A-8—Statement of the FCA Board

This statement will be provided during FCA's review period.

Dated: May 4, 2000.

**Nan P. Mitchem,**

*Acting Secretary, Farm Credit Administration Board.*

[FR Doc. 00-11551 Filed 5-8-00; 8:45 am]

BILLING CODE 6705-01-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 99-SW-57-AD]

#### **Airworthiness Directives; Schweizer Aircraft Corporation Model 269A, 269A-1, 269B, 269C, 269C-1, 269D, and TH-55A Helicopters**

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the superseding of an existing airworthiness directive (AD) applicable to Schweizer Aircraft Corporation (Schweizer) Model 269A, 269A-1, 269B, 269C, 269C-1, and 269D helicopters. That AD currently requires inspecting the tail rotor swashplate shaft (shaft) nut for looseness and, if loose, inspecting the shaft for proper size; subsequently inspecting the shafts not previously inspected; and replacing any undersized shaft prior to further flight. This new action would reduce the applicability by specifying certain serial number tail rotor pitch control (pitch control) assemblies and shipping dates but would add the Schweizer Model TH-

55A helicopter to the applicability. This proposal is prompted by the discovery of an undersized replacement shaft during routine maintenance. The actions specified by this proposed AD are intended to prevent failure of the shaft, loss of the tail rotor, and subsequent loss of control of the helicopter.

**DATES:** Comments must be received on or before July 10, 2000.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Office of the Regional Counsel, Southwest Region, Attention: Rules Docket No. 99-SW-57-AD, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137. You may also send comments electronically to the Rules Docket at the following address: 9-asw-adcomments@faa.gov. Comments may be inspected at the Office of the Regional Counsel between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays.

**FOR FURTHER INFORMATION CONTACT:**

George J. Duckett, Aviation Safety Engineer, New York Aircraft Certification Office, FAA, 10 Fifth Street, 3rd Floor, Valley Stream, New York 11581, telephone (516) 256-7525, fax (516) 568-2716.

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications should identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this notice may be changed in light of the comments received.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this notice must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to

Docket No. 99-SW-57-AD." The postcard will be date stamped and returned to the commenter.

**Availability of NPRMs**

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Office of the Regional Counsel, Southwest Region, Attention: Rules Docket No. 99-SW-57-AD, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

**Discussion**

The FAA issued AD 99-17-10, Amendment 39-11258, on August 4, 1999 (64 FR 44823, August 18, 1999), to require inspecting the shaft nut for looseness and, if loose, inspecting the shaft, part number (P/N) 269A6049-3, for proper size; subsequently inspecting the shafts not previously inspected; and replacing any undersized shaft prior to further flight. That action was prompted by the discovery of an undersized replacement shaft during routine maintenance. The requirements of that AD are intended to prevent failure of the shaft and subsequent loss of control of the helicopter.

Since the issuance of that AD, the FAA has determined that the TH-55A model helicopter could have an undersized shaft installed and should have been included in the applicability of AD 99-17-10. Additionally, we have received reports of undersized shafts shipped from the factory as spares between September 1 and December 1, 1998. This action requires inspecting each shaft nut for looseness and each shaft for improper size, replacing each shaft, as necessary, and adding Schweizer Model TH-55A to the applicability requirements.

The FAA has reviewed Schweizer Service Bulletins B-271.1 for Schweizer Models 269A, 269A-1, 269B, 269C, and TH-55A; C1B-009.1 for the Model 269C-1; and DB-007.1 for the Model 269D, all dated October 14, 1999. These service bulletins describe procedures for inspecting the shaft nut, P/N 269A6258, for looseness by using a firm hand pressure and inspecting the shaft, P/N 269A6049-3, for proper size.

Since an unsafe condition has been identified that is likely to exist or develop on other Schweizer Model 269A, 269A-1, 269B, 269C, 269C-1, 269D and TH-55A helicopters of these same type designs, the proposed AD would supersede AD 99-17-10 to require inspecting the shaft nut, P/N 269A6258, for looseness; inspecting the shaft, P/N 269A6049-3, for proper size; and replacing any undersized shaft with an airworthy shaft of the proper size for

helicopters with equipment installed as follows:

- Shaft, P/N 269A6049-3, shipped from the factory between September 1 and December 1, 1998, and installed after the helicopter was manufactured, or
- Pitch control assembly, P/N 269A6050-5, with serial number with an "S" prefix and number 1047 through 1061.

The FAA estimates that 28 helicopters would be affected by this AD. For each helicopter, it would take 0.25 work hour to accomplish the 10-hour inspection and 3.6 work hours to accomplish the inspection and replacement, if necessary, at the 100-hour or annual inspection interval. The average labor rate is \$60 per work hour. Required parts would cost approximately \$1400 per helicopter. Based on these figures, the total cost impact of the AD on U.S. operators is estimated to be \$45,668.

The regulations proposed herein would not have substantial direct effects on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this proposed action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Safety.

**The Proposed Amendment**

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

2. Section 39.13 is amended by removing Amendment 39-11258 and by adding a new airworthiness directive to read as follows:

**Schweizer Aircraft Corporation:** Docket No. 99-SW-57-AD. Supersedes AD 99-17-10, Amendment 39-11258, Docket No. 99-SW-31-AD.

**Applicability:** Model 269A, 269A-1, 269B, 269C, 269C-1, 269D and TH-55A helicopters, with a tail rotor washplate shaft (shaft), part number (P/N) 269A6049-3, or a tail rotor pitch control assembly (pitch control), P/N 269A6050-5, with a serial number (S/N) with an "S" prefix and number 1047 through 1061, installed, certificated in any category.

**Note 1:** This AD applies to each helicopter identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For helicopters that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent failure of the shaft, loss of the tail rotor, and subsequent loss of control of the helicopter, accomplish the following:

(a) Within 10 hours time-in-service (TIS);

(1) Determine whether the factory-installed shaft, part number (P/N) 269A6049-3, has been replaced with a shaft shipped from the factory between September 1 and December 1, 1998, inclusive, or if a pitch control, P/N 269A6050-5, with a S/N with an "S" prefix and numbers 1047 through 1061 is installed.

(2) If the factory ship date for a replacement shaft cannot be positively determined, if the shipping date was between September 1 and December 1, 1998, inclusive, or if the pitch control S/N has an "S" prefix and number 1047 through 1061,

(i) Before further flight and thereafter at intervals not to exceed 10 hours TIS, accomplish "Procedure, Part I," of Schweizer Service Bulletins B-271.1 for Models 269A, 269A-1, 269B, 269C and TH-55A helicopters; C1B-009.1 for the Model 269C-1, or DB-007.1 for the Model 269D, all dated October 14, 1999 (SB), as applicable.

(ii) At the next scheduled 100-hour or annual inspection, whichever occurs first, accomplish Part II, paragraphs a. through d., of the applicable SB. Shafts not meeting the requirements of paragraph d. of the applicable SB must be replaced with an airworthy shaft prior to further flight.

(b) Before installing a replacement shaft, determine the date the shaft was shipped from the factory. If the date was between September 1 and December 1, 1998,

inclusive, or cannot be determined, accomplish the inspections required by Part II, paragraph d., of the applicable SB prior to installation. Replace any unairworthy shaft with an airworthy shaft.

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, New York Aircraft Certification Office. Operators shall submit their requests through an FAA Principal Maintenance Inspector, who may concur or comment and then send it to the Manager, New York Aircraft Certification Office.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the New York Aircraft Certification Office.

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the helicopter to a location where the requirements of this AD can be accomplished.

Issued in Fort Worth, Texas, on April 28, 2000.

**Eric Bries,**

*Acting Manager, Rotorcraft Directorate,  
Aircraft Certification Service.*

[FR Doc. 00-11523 Filed 5-8-00; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 99-SW-42-AD]

#### Airworthiness Directives; Bell Helicopter Textron Canada (BHTC) Model 430 Helicopters

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the superseding of an existing airworthiness directive (AD) applicable to BHTC Model 430 helicopters. That AD requires inspecting all four main rotor adapter assemblies for evidence of flapping and lead-lag contact. That AD also requires installing a never-exceed-velocity (VNE) placard with markings on the airspeed indicator glass and instrument case and a revision to the rotorcraft flight manual (RFM) to reflect the airspeed revision. This action would provide mandatory terminating action for requirements of that AD by replacing the fluidlastic damper blade sets with improved sets that incorporate a pressure indicator to detect loss of damper fluid. This proposal is prompted by the need for a positive

means of detecting loss of damper fluid that could result in main rotor tip path plane separation. The actions specified by the proposed AD are intended to prevent increased vibrations, damage to the main rotor system, and subsequent loss of control of the helicopter.

**DATES:** Comments must be received on or before July 10, 2000.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Office of the Regional Counsel, Southwest Region, Attention: Rules Docket No. 99-SW-42-AD, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137. You may also send comments electronically to the Rules Docket at the following address: 9-asw-adcomments@faa.gov.

Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays.

**FOR FURTHER INFORMATION CONTACT:** Sharon Miles, Aviation Safety Engineer, Rotorcraft Directorate, Rotorcraft Standards Staff, 2601 Meacham Blvd., Fort Worth, Texas 76137, telephone (817) 222-5122, fax (817) 222-5961.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications should identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this notice may be changed in light of the comments received.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their mailed comments submitted in response to this notice must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. 99-SW-42-AD." The postcard will be date stamped and returned to the commenter.