

section of the Small Business Regulatory Enforcement Fairness Act of 1996 (SBREFA), 5 U.S.C. 801, *et seq.* As required by SBREFA, the FDIC will file the appropriate reports with Congress and the General Accounting Office.

List of Subjects in 12 CFR Part 361

Government contracts, Lawyers, Legal services, Minority businesses, Reporting and recordkeeping requirements, Women businesses.

For the reasons set forth above, the Board of Directors of the Federal Deposit Insurance Corporation revises part 361 of chapter III of title 12 of the Code of Federal Regulations as follows:

PART 361—MINORITY AND WOMEN OUTREACH PROGRAM CONTRACTING

Sec.

- 361.1 Why do minority- and women-owned businesses need this outreach regulation?
- 361.2 Why does the FDIC have this outreach program?
- 361.3 Who may participate in this outreach program?
- 361.4 What contracts are eligible for this outreach program?
- 361.5 What are the FDIC's oversight and monitoring responsibilities in administering this program?
- 361.6 What outreach efforts are included in this program?

Authority: 12 U.S.C. 1833e.

§ 361.1 Why do minority- and women-owned businesses need this outreach regulation?

The purpose of the FDIC Minority and Women Outreach Program (MWOP) is to ensure that minority- and women-owned businesses (MWOBs) are given the opportunity to participate fully in all contracts entered into by the FDIC.

§ 361.2 Why does the FDIC have this outreach program?

It is the policy of the FDIC that minorities and women, and businesses owned by them have the maximum practicable opportunity to participate in contracts awarded by the FDIC.

§ 361.3 Who may participate in this outreach program?

For purposes of this part:

- (a) *Minority* has the same meaning as defined by the Small Business Administration at 13 CFR 124.103(b).
- (b) *Legal Services* means all services provided by attorneys or law firms (including services of support staff).

§ 361.4 What contracts are eligible for this outreach program?

The FDIC outreach program applies to all contracts entered into by the FDIC. The outreach program is incorporated

into FDIC policies and guidelines governing contracting and the retention of legal services.

§ 361.5 What are the FDIC's oversight and monitoring responsibilities in administering this program?

(a) The FDIC Office of Diversity and Economic Opportunity (ODEO) has overall responsibility for nationwide outreach oversight, which includes, but is not limited to, the monitoring, review and interpretation of relevant regulations. In addition, the ODEO is responsible for providing the FDIC with technical assistance and guidance to facilitate the identification, registration, and solicitation of MWOBs.

(b) Each FDIC office that performs contracting or outreach activities will submit information to the ODEO on a quarterly basis, or upon request. Quarterly submissions will include, at a minimum, statistical information on contract awards and solicitations by designated demographic categories.

§ 361.6 What outreach efforts are included in this program?

(a) Each office engaged in contracting with the private sector will designate one or more MWOP coordinators. The coordinators will perform outreach activities for MWOP and act as liaison between the FDIC and the public on MWOP issues. On a quarterly basis, or as requested by the ODEO, the coordinators will report to the ODEO on their implementation of the outreach program.

(b) Outreach includes the identification and registration of MWOBs who can provide goods and services utilized by the FDIC. This includes distributing information concerning the MWOP.

(c) The identification of MWOBs for the provision of legal and non-legal services will primarily be accomplished by:

- (1) Obtaining various lists and directories of MWOBs maintained by other federal, state, and local governmental agencies;
- (2) Participating in conventions, seminars and professional meetings comprised of, or attended predominately by, MWOBs;
- (3) Conducting seminars, meetings, workshops and other various functions to promote the identification and registration of MWOBs;
- (4) Placing MWOP promotional advertisements indicating opportunities with the FDIC in minority- and women-owned media; and
- (5) Monitoring to assure that FDIC staff interfacing with the contracting community are knowledgeable of, and actively promoting, the MWOP.

By Order of the Board of Directors.

Dated at Washington, DC, this 10th day of May 2000.

Federal Deposit Insurance Corporation.

Robert E. Feldman,

Executive Secretary.

[FR Doc. 00-12408 Filed 5-16-00; 8:45 am]

BILLING CODE 6714-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99-NM-213-AD; Amendment 39-11727; AD 2000-10-03]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model DC-10 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to all McDonnell Douglas Model DC-10 series airplanes, that requires a one-time detailed visual inspection to determine if wire segments of the wire bundle routed through the feed through on the aft side of the flight engineer's station are damaged or chafed, and corrective actions, if necessary. This amendment is prompted by a report of smoke coming out of the flight engineer's upper right circuit breaker panel, which was followed by circuit breakers popping and the panel lights going out. The actions specified by this AD are intended to prevent chafing of the wire bundle located behind the flight engineer's panel caused by the wire bundle coming in contact with the lower edge of the feed through and consequent electrical arcing, which could result in smoke and fire in the cockpit.

DATES: Effective June 21, 2000.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of June 21, 2000.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). This information may be examined at the Federal Aviation Administration (FAA),

Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT:

Natalie Phan-Tran, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5343; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to all McDonnell Douglas Model DC-10 series airplanes was published in the **Federal Register** on January 26, 2000 (65 FR 4186). That action proposed to require a one-time detailed visual inspection to determine if wire segments of the wire bundle routed through the feed through on the aft side of the flight engineer's station are damaged or chafed, and corrective actions, if necessary.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. Due consideration has been given to the comments received.

One commenter supports the proposed rule. Another commenter supports the proposed rule and indicates that it is in the process of accomplishing the subject inspection. A third commenter supports the proposed rule and indicates that it has completed the subject inspection.

Explanation of Change Made

Paragraph (a) of this AD has been changed to correct a typographical error that resulted in a reference to an incorrect alert service bulletin revision date. That paragraph references "McDonnell Douglas Alert Service Bulletin DC10-24A149, Revision 01, dated May 6, 1999," as the appropriate source of service information for accomplishment of the inspection required by paragraph (a) of the proposed AD. This AD references the appropriate alert service bulletin as "McDonnell Douglas Alert Service Bulletin DC10-24A149, Revision 01, dated July 28, 1999."

Conclusion

After careful review of the available data, including the comments noted above, the FAA has determined that air safety and the public interest require the adoption of the rule with the change previously described. The FAA has determined that these changes will neither increase the economic burden on any operator nor increase the scope of the AD.

Cost Impact

There are approximately 412 airplanes of the affected design in the worldwide fleet. The FAA estimates that 300 airplanes of U.S. registry will be affected by this AD, that it will take approximately 1 work hour per airplane to accomplish the required actions, and that the average labor rate is \$60 per work hour. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$18,000, or \$60 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

2000-10-03 McDonnell Douglas:

Amendment 39-11727. Docket 99-NM-213-AD.

Applicability: All Model DC-10 series airplanes, certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent chafing of the wire bundle located behind the flight engineer's panel caused by the wire bundle coming in contact with the lower edge of the feed through and consequent electrical arcing, which could result in smoke and fire in the cockpit, accomplish the following:

Inspection

(a) Within 1 year after the effective date of this AD, perform a one-time detailed visual inspection to determine if the wire segments of the wire bundle routed through the feed through on the aft side of the flight engineer's station are damaged or chafed, in accordance with McDonnell Douglas Alert Service Bulletin DC10-24A149, Revision 01, dated July 28, 1999.

Note 2: For the purposes of this AD, a detailed inspection is defined as: "An intensive visual examination of a specific structural area, system, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at intensity deemed appropriate by the inspector. Inspection aids such as mirror, magnifying lenses, etc. may be used. Surface cleaning and elaborate access procedures may be required."

Corrective Actions

(1) For airplanes identified as Group 1 in the alert service bulletin: Accomplish paragraph (a)(1)(i) or (a)(1)(ii) of this AD, as applicable.

(i) If no damaged or chafed wire is found, no further action is required by this AD.

(ii) If any damaged or chafed wire is found, prior to further flight, repair in accordance with the alert service bulletin.

(2) For airplanes identified as Group 2 in the alert service bulletin: Accomplish paragraph (a)(2)(i) or (a)(2)(ii) of this AD, as applicable.

(i) If no damaged or chafed wire is found, within 1 year after the effective date of this AD, revise the wire bundle support clamp installation at the flight engineer's station in accordance with the alert service bulletin.

(ii) If any damaged or chafed wire is found, prior to further flight, repair the wiring, and revise the wire bundle support clamp installation at the flight engineer's station, in accordance with the alert service bulletin.

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permits

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(d) The actions shall be done in accordance with McDonnell Douglas Alert Service Bulletin DC10-24A149, Revision 01, dated July 28, 1999. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Technical Publications Business Administration, Dept. C1-L51 (2-60). Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

(e) This amendment becomes effective on June 21, 2000.

Issued in Renton, Washington, on May 8, 2000.

Vi L. Lipski,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-11950 Filed 5-16-00; 8:45 am]

BILLING CODE 4910-13-U

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 99-SW-05-AD; Amendment 39-11731; AD 2000-10-07]

RIN 2120-AA64

Airworthiness Directives; Eurocopter Deutschland GmbH (Eurocopter) Model EC 135 Helicopters

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD) that applies to Eurocopter Model EC 135 helicopters. This AD requires replacing a certain oil cooler fan splined drive shaft (shaft) with a different airworthy shaft and re-identifying the part numbers on the oil cooler fans. This amendment is prompted by two incidents in which the shaft broke. The actions specified by this AD are intended to prevent failure of the shaft, loss of oil cooling, and a subsequent engine shutdown during flight.

EFFECTIVE DATE: June 21, 2000.

FOR FURTHER INFORMATION CONTACT: Paul Madej, Aviation Safety Engineer, FAA, Rotorcraft Directorate, Rotorcraft Standards Staff, 2601 Meacham Blvd., Fort Worth, Texas 76137, telephone (817) 222-5125, fax (817) 222-5961.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an AD that applies to Eurocopter Model EC 135 helicopters was published in the **Federal Register** on February 11, 2000 (65 FR 6925). That action proposed to require replacing a certain shaft with a different airworthy shaft and re-identifying the part numbers on the oil cooler fans.

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were received on the proposal or the FAA's determination of the cost to the public. The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

The FAA estimates that 9 helicopters of U.S. registry will be affected by this AD, that it will take approximately 4 work hours per helicopter to replace and re-identify the affected parts and record these actions in the gearbox history card or equivalent record, and that the average labor rate is \$60 per work hour. The manufacturer has stated in Alert Service Bulletin EC 135-79A-001, dated January 23, 1998, that required parts will be provided at no cost. Based on these figures, the total cost impact of the AD on U.S. operators is estimated to be \$2,160.

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding a new airworthiness directive to read as follows: