

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2000-NM-113-AD]

RIN 2120-AA64

**Airworthiness Directives; British Aerospace Model BAC 1-11 401/AK and 410/AQ Airplanes**

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to all British Aerospace Model BAC 1-11 401/AK and 410/AQ airplanes. This proposal would require replacement of certain landing gear brake accumulators with improved accumulators. This action is necessary to prevent loss of hydraulic pressure and possible structural damage to the airplane due to failure of the accumulator. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by October 19, 2000.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2000-NM-113-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2000-NM-113-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from British Aerospace, Service Support, Airbus Limited, P.O. Box 77, Bristol BS99 7AR, England. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

**FOR FURTHER INFORMATION CONTACT:** Norman B. Martenson, Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601

Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2110; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this notice may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this notice must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2000-NM-113-AD." The postcard will be date stamped and returned to the commenter.

**Availability of NPRMs**

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2000-NM-113-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

**Discussion**

The Civil Aviation Authority (CAA), which is the airworthiness authority for the United Kingdom, notified the FAA that an unsafe condition may exist on all British Aerospace Model BAC 1-11 401/AK and 410/AQ airplanes. The

CAA advises that corrosion has been found on the steel shell under the nameplate and in the threads beneath the end caps of certain landing gear brake accumulators. These accumulators had exceeded their original calendar life. Additionally, fatigue and stress corrosion may have weakened the end caps of the accumulator. Failure of the accumulator, if not corrected, could result in loss of hydraulic pressure and possible structural damage to the airplane.

**Explanation of Relevant Service Information**

British Aerospace has issued Service Bulletin 32-PM6054, dated February 2000, which describes procedures for replacement of certain landing gear brake accumulators with accumulators that are fitted with end caps made from stress and corrosion resistant aluminum alloy. The improved accumulators also have increased wall thickness in the end caps, a higher strength shell, and corrosion prevention measures in the threads and under the nameplate and mounting straps. The service bulletin references Parker Service Bulletin 1356-653562-32-100, dated September 23, 1999, as an additional source of service information for accomplishment of the replacement.

Accomplishment of the actions specified in the British Aerospace service bulletin is intended to adequately address the identified unsafe condition. The CAA classified this service bulletin as mandatory in order to ensure the continued airworthiness of these airplanes in the United Kingdom.

**FAA's Conclusions**

This airplane model is manufactured in the United Kingdom and is type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the CAA has kept the FAA informed of the situation described above. The FAA has examined the findings of the CAA, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

**Explanation of Requirements of Proposed Rule**

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, the proposed AD would require

accomplishment of the actions specified in the British Aerospace service bulletin described previously.

### Cost Impact

The FAA estimates that 13 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 1 work hour per airplane to accomplish the proposed actions, and that the average labor rate is \$60 per work hour. Required parts would cost approximately \$9,940 per airplane. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$130,000, or \$10,000 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

### Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

### The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**British Aerospace Airbus Limited (Formerly British Aerospace Commercial Aircraft Limited, British Aerospace Aircraft Group):** Docket 2000–NM–113–AD.

**Applicability:** All Model BAC 1–11 401/AK and 410/AQ airplanes, certificated in any category.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent loss of hydraulic pressure and possible structural damage to the airplane due to failure of the landing gear brake accumulator, accomplish the following:

#### Replacement

(a) Within 10 months after the effective date of this AD, replace any Parker landing gear brake accumulator having part number (P/N) 1356–653562 with an accumulator having P/N 1356–653562M2, in accordance with British Aerospace Service Bulletin 32–PM6054, dated February 2000.

**Note 2:** The British Aerospace service bulletin references Parker Service Bulletin 1356–653562–32–100, dated September 23, 1999, as an additional source of service information for accomplishment of the replacement.

#### Spares

(b) As of the effective date of this AD, no Parker landing gear brake accumulator having P/N 1356–653562 shall be installed on any airplane.

#### Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that

provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM–116, FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM–116.

**Note 3:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM–116.

#### Special Flight Permits

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on September 13, 2000.

**Donald L. Riffin,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 00–24002 Filed 9–18–00; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2000–NM–213–AD]

RIN 2120–AA64

#### Airworthiness Directives; Saab Model SAAB SF340A and SAAB 340B Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Saab Model SAAB SF340A and SAAB 340B series airplanes. This proposal would require inspecting the connector on the refuel/defuel panel and the electrical connector on the illuminated placard to detect signs of fluid ingress or corrosion, and corrective actions. This action is necessary to prevent electrical shorts or arcing at the illuminated placard connector at the refuel/defuel panel, which could result in a potential ignition source for fuel vapors during fueling procedures. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by October 19, 2000.