

contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by removing amendment 39–10546 (63 FR 29546, July 6, 1998), and by adding a new airworthiness directive (AD), amendment 39–12000, to read as follows:

2000–23–27 Bombardier, Inc. (Formerly de Havilland, Inc.): Amendment 39–12000. Docket 99–NM–359–AD. Supersedes AD 98–11–21, Amendment 39–10546.

Applicability: Model DHC–8–102, –103, and –301 series airplanes; certificated in any category; serial numbers 002 through 010 inclusive, 012 through 201 inclusive, 203 through 209 inclusive, 211 through 215 inclusive, 217 through 220 inclusive, 222, and 223; except those airplanes on which de Havilland Modification 8/1114 or 8/1110 has been accomplished.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c)(1) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent the possibility of a fire on an airplane due to chafing of the electrical wiring of the cabin ceiling lighting system, accomplish the following:

Restatement of Requirements of AD 98–11–21

Inspection for Wire Wear and Breakage

(a) Within 1,000 hours time-in-service or 6 months after July 6, 1998 (the effective date of AD 98–11–21, amendment 39–10546), whichever occurs first: Accomplish the requirements of paragraphs (a)(1) and (a)(2) of this AD in accordance with de Havilland Service Bulletin S.B. 8–33–35, dated September 1, 1995, or Bombardier Service Bulletin S.B. 8–33–35, Revision ‘B’, dated September 25, 1998.

(1) Perform a one-time inspection for wear and breakage of wire segments of the individual lighting units of the ceiling and sidewall lights. Prior to further flight, replace any damaged wiring.

(2) Install teflon spiral wrap on the wiring of the ceiling and sidewall lights (Modification 8/2158).

Note 2: Accomplishment of the actions required by paragraph (a) of this AD in accordance with Bombardier Service Bulletin S.B. 8–33–35, Revision ‘A’, dated July 28, 1998, is acceptable for compliance with that paragraph.

New Requirements of This AD

Inspection for Installed Teflon Spiral Wrap

(b) Within 1,000 hours time-in-service or 6 months after the effective date of this AD, whichever occurs first: Perform a one-time inspection to determine if teflon spiral wrap is installed on the wiring of the lavatory lighting system, in accordance with Bombardier Service Bulletin S.B. 8–33–35, Revision ‘B’, dated September 25, 1998.

(1) If teflon spiral wrap is not installed, prior to further flight, install teflon spiral wrap on the wiring of the lavatory lighting system in accordance with the service bulletin.

(2) If teflon spiral wrap is installed, no further action is required by this paragraph.

Alternative Methods of Compliance

(c)(1) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, New York Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, New York ACO.

(2) Alternative methods of compliance, approved previously in accordance with AD 98–11–21, amendment 39–10546, are approved as alternative methods of compliance with this AD.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the New York ACO.

Special Flight Permits

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(e) The actions shall be done in accordance with de Havilland Service Bulletin S.B. 8–33–35, dated September 1, 1995; or Bombardier Service Bulletin S.B. 8–33–35, Revision ‘B’, dated September 25, 1998.

(1) The incorporation by reference of Bombardier Service Bulletin S.B. 8–33–35, Revision ‘B’, dated September 25, 1998, is approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51.

(2) The incorporation by reference of de Havilland Service Bulletin S.B. 8–33–35, dated September 1, 1995, was approved previously by the Director of the Federal Register as of July 6, 1998 (63 FR 29546, June 1, 1998).

(3) Copies may be obtained from Bombardier, Inc., Bombardier Regional Aircraft Division, 123 Garratt Boulevard, Downsview, Ontario M3K 1Y5, Canada. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Note 4: The subject of this AD is addressed in Canadian airworthiness directive CF–95–18R1, dated January 8, 1999.

Effective Date

(f) This amendment becomes effective on January 2, 2001.

Issued in Renton, Washington, on November 14, 2000.

Donald L. Riffin,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00–29606 Filed 11–27–00; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2000–NM–79–AD; Amendment 39–11996; AD 2000–23–23]

RIN 2120–AA64

Airworthiness Directives; Airbus Model A330 and A340 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Airbus Model A330 and A340 series airplanes, that requires modification of the rib 1/wing center spar attachment. This amendment is necessary to prevent fatigue cracking at the rib 1/center spar angle and bottom corner fitting, which could result in reduced structural capability of the wing. This action is

intended to address the identified unsafe condition.

DATES: Effective January 2, 2001.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of January 2, 2001.

ADDRESSES: The service information referenced in this AD may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the

Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Norman B. Martenson, Manager, International Branch, ANM-116, FAA, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2110; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Airbus Model A330 and A340 series airplanes was published in the **Federal Register** on September 27, 2000 (65 FR 58013). That action proposed to require modification of the rib 1/wing center spar attachment.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.

Conclusion

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

The following information describes the anticipated cost impact on U.S. operators for the required modification.

Model	Number of airplanes on U.S. Register	Number of work hours	Average labor rate per work hour	Cost of required parts	Per-airplane cost
A330	5	42	\$60	\$9,950	\$12,470
A340	0	42	60	10,099	12,619

The cost impact figures discussed above are based on assumptions that no operator has yet accomplished the modification of this AD, and that no operator would accomplish these actions in the future if this AD were not adopted. However, the FAA has been advised that the 5 airplanes currently on the U.S. Register have been modified in accordance with the requirements of this AD. Therefore, until additional affected airplanes (unmodified) are added to the U.S. Register, this AD imposes no additional cost on U.S. operators.

The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a

"significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

2000-23-23 Airbus Industrie: Amendment 39-11996. Docket 2000-NM-79-AD.

Applicability: Model A330 and A340 series airplanes, certificated in any category; excluding those on which Airbus Modification 43021 has been installed.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent fatigue cracking at the rib 1/ center spar angle and bottom corner fitting, which could result in reduced structural capability of the wing, accomplish the following:

Modification

(a) Modify the rib 1/wing center spar attachment, as specified by paragraph (a)(1) or (a)(2), as applicable, of this AD.

(1) For Model A330 series airplanes: Modify before the accumulation of 9,600 total flight cycles or 29,900 total flight hours, whichever occurs first. Do the modification in accordance with Airbus Service Bulletin A330-57-3017, including Appendix 01, Revision 02, dated October 11, 1999.

(2) For Model A340 series airplanes: Modify before the accumulation of 9,300 total flight cycles or 37,200 total flight hours, whichever occurs first. Do the modification

in accordance with Airbus Service Bulletin A340-57-4022, including Appendices 01 and 02, dated October 8, 1999.

Note 2: Modification prior to the effective date of this AD in accordance with Airbus Service Bulletin A330-57-3017, dated October 14, 1998, or Revision 01, dated April 9, 1999, is acceptable for compliance with the requirements of paragraph (a) of this AD.

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch.

Special Flight Permits

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Incorporation by Reference

(d) The actions shall be done in accordance with Airbus Service Bulletin A330-57-3017, including Appendix 01, Revision 02, dated October 11, 1999; and Airbus Service Bulletin A340-57-4022, including Appendices 01 and 02, dated October 8, 1999; as applicable. This incorporation by reference was approved by the Director of the **Federal Register** in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Note 4: The subject of this AD is addressed in French airworthiness directives 2000-073-111(B) and 2000-074-136(B), both dated February 23, 2000.

Effective Date

(e) This amendment becomes effective on January 2, 2001.

Issued in Renton, Washington, on November 14, 2000.

Donald L. Riggan,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 00-29605 Filed 11-27-00; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2000-NM-221-AD; Amendment 39-11997; AD 2000-23-24]

RIN 2120-AA64

Airworthiness Directives; Saab Model SAAB 2000 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Saab Model SAAB 2000 series airplanes, that requires an inspection to ensure correct installation of certain self-seal couplings in each nacelle, and corrective action, if necessary. This amendment also requires installation of a new clamp to the self-seal couplings. This action is necessary to prevent separation of the self-seal couplings, which could result in loss of engine oil pressure and a flight-crew-commanded engine shutdown. This action is intended to address the identified unsafe condition.

DATES: Effective January 2, 2001.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of January 2, 2001.

ADDRESSES: The service information referenced in this AD may be obtained from Saab Aircraft AB, SAAB Aircraft Product Support, S-581.88, Linkoping, Sweden. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Norman B. Martenson, Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2110; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Saab Model SAAB 2000 series airplanes was published in the **Federal Register** on September 29, 2000 (65 FR 58494). That action proposed to require an inspection to ensure correct installation of certain self-seal couplings in each nacelle, and

corrective action, if necessary. That action also proposed to require installation of a new clamp to the self-seal couplings.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.

Conclusion

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

The FAA estimates that 3 Model SAAB 2000 series airplanes of U.S. registry will be affected by this AD, that it will take approximately 1 work hour per airplane to accomplish the required actions, and that the average labor rate is \$60 per work hour. Required parts will be provided by the vendor at no charge to operators. Based on these figures, the cost impact of the required AD on U.S. operators is estimated to be \$180, or \$60 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities