

months. If any discrepancy is found, before further flight, repair per paragraph (f) of this AD. For a repair method to be approved by the Manager, SACO, as required by this paragraph, the approval letter must specifically reference this AD.

#### Repair

(f) Repair (including removing corrosion; inspecting the rework area for cracks; refinishing the blend-out area; installing a nesting angle repair; and applying chemical film treatment, primer, sealant, and corrosion-inhibiting compound) any discrepancy specified in paragraphs (d)(3), (d)(4)(ii), and (e) of this AD, per a method approved by the Manager, Seattle ACO; or per data meeting the type certification basis of the airplane approved by a Boeing Designated Engineering Representative who has been authorized by the Manager, Seattle ACO, to make such findings. For a repair method to be approved by the Manager, Seattle ACO, as required by this paragraph, the approval letter must specifically reference this AD.

#### Alternative Methods of Compliance

(g) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Seattle ACO, FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Seattle ACO.

**Note 3:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Seattle ACO.

#### Special Flight Permit

(h) Special flight permits may be issued per §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on April 24, 2001.

**Donald L. Riggins,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01-10729 Filed 4-30-01; 8:45 am]

**BILLING CODE 4910-13-U**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2000-NM-211-AD]

RIN 2120-AA64

#### Airworthiness Directives; BAe Systems (Operations) Limited Model Avro 146-RJ Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain BAe Systems (Operations) Limited Model Avro 146-RJ series airplanes. This proposal would require modification of the passenger service units. This action is necessary to prevent failure of the passenger service units to deliver oxygen to the passengers in the event of decompression of the airplane, which could result in injury to the passengers. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by May 31, 2001.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2000-NM-211-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2000-NM-211-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from British Aerospace Regional Aircraft American Support, 13850 Mclearn Road, Herndon, Virginia 20171. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

**FOR FURTHER INFORMATION CONTACT:** Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address

specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. 2000-NM-211-AD." The postcard will be date-stamped and returned to the commenter.

#### Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket 2000-NM-211-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

#### Discussion

The Civil Aviation Authority (CAA), which is the airworthiness authority for, notified the FAA that an unsafe condition may exist on certain BAe Systems (Operations) Limited Model Avro 146-RJ series airplanes. The CAA advises that the current design of the support lanyards on the passenger service units (PSUs) could restrict operation of the oxygen generator drop-down lids. Failure of the PSUs to deliver oxygen to the passengers in the event of decompression of the airplane could result in injury to the passengers.

#### Relevant Service Information

The manufacturer has issued BAe Systems (Operations) Limited Service Bulletin SB.25-418-36215A, dated

April 5, 2000; and Revision 1, dated October 17, 2000. The service bulletin describes procedures for modifying the PSUs. The modification involves relocating the lanyard from the third attachment lug (next to the speaker installation) to the end attachment lug on the PSUs. These actions are intended to adequately address the unsafe condition. The CAA classified this service bulletin as mandatory and issued British airworthiness directive 004-04-2000 to ensure the continued airworthiness of these airplanes in the United Kingdom.

#### FAA's Conclusions

This airplane model is manufactured in the United Kingdom and is type certificated for operation in the United States under the provisions of § 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the CAA has kept the FAA informed of the situation described above. The FAA has examined the findings of the CAA, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

#### Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same type design registered in the United States, the proposed AD would require accomplishment of the actions specified in the service bulletin described previously.

#### Cost Impact

The FAA estimates that this AD would affect 40 airplanes of U.S. registry. The proposed actions would take approximately 5 work hours per airplane, at an average labor rate of \$60 per work hour. Required parts would be provided at no cost to the operators. Based on these figures, the FAA estimates the cost of the proposed AD on U.S. operators to be \$12,000, or \$300 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this proposed AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include

incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

#### Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption

#### ADDRESSES.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

#### BAE Systems (Operations) Limited (Formerly British Aerospace Regional Aircraft): Docket 2000-NM-211-AD.

**Applicability:** Model Avro 146-RJ series airplanes, certificated in any category, as listed in BAe Systems (Operations) Limited Service Bulletin SB.25-418-36215A, Revision 1, dated October 17, 2000.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area

subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent failure of the passenger service units (PSUs) to deliver oxygen to the passengers in the event of decompression of the airplane, which could result in injury to the passengers, accomplish the following:

#### Modification

(a) Within 90 days after the effective date of this AD, modify the PSUs by relocating the lanyard, in accordance with BAe Systems (Operations) Limited Service Bulletin SB.25-418-36215A, dated April 5, 2000; or Revision 1, dated October 17, 2000.

#### Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate. Operators shall submit their requests through an appropriate FAA Principal Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

#### Special Flight Permits

(c) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

**Note 3:** The subject of this AD is addressed in British airworthiness directive 004-04-2000.

Issued in Renton, Washington, on April 24, 2001.

**Donald L. Riggan,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*  
[FR Doc. 01-10728 Filed 4-30-01; 8:45 am]

**BILLING CODE 4910-13-U**