

proposed actions, and that the average labor rate is \$60 per work hour. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$340,800, or \$4,800 per airplane, per inspection cycle.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this proposed AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

Gulfstream Aerospace Corporation: Docket 96–NM–143–AD.

Applicability: All Model G–159 airplanes, certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To detect and correct corrosion of the skin of certain structural assemblies, which could cause local instability failures of the wing under certain load conditions and result in degradation of wing capability; accomplish the following:

(a) Within 9 months after the effective date of this AD, perform a non-destructive test (NDT) to detect corrosion of the skins of the aileron rudder, rudder trim tab, flap, evaluator, fuselage, vertical stabilizer, and horizontal stabilizer; in accordance with Gulfstream Aerospace GI Customer Bulletin No. 337, dated December 10, 1993.

(1) If no corrosion is detected, repeat the NDT inspections thereafter at intervals not to exceed 18 months.

(2) If any corrosion is detected that meets the criteria of "light" corrosion, as defined by Gulfstream Tool No. ST905–377, repeat the NDT inspections of that component thereafter at intervals not to exceed 12 months.

(3) If any corrosion is detected that meets the criteria of "moderate" corrosion, as defined by Gulfstream Tool No. ST905–377, repeat the NDT inspection of that component thereafter at intervals not to exceed 9 months.

(4) If any corrosion is detected that meets the criteria of "severe" corrosion, as defined by Gulfstream Tool No. ST905–377, prior to further flight, replace the component with a serviceable component, in accordance with the Gulfstream I Maintenance Manual.

(b) Within 9 months after the effective date of this AD, perform a non-destructive test (NDT) to detect corrosion of the lower wing plank splices, in accordance with Gulfstream Aerospace GI Customer Bulletin No. 337, dated December 10, 1993.

(1) If no corrosion is detected, repeat the NDT inspection at intervals not to exceed 18 months.

(2) If any corrosion is detected, prior to further flight, repair in accordance with the customer bulletin.

Reporting Requirement

(c) Within 10 days of performing the inspections required by paragraph (a) of this AD: Submit a report of inspection findings (both positive and negative) to Gulfstream Aerospace Corporation; Attention: Technical Operations—Mail Station D–10; P.O. Box 2206; Savannah, Georgia 31402–0080. Information collection requirements contained in this regulation have been approved by the Office of Management and Budget (OMB) under the provisions of the Paperwork Reduction Act of 1980 (44 U.S.C. 3501 *et seq.*) and have been assigned OMB Control Number 2120–0056.

Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Wichita Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Wichita ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Wichita ACO.

Special Flight Permits

(e) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on May 29, 2001.

Vi L. Lipski,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 01–14145 Filed 6–5–01; 8:45 am]

BILLING CODE 4910–13–U

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 99–NM–290–AD]

RIN 2120–AA64

Airworthiness Directives; McDonnell Douglas Model DC–9–10, –20, –30, –40, and –50 Series Airplanes; and C–9 (Military) Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model DC–9–10, –20, –30, –40, and –50 series airplanes; and C–9 (military) airplanes.

This proposal would require replacing the transformer ballast assembly in the first officer's console with a new, improved ballast assembly. This action is necessary to prevent overheating of the ballast transformers due to aging fluorescent tubes that cause a higher power demand on the ballast transformers, which could result in smoke in the cockpit. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by July 23, 2001.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 99-NM-290-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 99-NM-290-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California.

FOR FURTHER INFORMATION CONTACT: Elvin Wheeler, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5344; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address

specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 99-NM-290-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 99-NM-290-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Discussion

As part of its practice of re-examining all aspects of the service experience of a particular aircraft whenever an accident occurs, the FAA has become aware of instances of smoke emanating from the ballast transformers of the cockpit fluorescent lights on McDonnell Douglas Model DC-9 series airplanes. Investigation revealed that aging fluorescent tubes result in a higher power demand on the ballast transformers, which causes the transformer to overheat. This condition, if not corrected, could result in smoke in the cockpit.

Other Related Rulemaking

The FAA, in conjunction with Boeing and operators of McDonnell Douglas

Model DC-9-10, -20, -30, -40, and -50 series airplanes, and C-9 (military) airplanes, is continuing to review all aspects of the service history of those airplanes to identify potential unsafe conditions and to take appropriate corrective actions. This proposed airworthiness directive (AD) is one of a series of actions identified during that process. The process is continuing and the FAA may consider additional rulemaking actions as further results of the review become available.

Explanation of Relevant Service Information

The FAA has reviewed and approved McDonnell Douglas Alert Service Bulletin DC9-33A114, dated November 1, 1999. The service bulletin describes procedures for replacing the transformer ballast assembly in the first officer's console with a new, improved ballast assembly. Accomplishment of the action specified in the service bulletin is intended to adequately address the identified unsafe condition.

Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other products of this same type design, the proposed AD would require accomplishment of the action specified in the service bulletin described previously.

Cost Impact

There are approximately 836 Model DC-9-10, -20, -30, -40, and -50 series airplanes, and C-9 (military) airplanes of the affected design in the worldwide fleet. The FAA estimates that 543 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 1 work hour per airplane to accomplish the proposed actions, and that the average labor rate is \$60 per work hour. Required parts would cost between \$1,379 and \$1,860 per airplane. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be between \$781,377 and \$1,042,560, or \$1,439 or \$1,920 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this proposed AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time

required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

McDonnell Douglas: Docket 99–NM–290–AD.

Applicability: Model DC–9–10, –20, –30, –40, and –50 series airplanes; and C–9 (military) airplanes; as listed in McDonnell Douglas Alert Service Bulletin DC9–33A114, dated November 1, 1999; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For

airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (c) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent overheating of the ballast transformers due to aging fluorescent tubes that cause a higher power demand on the ballast transformers, which could result in smoke in the cockpit, accomplish the following:

Replacement

(a) Within 12 months after the effective date of the AD, replace the transformer ballast assembly from the first officer's console with a new, improved transformer ballast assembly, in accordance with McDonnell Douglas Alert Service Bulletin DC9–33A114, dated November 1, 1999.

Spares

(b) As of the effective date of this AD, no person shall install a transformer assembly, part number BA170–1, –11, –21, or "MOD.B, on any airplane.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permit

(d) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on May 29, 2001.

Vi L. Lipski,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 01–14144 Filed 6–5–01; 8:45 am]

BILLING CODE 4910–13–U

DEPARTMENT OF THE INTERIOR

Office of Surface Mining Reclamation and Enforcement

30 CFR Part 934

[SPATS No. ND–042–FOR; North Dakota State Program Amendment XXXI]

Permanent Program and Abandoned Mine Land Reclamation Plan Submissions; North Dakota

AGENCY: Office of Surface Mining Reclamation and Enforcement, Interior.

ACTION: Proposed rule; public comment period and opportunity for public hearing on proposed amendment.

SUMMARY: The Office of Surface Mining Reclamation and Enforcement (OSM) is announcing receipt of a proposed amendment to the North Dakota regulatory program (hereinafter, the "North Dakota program") under the Surface Mining Control and Reclamation Act of 1977 (SMCRA). North Dakota proposes very minor revisions to its statute concerning surface coal mining and reclamation operations such as changing the name of the "Superintendent of the State Historical Board" to the "Director of the State Historical Society," and changing some of the language in the statute to make it plainer and easier to understand.

DATES: We will accept written comments on this amendment until 4 p.m., m.d.t. July 6, 2001. If requested, we will hold a public hearing on the amendment on July 2, 2001. We will accept requests to speak until 4 p.m., m.d.t. on June 21, 2001.

ADDRESSES: You should mail or hand deliver written comments and requests to speak at the hearing to Guy Padgett at the address listed below.

You may review copies of the North Dakota program, this amendment, a listing of any scheduled public hearings, and all written comments received in response to this document at the addresses listed below during normal business hours, Monday through Friday, excluding holidays. You may receive one free copy of the amendment by contacting OSM's Casper Field Office. Guy Padgett, Casper Field Office
Director
Office of Surface Mining Reclamation and Enforcement
100 East "B" Street
Federal Building, Room 2128
Casper, WY 82601–1918
James R. Deutsch, Director
Reclamation Division
North Dakota Public Service
Commission