

“significant regulatory action” under Executive Order 12866; (2) is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**2001-16-13 Airbus Industrie:** Amendment 39-12382. Docket 2001-NM-70-AD.

**Applicability:** Model A330 airplanes, serial numbers 301, 321, 322, 323, 341, 342, and 343, certificated in any category; except airplanes on which Airbus Industrie Modification 46636 has been accomplished in production or which have been modified in service in accordance with Airbus Service Bulletin A330-53-3090, dated March 9, 1999; Revision 01, dated July 6, 1999; or Revision 02, dated January 9, 2001.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent fatigue cracking of the fuselage longitudinal buttstrap, which could result in reduced structural integrity of the fuselage, accomplish the following:

#### Inspection

(a) Prior to the accumulation of 15,000 total flight cycles: Perform a roto-test inspection to detect cracks of the fastener holes at frame 31, frame 37.1, and stringer 9, in accordance with Airbus Service Bulletin A330-53-3090, Revision 02, dated January 9, 2001.

#### Reinforcement

(b) If no cracks are detected during the inspection performed in accordance with paragraph (a) of this AD, prior to further flight, reinforce the fuselage structure between frames 31 and 37.1, in accordance with Airbus Service Bulletin A330-53-3090, Revision 02, dated January 9, 2001.

#### Follow-up Inspection

(c) If any crack is detected during the inspection performed in accordance with paragraph (a) of this AD, prior to further flight, perform a high frequency eddy current (HFEC) inspection to determine the crack length, in accordance with Airbus Service Bulletin A330-53-3090, Revision 02, dated January 9, 2001. Prior to further flight, repair the crack in accordance with a method approved by either the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate; or the Direction Generale de l'Aviation Civile (or its delegated agent).

#### Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM-116. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM-116.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM-116.

#### Special Flight Permits

(e) Special flight permits may be issued in accordance with §§ 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

#### Incorporation by Reference

(f) Except as required by paragraph (c) of this AD, the actions shall be done in accordance with Airbus Service Bulletin A330-53-3090, Revision 02, dated January 9, 2001. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Airbus Industrie, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind

Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

**Note 3:** The subject of this AD is addressed in French airworthiness directive 2001-075(B), dated March 17, 2001.

#### Effective Date

(g) This amendment becomes effective on September 7, 2001.

Issued in Renton, Washington, on August 15, 2001.

**Vi L. Lipski,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01-21103 Filed 8-22-01; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2001-NE-15-AD; Amendment 39-12405; AD 2001-17-14]

RIN 2120-AA64

#### Airworthiness Directives; CFM International CFM56 Series Turbofan Engines

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** This amendment adopts a new airworthiness directive (AD) that is applicable to CFM International (CFMI) CFM56-5C4/1 series turbofan engines. This action requires that the LPT conical support, P/N 337-002-407-0, installed in CFM56-5C4/1 engines, be removed from service at or before reaching the cyclic life limit of 9,350 cycles-since-new (CSN). This amendment is prompted by the discovery of an error in the Time Limits Section of Chapter 5 of the CFM56-5C Engine Shop Manual. The manual incorrectly lists the published cyclic life limit of the CFMI CFM56-5C4/1 LPT conical support, (P/N) 337-002-407-0, as 15,000 CSN, rather than the certified value of 9,350 CSN. The actions specified in this AD are intended to prevent LPT conical supports from remaining in service beyond their certified cyclic life limit, which could result in an uncontained engine failure and damage to the airplane.

**DATES:** Effective September 7, 2001.

Comments for inclusion in the Rules Docket must be received on or before October 22, 2001.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation

Administration (FAA), New England Region, Office of the Regional Counsel, Attention: Rules Docket No. 2001-NE-15-AD, 12 New England Executive Park, Burlington, MA 01803-5299. Comments may also be sent via the Internet using the following address: "9-ane-adcomment@faa.gov". Comments sent via the Internet must contain the docket number in the subject line.

**FOR FURTHER INFORMATION CONTACT:**

Diane Cook, Aerospace Engineer, Engine Certification Office, FAA, Engine and Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803-5299; telephone (781) 238-7133; fax (781) 238-7199.

**SUPPLEMENTARY INFORMATION:** The FAA has been informed by CFMI that the cyclic life limit of the CFM56-5C4/1 Low Pressure Turbine (LPT) conical support, P/N 337-002-407-0, published in the Time Limits Section of Chapter 5 of the CFM56-5C Engine Shop Manual is incorrect, and will be corrected at the next revision to the manual. The incorrect published cyclic life reads 15,000 cycles since new (CSN) instead of the certified value of 9,350 CSN. This condition, if not corrected, could result in the LPT conical support remaining in service beyond its certified cyclic life limit, which could result in an uncontained engine failure and damage to the airplane. Currently, the CFMI fleet has not incorporated LPT Conical Support, P/N 337-002-407-0, into any of the CFM56-5C4/1 engines. Therefore, this AD will not result in any economic impact on the U.S. operators. However, as the operators convert CMF56-5C engines into different model configurations, there is a potential that LPT Conical Support, P/N 337-002-407-0, will be installed in the CFM56-5C4/1 engine model.

**FAA's Determination of An Unsafe Condition and Proposed Actions**

Although this affected engine model is not used on any airplanes that are registered in the United States, the possibility exists this engine model could be used on airplanes that are registered in the United States in the future. This AD reestablishes the certified cyclic life limit for LPT conical support P/N 337-002-407-0, by requiring the replacement of LPT conical support P/N 337-002-407-0, at or before accumulating 9,350 CSN. This AD is being issued to prevent LPT conical supports from remaining in service beyond their certified cyclic life limit, which could result in an uncontained engine failure and damage to the airplane.

**Immediate Adoption of This AD**

Since there are no domestic operators of this engine model, notice and opportunity for prior public comment are unnecessary. Therefore, a situation exists that allows the immediate adoption of this regulation.

**Comments Invited**

Although this action is in the form of a final rule that involves requirements affecting flight safety and, thus, was not preceded by notice and an opportunity for public comment, comments are invited on this rule. Interested persons are invited to comment on this rule by submitting such written data, views, or arguments as they may desire. Communications should identify the Rules Docket number and be submitted in triplicate to the address specified under the caption **ADDRESSES**. All communications received on or before the closing date for comments will be considered, and this rule may be amended in light of the comments received. Factual information that supports the commenter's ideas and suggestions is extremely helpful in evaluating the effectiveness of the AD action and determining whether additional rulemaking action would be needed.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the rule that might suggest a need to modify the rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report that summarizes each FAA-public contact concerned with the substance of this AD will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NE-15-AD." The postcard will be date stamped and returned to the commenter.

**Regulatory Impact**

This final rule does not have federalism implications, as defined in Executive Order 13132, because it would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government. Accordingly, the FAA has not consulted with state authorities prior to publication of this final rule.

The FAA has determined that this regulation is an emergency regulation that must be issued immediately to correct an unsafe condition in aircraft, and is not a "significant regulatory action" under Executive Order 12866. It has been determined further that this action involves an emergency regulation under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979). If it is determined that this emergency regulation otherwise would be significant under DOT Regulatory Policies and Procedures, a final regulatory evaluation will be prepared and placed in the Rules Docket. A copy of it, if filed, may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Safety.

**Adoption of the Amendment**

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

2. Section 39.13 is amended by adding the following new airworthiness directive:

**2001-17-14 CFM International:**

Amendment 39-12405. Docket 2001-NE-15-AD.

**Applicability**

This airworthiness directive (AD) is applicable to CFM International (CFMI) CFM56-5C4/1 series turbofan engines with low pressure turbine (LPT) conical support, part number (P/N) 337-002-407-0, installed. These engines are installed on, but not limited to Airbus Industrie A320 series airplanes.

**Note 1:** This AD applies to each engine identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For engines that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not

been eliminated, the request should include specific proposed actions to address it.

#### Compliance

Compliance with this AD is required as indicated.

To prevent an LPT conical support from remaining in service beyond its certified cyclic life limit, which could result in an uncontained engine failure and damage to the airplane, accomplish the following:

(a) Remove LPT conical support, P/N 337-002-407-0, at or before accumulating 9,350 cycles-since-new (CSN) and replace with a serviceable part.

(b) After the effective date of this AD, do not install any LPT conical support, P/N 337-002-407-0 with 9,350 CSN or greater, into CFM56-5C4/1 model engines.

(c) This AD reestablishes the certified cyclic life limit for LPT conical support, P/N 337-002-407-0, which was published incorrectly in the Time Limits Section of Chapter 5 of the CFM56-5C Engine Shop Manual. This Manual will be revised to correct this error. Thereafter, except as provided in paragraph (d) of this AD, no alternative cyclic retirement life limits may be approved for LPT conical support, P/N 337-002-407-0.

#### Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Engine Certification Office (ECO). Operators must submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, ECO.

**Note 2:** Information concerning the existence of approved alternative methods of compliance with this airworthiness directive, if any, may be obtained from the ECO.

#### Effective Date of This AD

(e) This amendment becomes effective on September 7, 2001.

Issued in Burlington, Massachusetts, on August 15, 2001.

**Jay J. Pardee,**

Manager, Engine and Propeller Directorate,  
Aircraft Certification Service.

[FR Doc. 01-21221 Filed 8-22-01; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 97

[Docket No. 30265; Amdt. No. 2066]

#### Standard Instrument Approach Procedures; Miscellaneous Amendments

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This amendment establishes, amends, suspends, or revokes Standard Instrument Approach Procedures (SIAPs) for operations at certain airports. These regulatory actions are needed because of changes occurring in the National Airspace System, such as the commissioning of new navigational facilities, addition of new obstacles, or changes in air traffic requirements. These changes are designed to provide safe and efficient use of the navigable airspace and to promote safe flight operations under instrument flight rules at the affected airports.

**DATES:** An effective date for each SIAP is specified in the amendatory provisions.

Incorporation by reference—approved by the Director of the Federal Register on December 31, 1980, and reapproved as of January 1, 1982.

**ADDRESSES:** Availability of matter incorporated by reference in the amendment is as follows:

*For Examination—*

1. FAA Rules Docket, FAA Headquarters Building, 800 Independence Avenue, SW., Washington, DC 20591;

2. The FAA Regional Office of the region in which affected airport is located; or

3. The Flight Inspection Area Office which originated the SIAP.

*For Purchase—*Individual SIAP copies may be obtained from:

1. FAA Public Inquiry Center (APA-200), FAA Headquarters Building, 800 Independence Avenue, SW., Washington, DC 20591; or

2. The FAA Regional Office of the region in which the affected airport is located.

*By Subscription—*Copies of all SIAPs, mailed once every 2 weeks, are for sale by the Superintendent of Documents, US Government Printing Office, Washington, DC 20402.

#### FOR FURTHER INFORMATION CONTACT:

Donald P. Pate, Flight Procedure Standards Branch (AMCAFS-420), Flight Technologies and Programs Division, Flight Standards Service, Federal Aviation Administration, Mike Monroney Aeronautical Center, 6500 South MacArthur Blvd. Oklahoma City, OK. 73169 (Mail Address: P.O. Box 25082 Oklahoma City, OK. 73125) telephone: (405) 954-4164.

**SUPPLEMENTARY INFORMATION:** This amendment to part 97 of the Federal Aviation Regulations (14 CFR part 97) establishes, amends, suspends, or revokes Standard Instrument Approach Procedures (SIAPs). The complete regulatory description on each SIAP is contained in the appropriate FAA Form

8260 and the National Flight Data Center (FDC)/Permanent (P) Notices to Airmen (NOTAM) which are incorporated by reference in the amendment under 5 U.S.C. 552(a), 1 CFR part 51, and § 97.20 of the Federal Aviation's Regulations (FAR). Materials incorporated by reference are available for examination or purchase as stated above.

The large number of SIAPs, their complex nature, and the need for a special format make their verbatim publication in the **Federal Register** expensive and impractical. Further, airmen do not use the regulatory text of the SIAPs, but refer to their graphic depiction of charts printed by publishers of aeronautical materials. Thus, the advantages of incorporation by reference are realized and publication of the complete description of each SIAP contained in FAA form documents is unnecessary. The provisions of this amendment state the affected CFR (and FAR) sections, with the types and effective dates of the SIAPs. This amendment also identifies the airport, its location, the procedure identification and the amendment number.

#### The Rule

This amendment to part 97 of the Federal Aviation Regulations (14 CFR part 97) establishes, amends, suspends, or revokes SIAPs. For safety and timeliness of change considerations, this amendment incorporates only specific changes contained in the content of the following FDC/P NOTAMs for each SIAP. The SIAP information in some previously designated FDC/Temporary (FDC/T) NOTAMs is of such duration as to be permanent. With conversion to FDC/P NOTAMs, the respective FDC/T NOTAMs have been canceled.

The FDC/P NOTAMs for the SIAPs contained in this amendment are based on the criteria contained in the U.S. Standard for Terminal Instrument Procedures (TERPS). In developing these chart changes to SIAPs by FDC/P NOTAMs, the TERPS criteria were applied to only these specific conditions existing at the affected airports. All SIAP amendments in this rule have been previously issued by the FAA in a National Flight Data Center (FDC) Notice to Airmen (NOTAM) as an emergency action of immediate flight safety relating directly to published aeronautical charts. The circumstances which created the need for all these SIAP amendments requires making them effective in less than 30 days.

Further, the SIAPs contained in this amendment are based on the criteria contained in the TERPS. Because of the