

Actions	Compliance	Procedures
(5) Do not install, on any affected airplane, a P/N 1847-A through 1847-L, 1848-A through 1848-F, or 1862-A through 1862-L MLG radius rod, unless it has been inspected and is found to meet the conductivity or hardness standard specified in the service information.	As of the effective date of this AD .....	In accordance with British Aerospace Alert Service Bulletin 32-A-JA010740, Revision 2, Issued: July 23, 2001.

**Note 1:** The compliance time of this AD differs from that specified in British Aerospace Alert Service Bulletin 32-A-JA-010740, Revision 2, Issued July 23, 2001. This AD takes precedence over any other information.

**Note 2:** British Aerospace Alert Service Bulletin 32-JA010740, Revision 2, Issued: July 23, 2001, specifies reporting the results of the inspections to British

Aerospace Regional Aircraft. The FAA highly recommends that each owner/operator submit this information. British Aerospace and the British Civil Airworthiness Authority (CAA) will use this information to determine whether further action is necessary. The FAA will evaluate the information from the British CAA and may initiate further rulemaking action.

(e) *Can I comply with this AD in any other way?* You may use an alternative method of compliance or adjust the compliance time if:

(1) Your alternative method of compliance provides an equivalent level of safety; and

(2) The Manager, Small Airplane Directorate, approves your alternative. Submit your request through an FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Small Airplane Directorate.

**Note 3:** This AD applies to each airplane identified in paragraph (a) of this AD, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (e) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if you have not eliminated the unsafe condition, specific actions you propose to address it.

(f) *Where can I get information about any already-approved alternative methods of compliance?* Contact Doug Rudolph, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4059; facsimile: (816) 329-4090.

(g) *What if I need to fly the airplane to another location to comply with this AD?* The FAA can issue a special flight permit under sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate your airplane to a location where you can accomplish the requirements of this AD.

(h) *How do I get copies of the documents referenced in this AD?* You may get copies of the documents referenced in this AD from

British Aerospace Regional Aircraft, Prestwick International Airport, Ayrshire, KA9 2RW, Scotland; telephone: (01292) 479888; facsimile: (01292) 479703. You may view these documents at FAA, Central Region, Office of the Regional Counsel, 901 Locust, Room 506, Kansas City, Missouri 64106.

**Note 4:** The subject of this AD is addressed in British AD Number 005-07-2001, not dated.

Issued in Kansas City, Missouri, on October 1, 2001.

**Dorenda D. Baker,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01-25048 Filed 10-4-01; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2001-NM-52-AD]

RIN 2120-AA64

#### Airworthiness Directives; McDonnell Douglas Model MD-11 Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 series airplanes. This proposal would require an inspection to detect arcing damage of the terminal strips, surrounding structure, and electrical cables in the forward cargo compartment; and repair or replacement of any damaged part with a new part. This proposal also would require modification of the applicable terminal strip installation in the cargo compartment, and replacement of the applicable terminal strips in the cargo compartment with new strips. This action is necessary to prevent arcing and consequent damage to the terminal strips and adjacent structure and smoke/fire in the forward cargo compartment.

This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by November 19, 2001.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-52-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001-NM-52-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California.

**FOR FURTHER INFORMATION CONTACT:** Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:**

#### Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address

specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.

- For each issue, state what specific change to the proposed AD is being requested.

- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NM-52-AD." The postcard will be date stamped and returned to the commenter.

#### Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-52-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

#### Discussion

As part of its practice of re-examining all aspects of the service experience of a particular aircraft whenever an accident occurs, the FAA has become aware of an incident in which arcing occurred between the power feeder cables and terminal strip support brackets on a McDonnell Douglas Model MD-11 series airplane. Investigation revealed that insufficient clearance exists between the terminal strips and the associated support brackets. This condition, if not corrected, could result in arcing and consequent damage to the terminal strips and adjacent structure and smoke/fire in the forward cargo compartment.

This incident is not considered to be related to an accident that occurred off

the coast of Nova Scotia involving a McDonnell Douglas Model MD-11 series airplane. The cause of that accident is still under investigation.

#### Other Related Rulemaking

The FAA, in conjunction with Boeing and operators of Model MD-11 series airplanes, is continuing to review all aspects of the service history of those airplanes to identify potential unsafe conditions and to take appropriate corrective actions. This proposed airworthiness directive (AD) is one of a series of actions identified during that process. The process is continuing and the FAA may consider additional rulemaking actions as further results of the review become available.

#### Explanation of Relevant Service Information

The FAA has reviewed and approved McDonnell Douglas Alert Service Bulletin MD11-24A174, dated January 31, 2001. The service bulletin describes procedures for a general visual inspection to detect arcing damage of the terminal strips, surrounding structure, and electrical cables in the forward cargo compartment; and repair or replacement of any damaged part with a new part. The service bulletin also describes procedures for modification of the applicable terminal strip installation in the cargo compartment, and replacement of the applicable terminal strips in the cargo compartment with new strips. The modification and replacement include inspecting for damaged cables and repairing of any damaged cable. Accomplishment of the actions specified in the service bulletin is intended to adequately address the identified unsafe condition.

#### Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other products of this same type design, the proposed AD would require accomplishment of the actions specified in the service bulletin described previously, except as discussed below.

#### Differences Between Proposed Rule and Service Bulletin

Operators should note that the service bulletin specifies to repair damaged structure per the Structural Repair Manual (SRM). However, the SRM does not provide adequate procedures for repair of certain structural material. Therefore, this proposed AD would require the repair of damaged structure that is not covered in the SRM to be

accomplished per a method approved by the FAA.

#### Cost Impact

There are approximately 154 Model MD-11 series airplanes of the affected design in the worldwide fleet. The FAA estimates that 59 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 6 work hours per airplane to accomplish the proposed actions, and that the average labor rate is \$60 per work hour. The manufacturer has committed previously to its customers that it will bear the cost of replacement parts. As a result, the cost of those parts is not attributable to this proposed AD. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$21,240, or \$360 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. However, the FAA has been advised that manufacturer warranty remedies are available for labor costs associated with accomplishing the actions required by this proposed AD. Therefore, the future economic cost impact of this rule on U.S. operators may be less than the cost impact figure indicated above.

The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

#### Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory

Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption "ADDRESSES."

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

**McDonnell Douglas:** Docket 2001–NM–52–AD.

**Applicability:** Model MD–11 series airplanes, as listed in McDonnell Douglas Alert Service Bulletin MD11–24A174, dated January 31, 2001; certificated in any category.

**Note 1:** This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

**Compliance:** Required as indicated, unless accomplished previously.

To prevent arcing and consequent damage to the terminal strips and adjacent structure and smoke/fire in the forward cargo compartment, accomplish the following:

#### Inspection, Modification, Replacement, and Corrective Actions, If Necessary

(a) Within 18 months after the effective date of this AD, do the actions specified in paragraphs (a)(1), (a)(2), and (a)(3) of this AD per the Accomplishment Instructions of McDonnell Douglas Alert Service Bulletin MD11–24A174, dated January 31, 2001.

(1) Do a general visual inspection to detect arcing damage of the terminal strips, surrounding structure, and electrical cables in the forward cargo compartment. If any

damage is detected, before further flight, repair or replace the damaged part with a new part, per the service bulletin; except if the type of structural material that has been affected is not covered in the Structural Repair Manual (SRM), repair per a method approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA.

**Note 2:** For the purposes of this AD, a general visual inspection is defined as "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or drop-light, and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

**Note 3:** Where there are differences between the referenced service bulletin and the AD, the AD prevails.

(2) Modify the applicable terminal strip installation in the cargo compartment (including inspection for damaged cables and repair of any damaged cable).

(3) Replace the applicable terminal strips in the cargo compartment with new strips (including inspection for damaged cables and repair of any damaged cable).

#### Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles ACO, FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

**Note 4:** Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

#### Special Flight Permit

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on October 1, 2001.

**Charles Huber,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 01–25065 Filed 10–4–01; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2001–NM–53–AD]

RIN 2120–AA64

#### Airworthiness Directives; McDonnell Douglas Model MD–11 Series Airplanes

**AGENCY:** Federal Aviation Administration, DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD–11 series airplanes. This proposal would require performing an inspection of the wiring of the Firex bottle discharge cartridge of the No. 2 engine at station Y=2163.00 bulkhead for chafing on adjacent structure and damaged wiring; repairing damaged wires; and repositioning wires, if necessary. This action is necessary to prevent chafing and possible damage to the wiring of the Firex bottle discharge cartridge of the No. 2 engine, which could result in improper distribution of the fire extinguishing agent within the No. 2 engine in the event of a fire. This action is intended to address the identified unsafe condition.

**DATES:** Comments must be received by November 19, 2001.

**ADDRESSES:** Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM–114, Attention: Rules Docket No. 2001–NM–53–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227–1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001–NM–53–AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service