

(b) Except as provided in paragraph (c) of this AD, and notwithstanding contrary provisions in section 43.16 of the Federal Aviation Regulations (14 CFR 43.16), these mandatory inspections shall be performed only in accordance with the Time Limits Section of the manufacturer's ICA.

Alternative Methods of Compliance

(c) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Engine Certification Office (ECO). Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector (PMI), who may add comments and then send it to the ECO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this airworthiness directive, if any, may be obtained from the ECO.

Continuous Airworthiness Maintenance Program

(d) FAA-certificated air carriers that have an approved continuous airworthiness maintenance program in accordance with the record keeping requirement of § 121.369 (c) of the Federal Aviation Regulations [14 CFR 121.369 (c)] must maintain records of the mandatory inspections that result from revising the Time Limits Section of the Instructions for Continuous Airworthiness (ICA) and the air carrier's continuous airworthiness program. Alternately, certificated air carriers may establish an approved system of record retention that provides a method for preservation and retrieval of the maintenance records that include the inspections resulting from this AD, and include the policy and procedures for implementing this alternate method in the air carrier's maintenance manual required by § 121.369 (c) of the Federal Aviation Regulations [14 CFR 121.369 (c)]; however, the alternate system must be accepted by the appropriate PMI and require the maintenance records be maintained either indefinitely or until the work is repeated. Records of the piece-part inspections are not required under § 121.380 (a) (2) (vi) of the Federal Aviation Regulations [14 CFR 121.380 (a) (2) (vi)]. All other Operators must maintain the records of mandatory inspections required by the applicable regulations governing their operations.

Note 3: The requirements of this AD have been met when the engine shop manual changes are made and air carriers have modified their continuous airworthiness maintenance plans to reflect the requirements in the engine shop manuals.

Issued in Burlington, Massachusetts, on September 25, 2001.

Jay J. Pardee,

Manager, Engine and Propeller Directorate, Aircraft Certification Service.

[FR Doc. 01-25077 Filed 10-4-01; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2001-NM-59-AD]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain McDonnell Douglas Model MD-11 series airplanes. This proposal would require installation of protective sleeving on the right emergency alternating current wire assembly of the overhead switch panel. This action is necessary to ensure that protective sleeving is installed on the right emergency alternating current (AC) wire assembly of the overhead switch panel. Lack of such sleeving could result in loss of redundant electrical power during certain cockpit overhead wiring faults. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by November 19, 2001.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-59-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001-NM-59-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the FAA, Transport

Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received. Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NM-59-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No.

2001–NM–59–AD, 1601 Lind Avenue, SW., Renton, Washington 98055–4056.

Discussion

As part of its practice of re-examining all aspects of the service experience of a particular aircraft whenever an accident occurs, the FAA has become aware that protective sleeving was not installed during production of McDonnell Douglas Model MD–11 series airplanes, fuselage numbers 0527 through 0646 inclusive. A production change improperly provided procedures for removing the sleeving. The protective sleeving provides mechanical segregation for the right emergency alternating current (AC) wire assembly of the overhead switch panel. Lack of protective sleeving on the right emergency AC wire assembly of the overhead switch panel, if not corrected, could result in loss of redundant electrical power during certain cockpit overhead wiring faults.

These findings are not considered to be related to an accident that occurred off the coast of Nova Scotia involving a McDonnell Douglas Model MD–11 series airplane. The cause of that accident is still under investigation.

Other Related Rulemaking

The FAA, in conjunction with Boeing and operators of Model MD–11 series airplanes, is continuing to review all aspects of the service history of those airplanes to identify potential unsafe conditions and to take appropriate corrective actions. This proposed airworthiness directive (AD) is one of a series of actions identified during that process. The process is continuing and the FAA may consider additional rulemaking actions as further results of the review become available.

Explanation of Relevant Service Information

The FAA has reviewed and approved Boeing Service Bulletin MD11–24–197, dated May 16, 2001, which describes procedures for installation of protective sleeving on the right emergency AC wire assembly of the overhead switch panel. Accomplishment of the action specified in the service bulletin is intended to adequately address the identified unsafe condition.

Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other products of this same type design, the proposed AD would require accomplishment of the actions specified in the service bulletin described previously.

Cost Impact

There are approximately 119 Model MD–11 series airplanes of the affected design in the worldwide fleet. The FAA estimates that 34 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 4 work hours per airplane to accomplish the proposed actions, and that the average labor rate is \$60 per work hour. The manufacturer has committed previously to its customers that it will bear the cost of parts. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$8,160, or \$240 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this proposed AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a “significant regulatory action” under Executive Order 12866; (2) is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

McDonnell Douglas: Docket 2001–NM–59–AD.

Applicability: Model MD–11 series airplanes, as listed in Boeing Service Bulletin MD11–24–197, dated May 16, 2001; certificated in any category.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To ensure that protective sleeving is installed on the right emergency alternating current (AC) wire assembly of the overhead switch panel, accomplish the following:

Installation

(a) Within 18 months after the effective date of this AD, install protective sleeving on the right emergency wire assembly of the overhead switch panel, per Boeing Service Bulletin MD11–24–197, dated May 16, 2001.

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, Los Angeles Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, Los Angeles ACO.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the Los Angeles ACO.

Special Flight Permit

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Issued in Renton, Washington, on October 1, 2001.

Charles Huber,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.
[FR Doc. 01-25070 Filed 10-4-01; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2001-NM-57-AD]

RIN 2120-AA64

Airworthiness Directives; McDonnell Douglas Model MD-11 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the superseding of an existing airworthiness directive (AD), applicable to certain McDonnell Douglas Model MD-11 series airplanes, that currently requires a one-time detailed visual inspection of the wire bundle installation behind the first observer's station to detect damaged or chafed wires; and corrective action, if necessary. This action would require an inspection of the wire bundle installation behind the first observer's station to detect damaged or chafed wires, and repair, if necessary. This action also would require installing a grommet around the lower edge of the feed-through; replacing the support bracket with a new bracket; and relocating the support clamp of the wire bundle; as applicable. The proposed AD also expands the applicability of the existing AD to include additional airplanes. This proposal is prompted by the FAA's determination that the existing support bracket and the location of the support clamp of the wire bundle may not adequately preclude the wire bundle contained in the feed-through behind the first observer's station from contacting the bottom portion of the feed-through. The actions specified by the proposed AD are intended to prevent such contact, which could cause cable chafing, electrical arcing, smoke, or fire in the cockpit.

DATES: Comments must be received by November 19, 2001.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-57-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9:00 a.m. and 3:00 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001-NM-57-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Boeing Commercial Aircraft Group, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024). This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT:

Brett Portwood, Aerospace Engineer, Systems and Equipment Branch, ANM-130L, FAA, Transport Airplane Directorate, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5350; fax (562) 627-5210.

SUPPLEMENTARY INFORMATION:**Comments Invited**

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.

- For each issue, state what specific change to the proposed AD is being requested.

- Include justification (e.g., reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NM-57-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-57-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Discussion

On February 10, 2000, the FAA issued AD 2000-03-13, amendment 39-11572 (65 FR 8028, February 17, 2000), applicable to certain McDonnell Douglas Model MD-11 series airplanes, to require a one-time detailed visual inspection of the wire bundle installation behind the first observer's station to detect damaged or chafed wires; and corrective action, if necessary. That action was prompted by a report indicating that the wire bundle contained in the feed-through behind the first observer's station was contacting the bottom portion of the feed-through. The requirements of that AD are intended to prevent such contact, which could cause cable chafing, electrical arcing, smoke, or fire in the cockpit.

Actions Since Issuance of Previous Rule

Since the issuance of AD 2000-03-13, the FAA, in conjunction with Boeing, has determined that the existing support bracket and the location of the support clamp of the wire bundle may not adequately preclude the wire bundle contained in the feed-through behind the first observer's station from contacting the bottom portion of the feed-through.