

modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (d) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent peeling of the paint and markings from the dust covers for the flight data recorder (FDR) and cockpit voice recorder (CVR) equipment due to hydraulic mist from the actuators, which could result in the inability to identify the FDR and CVR equipment in the event of an accident-recovery mission, accomplish the following:

One-Time Inspection and Corrective Actions

(a) For airplanes having serial numbers 7003 through 7067 inclusive, and 7069 through 7570 inclusive: Within 18 months after the effective date of this AD, do a general visual inspection of the dust cover for the FDR to determine if a chemical agent resistant coating has been applied to the dust cover. Dust covers that have had a protective coating applied are identified through the markings specified in the service bulletin. Do the inspection per Part A of the Accomplishment Instructions of Canadair Regional Jet Service Bulletin 601R-31-026, dated October 12, 2001; excluding the Service Bulletin Comment Sheet—Facsimile Reply Sheet and the CRJ 100/200 Service Bulletin Compliance Facsimile Reply Sheet.

(1) If specified markings are present, no further action is required by this paragraph.

(2) If specified markings are not present, before further flight, do the action required by either paragraph (a)(2)(i) or (a)(2)(ii) of this AD:

(i) Rework the FDR dust cover per Part B of the Accomplishment Instructions of the service bulletin; or

(ii) Replace the FDR dust cover with a new dust cover per Part C of the Accomplishment Instructions of the service bulletin.

Note 2: For the purposes of this AD, a general visual inspection is defined as: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

(b) For airplanes having serial numbers 7003 through 7067 inclusive, and 7069 through 7573 inclusive: Within 18 months after the effective date of this AD, do a

general visual inspection of the CVR dust cover to determine if a chemical agent resistant coating has been applied to the dust cover. Dust covers that have had a protective coating applied are identified through the markings specified in the service bulletin. Do the inspection per Part A of the Accomplishment Instructions of Bombardier Canadair Regional Jet Service Bulletin 601R-23-056, dated October 12, 2001; excluding Comment Sheet—Facsimile Reply Sheet, and CRJ 100/200 Service Bulletin Compliance Facsimile Reply Sheet.

(1) If specified markings are present, no further action is required by this paragraph.

(2) If specified markings are not present, before further flight, do the action required by either paragraph (b)(2)(i) or (b)(2)(ii) of this AD:

(i) Rework the CVR dust cover per Part B of the Accomplishment Instructions of the service bulletin; or

(ii) Replace the CVR dust cover with a new dust cover per Part C of the Accomplishment Instructions of the service bulletin.

Parts Installation

(c) As of the effective date of this AD, no person shall install an FDR dust cover, part number (P/N) 074E0198-00; or a CVR dust cover, P/N 075E0604-00 or 9300A218S; unless the rework action required by paragraphs (a)(2)(i) and (b)(2)(i) of this AD, as applicable, has been done.

Alternative Methods of Compliance

(d) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, New York Aircraft Certification Office (ACO), FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, New York ACO.

Note 3: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the New York ACO.

Special Flight Permits

(e) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Note 4: The subject of this AD is addressed in Canadian airworthiness directive CF-2001-45, dated December 3, 2001.

Issued in Renton, Washington, on January 23, 2003.

Vi L. Lipski,

*Manager, Transport Airplane Directorate,
Aircraft Certification Service*

[FR Doc. 03-2098 Filed 1-29-03; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2001-NM-269-AD]

RIN 2120-AA64

Airworthiness Directives; Dassault Model Falcon 900 EX and Mystere-Falcon 900 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This document proposes the adoption of a new airworthiness directive (AD) that is applicable to certain Dassault Model Falcon 900 EX and Mystere-Falcon 900 series airplanes. This proposal would require installing an attachment support assembly for the fire extinguishing piping in the baggage compartment. This action is necessary to prevent distortion of the fire extinguishing discharge nozzle as a result of the nozzle not being secure, which could result in poor diffusion of the fire extinguishing agent in the event of a fire in the baggage compartment. This action is intended to address the identified unsafe condition.

DATES: Comments must be received by March 3, 2003.

ADDRESSES: Submit comments in triplicate to the Federal Aviation Administration (FAA), Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-269-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056. Comments may be inspected at this location between 9 a.m. and 3 p.m., Monday through Friday, except Federal holidays. Comments may be submitted via fax to (425) 227-1232. Comments may also be sent via the Internet using the following address: 9-anm-nprmcomment@faa.gov. Comments sent via fax or the Internet must contain "Docket No. 2001-NM-269-AD" in the subject line and need not be submitted in triplicate. Comments sent via the Internet as attached electronic files must be formatted in Microsoft Word 97 for Windows or ASCII text.

The service information referenced in the proposed rule may be obtained from Dassault Falcon Jet, PO Box 2000, South Hackensack, New Jersey 07606. This information may be examined at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-2125; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested persons are invited to participate in the making of the proposed rule by submitting such written data, views, or arguments as they may desire. Communications shall identify the Rules Docket number and be submitted in triplicate to the address specified above. All communications received on or before the closing date for comments, specified above, will be considered before taking action on the proposed rule. The proposals contained in this action may be changed in light of the comments received.

Submit comments using the following format:

- Organize comments issue-by-issue. For example, discuss a request to change the compliance time and a request to change the service bulletin reference as two separate issues.
- For each issue, state what specific change to the proposed AD is being requested.
- Include justification (*e.g.*, reasons or data) for each request.

Comments are specifically invited on the overall regulatory, economic, environmental, and energy aspects of the proposed rule. All comments submitted will be available, both before and after the closing date for comments, in the Rules Docket for examination by interested persons. A report summarizing each FAA-public contact concerned with the substance of this proposal will be filed in the Rules Docket.

Commenters wishing the FAA to acknowledge receipt of their comments submitted in response to this action must submit a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket Number 2001-NM-269-AD." The postcard will be date stamped and returned to the commenter.

Availability of NPRMs

Any person may obtain a copy of this NPRM by submitting a request to the FAA, Transport Airplane Directorate, ANM-114, Attention: Rules Docket No. 2001-NM-269-AD, 1601 Lind Avenue, SW., Renton, Washington 98055-4056.

Discussion

The Direction Générale de l'Aviation Civile (DGAC), which is the

airworthiness authority for France, notified the FAA that an unsafe condition may exist on certain Dassault Model Falcon 900 EX and Model Mystere-Falcon 900 series airplanes. The DGAC advises of a reported case where, after the fire extinguisher for the baggage compartment discharged, the discharge nozzle for the fire extinguishing piping through which the fire extinguishing agent passes, was found damaged. Distortion of the discharge nozzle occurred at the bulkhead feedthrough at frame 30 because the nozzle was not secure. This condition, if not corrected, could result in poor diffusion of the fire extinguishing agent in the event of a fire in the baggage compartment.

Explanation of Relevant Service Information

Dassault has issued Service Bulletins F900EX-142 (for Model Falcon 900 EX series airplanes) and F900-279 (for Model Mystere-Falcon 900 series airplanes), both dated June 7, 2001, including Service Bulletins Compliance page, which describe procedures for installing an attachment support assembly for the fire extinguishing piping in the baggage compartment, and submitting a compliance report to Dassault. Accomplishment of the actions specified in the applicable service bulletin is intended to adequately address the identified unsafe condition. The DGAC classified these service bulletins as mandatory and issued French airworthiness directive 2001-192-034(B), dated May 16, 2001, in order to assure the continued airworthiness of these airplanes in France.

FAA's Conclusions

These airplane models are manufactured in France and are type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the DGAC has kept the FAA informed of the situation described above. The FAA has examined the findings of the DGAC, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

Explanation of Requirements of Proposed Rule

Since an unsafe condition has been identified that is likely to exist or develop on other airplanes of the same

type design registered in the United States, the proposed AD would require accomplishment of the actions specified in the applicable service bulletin described previously.

Differences Between Proposed Rule and Service Bulletin

Operators should note that, although the Accomplishment Instructions of the referenced service bulletin describe procedures for completing and submitting a compliance report, this proposed AD would not require such reporting.

Cost Impact

The FAA estimates that 150 airplanes of U.S. registry would be affected by this proposed AD, that it would take approximately 3 work hours per airplane to accomplish the proposed actions, and that the average labor rate is \$60 per work hour. Required parts would be provided by the manufacturer at no cost to the operators. Based on these figures, the cost impact of the proposed AD on U.S. operators is estimated to be \$27,000, or \$180 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the proposed requirements of this AD action, and that no operator would accomplish those actions in the future if this proposed AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations proposed herein would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this proposal would not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this proposed regulation (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) if promulgated, will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory

Flexibility Act. A copy of the draft regulatory evaluation prepared for this action is contained in the Rules Docket. A copy of it may be obtained by contacting the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration proposes to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. Section 39.13 is amended by adding the following new airworthiness directive:

Dassault Aviation: Docket 2001–NM–269–AD.

Applicability: Model Falcon 900 EX and Mystere-Falcon 900 series airplanes, certificated in any category; excluding those airplanes on which the modification specified in Dassault Service Bulletin F900EX–142 (Modification F900 EX M3368), or Dassault Service Bulletin F900–279 (Modification MF900 M3368); both dated June 7, 2001; as applicable; has been done.

Note 1: This AD applies to each airplane identified in the preceding applicability provision, regardless of whether it has been otherwise modified, altered, or repaired in the area subject to the requirements of this AD. For airplanes that have been modified, altered, or repaired so that the performance of the requirements of this AD is affected, the owner/operator must request approval for an alternative method of compliance in accordance with paragraph (b) of this AD. The request should include an assessment of the effect of the modification, alteration, or repair on the unsafe condition addressed by this AD; and, if the unsafe condition has not been eliminated, the request should include specific proposed actions to address it.

Compliance: Required as indicated, unless accomplished previously.

To prevent distortion of the fire extinguishing discharge nozzle as a result of the nozzle not being secure, which could result in poor diffusion of the fire extinguishing agent in the event of a fire in the baggage compartment, accomplish the following:

Installation

(a) Within 7 months or 330 flight hours after the effective date of this AD, whichever comes first, install an attachment support

assembly for the fire extinguishing piping in the baggage compartment per paragraphs 2.A. through 2.C. of the Accomplishment Instructions of Dassault Service Bulletin F900EX–142 (for Model Falcon 900 EX series airplanes); or Dassault Service Bulletin F900–279 (for Model Mystere-Falcon F900 series airplanes); both dated June 7, 2001; including Service Bulletins Compliance page; as applicable.

Alternative Methods of Compliance

(b) An alternative method of compliance or adjustment of the compliance time that provides an acceptable level of safety may be used if approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA. Operators shall submit their requests through an appropriate FAA Principal Maintenance Inspector, who may add comments and then send it to the Manager, International Branch, ANM–116.

Note 2: Information concerning the existence of approved alternative methods of compliance with this AD, if any, may be obtained from the International Branch, ANM–116.

Special Flight Permits

(c) Special flight permits may be issued in accordance with sections 21.197 and 21.199 of the Federal Aviation Regulations (14 CFR 21.197 and 21.199) to operate the airplane to a location where the requirements of this AD can be accomplished.

Note 3: The subject of this AD is addressed in French airworthiness directive 2001–192–034(B), dated May 16, 2001.

Issued in Renton, Washington, on January 24, 2003.

Ali Bahrami,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 03–2148 Filed 1–29–03; 8:45 am]

BILLING CODE 4910–13–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 71

[Docket No. FAA–2002–13994; Airspace Docket No. 02–AAL–10]

RIN 2120–AA66

Proposed Establishment of Colored Federal Airways; AK

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: This notice proposes to establish two colored Federal airways, Amber–5 (A–5) and Blue 1 (B–1), in Alaska. This action would add to the instrument flight rules (IFR) airway and route structure in Alaska. The FAA is taking this action to enhance safety and

the management of aircraft operations in Alaska.

DATES: Comments must be received on or before March 17, 2003.

ADDRESSES: Send comments on this proposal to the Docket Management System, U.S. Department of Transportation, Room Plaza 401, 400 Seventh Street, SW., Washington, DC 20590–0001. You must identify the docket number FAA–2002–13994/ Airspace Docket No. 02–AAL–10, at the beginning of your comments.

You may also submit comments on the Internet at <http://dms.dot.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1–800–647–5527) is on the plaza level of the Department of Transportation NASSIF Building at the above address.

An informal docket may also be examined during normal business hours at the office of the Regional Air Traffic Division, Federal Aviation Administration, 222 West 7th Avenue, #14, Anchorage, AK 99533.

FOR FURTHER INFORMATION CONTACT: Ken McElroy, Airspace and Rules Division, ATA–400, Office of Air Traffic Airspace Management, Federal Aviation Administration, 800 Independence Avenue, SW., Washington, DC 20591; telephone: (202) 267–8783.

SUPPLEMENTARY INFORMATION:

Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers and be submitted in triplicate to the address listed above. Commenters wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: “Comments to Docket No. FAA–2002–13994/Airspace Docket No. 02–AAL–10.” The postcard will be date/time stamped and returned to the commenter. All communications received on or before the specified