

Related Information

(p) None.

Issued in Burlington, Massachusetts, on March 24, 2004.

Francis A. Favara,

Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.

[FR Doc. 04-7233 Filed 4-5-04; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2002-NM-101-AD; Amendment 39-13554; AD 2004-07-10]

RIN 2120-AA64

Airworthiness Directives; Boeing Model 737-600, -700, -700C, -800, and -900 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Boeing Model 737-600, -700, -700C, -800, and -900 series airplanes, that requires replacement of the proximity switch electronics unit with a new, improved unit. This action is necessary to prevent a malfunction of the aural warning for the landing gear, leading the crew to open the circuit breaker for the aural warning horn which stops the operation of other aural warnings of malfunctions in other systems and, thus, could jeopardize a safe flight and landing. This action is intended to address the identified unsafe condition.

DATES: Effective May 11, 2004.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of May 11, 2004.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Binh V. Tran, Aerospace Engineer, Systems and Equipment Branch, ANM-130S, FAA, Seattle Aircraft Certification

Office, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 917-6485; fax (425) 917-6590.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Boeing Model 737-600, -700, -700C, -800, and -900 series airplanes was published in the **Federal Register** on December 31, 2003 (68 FR 75469). That action proposed to require replacement of the proximity switch electronics unit with a new, improved unit.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. No comments were submitted in response to the proposal or the FAA's determination of the cost to the public.

Conclusion

The FAA has determined that air safety and the public interest require the adoption of the rule as proposed.

Cost Impact

There are approximately 890 airplanes of the affected design in the worldwide fleet. The FAA estimates that 283 airplanes of U.S. registry will be affected by this AD, that it will take approximately 4 work hours per airplane to accomplish the required actions, and that the average labor rate is \$65 per work hour. Required parts will cost approximately \$40 per airplane. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$84,900, or \$300 per airplane.

The cost impact figure discussed above is based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

The manufacturer may cover the cost of replacement parts associated with this AD, subject to warranty conditions. Manufacturer warranty remedies may also be available for labor costs associated with this AD. As a result, the costs attributable to the AD may be less than stated above.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and (3) will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. A final evaluation has been prepared for this action and it is contained in the Rules Docket. A copy of it may be obtained from the Rules Docket at the location provided under the caption **ADDRESSES**.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

■ Accordingly, pursuant to the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. Section 39.13 is amended by adding the following new airworthiness directive:

2004-07-10 Boeing: Amendment 39-13554. Docket 2002-NM-101-AD.

Applicability: Model 737-600, -700, -700C, -800, and -900 series airplanes, as listed in Boeing Alert Service Bulletin 737-32A1343, dated July 26, 2001; certificated in any category.

Compliance: Required as indicated, unless accomplished previously.

To prevent a malfunction of the aural warning for the landing gear, leading the crew to open the circuit breaker for the aural warning horn which stops the operation of other aural warnings of malfunctions in other systems and, thus, could jeopardize a safe flight and landing, accomplish the following:

Replacement

(a) Within 18 months after the effective date of this AD: Remove the Proximity Switch Electronics Unit (PSEU) having part number 285A1600-2 or 285A1600-3 and replace it with a PSEU having part number 285A1600-4, per the Accomplishment Instructions of Boeing Alert Service Bulletin 737-32A1343, dated July 26, 2001.

Parts Installation

(b) As of the effective date of this AD, no person shall install a PSEU having part number 285A1600-2 or 285A1600-3 on any airplane.

Alternative Methods of Compliance

(c) In accordance with 14 CFR 39.19, the Manager, Seattle Aircraft Certification Office, FAA, is authorized to approve alternative methods of compliance (AMOCs) for this AD.

Incorporation by Reference

(d) The actions shall be done in accordance with Boeing Alert Service Bulletin 737-32A1343, dated July 26, 2001. This incorporation by reference was approved by the Director of the Federal Register in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Copies may be obtained from Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207. Copies may be inspected at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

Effective Date

(e) This amendment becomes effective on May 11, 2004.

Issued in Renton, Washington, on March 22, 2004.

Kalene C. Yanamura,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 04-7127 Filed 4-5-04; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. 2002-NM-335-AD; Amendment 39-13550; AD 2004-07-06]

RIN 2120-AA64

Airworthiness Directives; Boeing Model 707 and 720 Series Airplanes

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule.

SUMMARY: This amendment adopts a new airworthiness directive (AD), applicable to certain Boeing Model 707 and 720 series airplanes, that requires repetitive inspections of the upper and lower barrel nuts and bolts that retain

the aft trunnion support fitting of each main landing gear for corrosion, cracks, and loose or missing nuts and bolts; torque checks of the upper and lower bolts to verify the torque is within a specified range; and corrective actions, if necessary. This action is necessary to detect and correct cracking and/or loss of the barrel nuts and bolts that retain the aft trunnion support fitting, which could result in the collapse of the main landing gear upon landing. This action is intended to address the identified unsafe condition.

DATES: Effective May 11, 2004.

The incorporation by reference of certain publications listed in the regulations is approved by the Director of the Federal Register as of May 11, 2004.

ADDRESSES: The service information referenced in this AD may be obtained from Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207. This information may be examined at the Federal Aviation Administration (FAA), Transport Airplane Directorate, Rules Docket, 1601 Lind Avenue, SW., Renton, Washington; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Candice Gerretsen, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 917-6428; fax (425) 917-6590.

SUPPLEMENTARY INFORMATION: A proposal to amend part 39 of the Federal Aviation Regulations (14 CFR part 39) to include an airworthiness directive (AD) that is applicable to certain Boeing Model 707 and 720 series airplanes was published in the *Federal Register* on December 18, 2003 (68 FR 70477). That action proposed to require repetitive inspections of the upper and lower barrel nuts and bolts that retain the aft trunnion support fitting of each main landing gear for corrosion, cracks, and loose or missing nuts and bolts; torque checks of the upper and lower bolts to verify the torque is within a specified range; and corrective actions, if necessary.

Comments

Interested persons have been afforded an opportunity to participate in the making of this amendment. We received no comments on the proposal or on the determination of the cost to the public.

Conclusion

After careful review of the available data, we have determined that air safety

and the public interest require the adoption of the rule as proposed.

Cost Impact

There are approximately 230 airplanes of the affected design in the worldwide fleet. The FAA estimates that 42 airplanes of U.S. registry will be affected by this AD.

It will take approximately 1 work hour per airplane to accomplish the required detailed inspection of the upper and lower barrel nuts and bolts and the torque check. The average labor rate is \$65 per work hour. Based on these figures, the cost impact of the AD on U.S. operators is estimated to be \$2,730, or \$65 per airplane, per inspection and torque check.

It will take approximately 3 work hours per airplane to accomplish the required detailed inspection of the aft trunnion bearing cap. The average labor rate is \$65 per airplane. Based on these figures, the cost impact on U.S. operators is estimated to be \$8,190, or \$195 per airplane.

It will take approximately 4 work hours per airplane to accomplish the required installation of the new Inconel barrel nut and bolt and the main landing gear trunnion. The average labor rate is \$65 per work hour. Based on these figures, the cost on U.S. operators is estimated to be \$10,920, or \$260 per airplane.

Required parts will cost approximately \$3,380 per airplane.

The cost impact figures discussed above are based on assumptions that no operator has yet accomplished any of the requirements of this AD action, and that no operator would accomplish those actions in the future if this AD were not adopted. The cost impact figures discussed in AD rulemaking actions represent only the time necessary to perform the specific actions actually required by the AD. These figures typically do not include incidental costs, such as the time required to gain access and close up, planning time, or time necessitated by other administrative actions.

Regulatory Impact

The regulations adopted herein will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government. Therefore, it is determined that this final rule does not have federalism implications under Executive Order 13132.

For the reasons discussed above, I certify that this action (1) is not a "significant regulatory action" under