

under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2004-22-02 Raytheon Aircraft Company (Formerly Beech):** Amendment 39-13830. Docket No. FAA-2004-18660; Directorate Identifier 2003-NM-161-AD.

#### Effective Date

(a) This airworthiness directive (AD) becomes effective December 1, 2004.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Raytheon (Beech) Model MU-300-10, 400, 400A, and 400T series airplanes; and Raytheon (Mitsubishi) Model Beech MU-300 airplanes; certificated in any category; as listed in Raytheon Service Bulletin SB 53-3486, dated June, 2003.

#### Unsafe Condition

(d) This AD was prompted by a report of fuel leaking from components in the spoiler mixer bay of several Raytheon (Beech) Model 400A series airplanes. We are issuing this AD to prevent the accumulation of fuel and/or fuel vapor in the spoiler mixer bay and/or the aft fuselage compartment, which could result in a fire in the airplane.

#### Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Inspections and Corrective Actions

(f) Within 400 flight hours or 12 months after the effective date of this AD, whichever occurs first, do the actions in paragraphs (f)(1) and (f)(2) of this AD. Do all actions in accordance with the Accomplishment Instructions of Raytheon Service Bulletin SB 53-3486, dated June 2003.

(1) Do a one-time general visual inspection of the spoiler mixer bay panels to determine the presence of drain holes. Before further flight after doing this inspection, drill at least one new drain hole, and any additional drain holes needed to make a total of five, at the places in each mixer bay panel specified in the service bulletin.

(2) Do a one-time general visual inspection for discrepancies of the sealant on the relief cutout on the aft pressure bulkhead, and of the small triangular-shaped baffles at left butt line (BL) 19.13 and right BL 10.43. Before further flight after doing this inspection, do any applicable corrective actions.

**Note 1:** For the purposes of this AD, a general visual inspection is: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to enhance visual access to all exposed surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

#### Parts Installation

(g) As of the effective date of this AD, no person may install on any airplane a spoiler mixer bay panel that has a part number listed in paragraph 3.B., "Spares," of the Accomplishment Instructions of Raytheon Service Bulletin SB 53-3486, dated June 2003, unless the panel has been inspected and modified in accordance with paragraph (f)(1) of this AD.

#### Alternative Methods of Compliance (AMOCs)

(h) The Manager, Wichita Aircraft Certification Office, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

#### Material Incorporated by Reference

(i) You must use Raytheon Service Bulletin SB 53-3486, dated June 2003, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approves the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. For copies of the service information, contact Raytheon Aircraft Company, Department 62, P.O. Box 85, Wichita, Kansas 67201-0085. For information on the availability of this material at the National Archives and Records Administration (NARA), call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html). You may view the AD docket at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street SW, room PL-401, Nassif Building, Washington, DC.

Issued in Renton, Washington, on October 18, 2004.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 04-23926 Filed 10-26-04; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. 2003-NE-43-AD; Amendment 39-13835; AD 2004-22-07]

RIN 2120-AA64

#### Airworthiness Directives; General Electric Company (GE) CF6-80C2 Turbofan Engines

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for GE CF6-80C2 turbofan engines with certain part number (P/N) high pressure turbine stage 2 nozzle guide vanes (HPT S2 NGVs) installed. This AD requires flex borescope inspections of HPT S2 NGVs installed in CF6-80C2 turbofan engines. This AD results from an uncontained engine failure due to HPT S2 NGV distress. We are issuing this AD to prevent blade separation from HPT S2 NGV distress, which could result in an uncontained engine failure.

**DATES:** This AD becomes effective December 1, 2004. The Director of the Federal Register approved the incorporation by reference of certain publications listed in the regulations as of December 1, 2004.

**ADDRESSES:** You can get the service information identified in this AD from General Electric Company via Lockheed Martin Technology Services, 10525 Chester Road, suite C, Cincinnati, Ohio 45215, telephone (513) 672-8400; fax (513) 672-8422.

You may examine the AD docket at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA. You may examine the service information, at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

**FOR FURTHER INFORMATION CONTACT:**

Eugene Triozzi, Aerospace Engineer, Engine Certification Office, FAA, Engine and Propeller Directorate, 12 New England Executive Park, Burlington, MA; telephone (781) 238-7148; fax (781) 238-7199.

**SUPPLEMENTARY INFORMATION:** The FAA proposed to amend 14 CFR part 39 with a proposed AD. The proposed AD applies to GE CF6-80C2 turbofan engines with certain P/N HPT S2 NGVs installed. We published the proposed AD in the **Federal Register** on November 18, 2003 (68 FR 65000). That action proposed to require flex borescope inspections of certain P/N HPT S2 NGVs installed in CF6-80C2A1, -80C2A2, -80C2A3, -80C2A5, -80C2A5F, -80C2A8, -80C2B1, -80C2B1F, -80C2B2, -80C2B2F, -80C2B4, -80C2B4F, -80C2B5F, -80C2B6, -80C2B6F, -80C2B6FA, -80C2B7F, and -80C2D1F turbofan engines.

*Examining the AD Docket:* You may examine the AD Docket (including any comments and service information), by appointment, between 8 a.m. and 4:30 p.m., Monday through Friday, except Federal holidays. See **ADDRESSES** for the location.

**Comments**

We provided the public the opportunity to participate in the development of this AD. We have considered the comments received.

**Requests To Limit the Required Inspections**

Seven commenters ask that we limit the inspections required by the proposed AD to those parts listed in paragraph 1.C.(6) of GE Service Bulletin (SB) No. CF6-80C2 S/B 72-0952, Revision 6, dated May 5, 2003, and that we revise Table 1 of the proposed AD to clarify the affected parts. The commenters state that those parts are the population recommended by the Manufacturer. We agree. We revised the applicability paragraph and Table 1 of the final rule for consistency with GE SB No. CF6-80C2 S/B 72-0952, Revision 6, dated May 5, 2003. We also clarified the applicability of certain P/Ns in Table 1 by adding, "Insert, P/N 1957M40G01 or P/N 1957M40G02, was installed during modification or repair," to those parts.

Six commenters ask that we limit the inspections required by the proposed AD to areas of critical stress such as the leading edge and outer fillet areas of the HPT nozzle airfoil as specified in Paragraph 3.B.(3) of GE SB No. CF6-80C2 S/B 72-0952, Revision 6, dated May 5, 2003. The commenters feel that

the proposed AD requires inspecting HPT blades as well as the nozzles, but that the cracking of the nozzles is the primary cause of failure of the HPT blade. The commenters feel that the proposed AD requires inspecting noncritical areas of nozzles. We agree. We revised paragraph (f) of the final rule to state "Flex-borescope inspect the NGVs following paragraphs 3.B.(3) through 3.B.(5) of the \* \* \*." We also deleted paragraphs (f)(1) through (f)(3)(ii) because they applied to HPT S2 NGVs that have not been repaired.

**Requests for a Drawdown Allowance and Credit for Inspections Already Done**

Five commenters ask that we provide an appropriate drawdown allowance for engines that have exceeded the threshold for the initial inspection, or provide credit for inspections that have already been done. The commenters feel that some engines might have already exceeded the initial limits. We agree that credit should be given for inspections that were performed before the effective date of the final rule, however, the proposed AD already provides for that credit by stating in paragraph (e) of the proposed AD "You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done". We changed paragraph (f)(2) of the final rule to state "For engines listed in paragraphs (f)(1)(i) and (f)(1)(ii) of this AD that are already beyond the initial inspection thresholds, inspect at or before accumulating an additional 200 CSO after the effective date of this AD."

**Request To Add CF6-80C2B8F to the Applicability**

Two commenters ask us to add the CF6-80C2B8F engine model to the Applicability. The commenters state that the engine model was in the SB before we issued the NPRM. We agree. We have added the CF6-80C2B8F engine model to the Applicability of the final rule.

**Request To Withdraw the NPRM**

Two commenters ask us to withdraw the NPRM because they do not feel there is an issue with safety of flight. One commenter states that they have not removed any engines for this cause. The other commenter states that the engine fragments that exited the engine via holes in the low pressure turbine case were small and caused only minor damage to the airplane. We do not agree. We identified an unsafe condition after an uncontained engine failure. We provided a discussion of the cause of

the uncontained engine failure and how the condition could affect other engines of the same type design. We are issuing this AD to prevent future occurrences of the same unsafe condition.

**Request To Change Blade Failure to Blade Separation**

One commenter asks us to change "blade failure" to "blade separation." The commenter states this is consistent with using the term failure when the failure of the part is the primary cause. We agree. We have changed "blade failure" to "blade separation" in the final rule.

**Request To Change CSO to CSN**

One commenter asks us to state the inspection compliance times for new nozzles in paragraph (f)(2)(i) through (iii) in terms of "CSN." The commenter feels this will clarify the requirements. We agree that the change would have clarified the requirements of the original NPRM. However, based on previous comments, the final rule will apply only to repaired or modified nozzles and the paragraphs that the commenter asks us to change will not be included in the final rule.

**Requests To Limit Reinspection Requirements**

Two commenters ask us to limit the reinspection requirements in paragraph (g) for the outer fillet to Figure 5, sheets 1 and 2 of GE SB No. CF6-80C2 S/B 72-0952, Revision 6, dated May 5, 2003. The commenters state that those sheets are the specific inspection requirements for cracking in the outer fillet. We agree. We added "Sheets 1 and 2" to paragraph (g) of the final rule.

**Requests To Change the Reinspection Intervals**

Several commenters ask us to change the reinspection intervals that are incorporated by reference in paragraph (g). The commenters feel that the requirement to "reinspect at the next regular S2 Blade Inspection" as stated in Figure 5 of GE SB No. CF6-80C2 S/B 72-0952, Revision 6, dated May 5, 2003, might be misleading. Although the next regular S2 Blade Inspection should coincide with 250 cycles-since-last-inspection (CSLI) for CF6-80C2D1F engines with 5.0 or more cycles per flight leg and 400 CSLI for all other engines, the lack of specific cyclic limits might cause confusion. We agree. We added new paragraphs (h), (h)(1), and (h)(2) to the final rule to define the next regular S2 Blade Inspection as cyclic limits of 250 and 400 CSLI respectively.

**Request To Delete or Change the Paragraph Relating To Operation as More Than One Engine Configuration**

Two commenters ask us to delete or change paragraph (h) of this AD, "Engines Operated as More than One Engine Model Configuration (Thrust Level)." Both commenters feel that we should delete paragraph (h) because the inspections are limited to repaired nozzles. One commenter also feels that we need a provision for engines that have operated at different thrust levels (i.e., reconfigured from one model to another model) before the initial inspection. We agree. We changed paragraph (i) of the final rule to require performing the initial inspection at the lowest applicable inspection threshold, and reinspection intervals associated with the current engine model configuration.

**Conclusion**

We have carefully reviewed the available data, including the comments received, and determined that air safety and the public interest require adopting the AD with the changes described previously. We have determined that these changes will neither increase the economic burden on any operator nor increase the scope of the AD.

**Costs of Compliance**

There are about 1,100 GE CF6-80C2 turbofan engines of the affected design in the worldwide fleet. We estimate that this AD will affect 300 of these engines installed on airplanes of U.S. registry. We also estimate that it will take about 2 work hours per engine to perform the

inspections on engines that exhibit no damage, and therefore require no mapping of damage, and that the average labor rate is \$65 per work hour. Based on these figures, we estimate the total cost of this AD to U.S. operators to be \$39,000.

**Regulatory Findings**

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a summary of the costs to comply with this AD and placed it in the AD Docket. You may get a copy of this summary by sending a request to us at the address listed under **ADDRESSES**. Include "AD Docket No. 2003-NE-43-AD" in your request.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the Federal Aviation Administration amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive:

**2004-22-07 General Electric Company:**  
Amendment 39-13835. Docket No. 2003-NE-43-AD.

**Effective Date**

(a) This airworthiness directive (AD) becomes effective December 1, 2004.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to General Electric Company (GE) CF6-80C2A1, -80C2A2, -80C2A3, -80C2A5, -80C2A5F, -80C2A8, -80C2B1, -80C2B1F, -80C2B2, -80C2B2F, -80C2B4, -80C2B4F, -80C2B5F, -80C2B6, -80C2B6F, -80C2B6FA, -80C2B7F, -80C2B8F, and -80C2D1F turbofan engines, with the part numbers (P/Ns) of high pressure turbine (HPT) stage 2 nozzle guide vanes (HPT S2 NGVs) listed in the following Table 1, installed:

TABLE 1.—AFFECTED HPT S2 NGVs

HPT S2 NGV:	Provided that:
P/N 1347M66G03, P/N 1347M66G04, and P/Ns 1815M81G01 through 1815M81G07.	Insert, P/N 1957M40G01 or P/N 1957M40G02, was installed during repair.
P/Ns 9373M80G07 through 9373M80G22, and P/Ns 9373M80G25 through 9373M80G32.	Insert, P/N 1957M40G01 or P/N 1957M40G02, was installed during repair, or NGV was repaired by GE between April 1, 1998 through September 30, 1999.
P/Ns 9373M80G33 through 9373M80G36 .....	Part was repaired.
P/Ns 2080M38G01 through 2080M38G16, and P/Ns 2080M38G19 through 2080M38G24.	Insert, P/N 1957M40G01 or P/N 1957M40G02, was installed during modification or repair.
P/Ns 2080M19G01 through 2080M19G04, P/Ns 2080M19G07 through 2080M19G16, P/Ns 2080M19G19 through 2080M19G46, P/Ns 2080M19G49 through 2080M19G70, and P/Ns 2080M19G73 through 2080M19G80.	Insert, P/N 1957M40G01 or P/N 1957M40G02, was installed during modification or repair.

These engines are installed on, but not limited to, Airbus A300, Airbus A310, Boeing 747, Boeing 767, and McDonnell Douglas MD-11 airplanes.

**Unsafe Condition**

(d) This AD results from an uncontained engine failure due to HPT S2 NGV distress. We are issuing this AD to prevent blade separation from HPT S2 NGV distress, which

could result in an uncontained engine failure.

**Compliance**

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**Initial Flex Borescope Inspection of NGVs**

(f) Flex-borescope inspect the NGVs following paragraph 3.B.(3) through 3.B.(5) of Accomplishment Instructions of GE Service Bulletin (SB) No. CF6-80C2 S/B 72-0952, Revision 6, dated May 5, 2003, as follows:

**Initial Inspection Thresholds**

(1) For all P/N NGVs, initial-inspect after the effective date of this AD at the following applicable initial inspection thresholds:

(i) For CF6–80C2A2, –80C2B2, and –80C2B2F engines, inspect at or before accumulating 1,600 HPT cycles-since-overhaul (CSO).

(ii) For CF6–80C2A1, –80C2A3, –80C2A5, –80C2A5F, –80C2A8, –80C2B1, –80C2B1F, –80C2B4, –80C2B4F, –80C2B5F, –80C2B6, –80C2B6F, –80C2B6FA, –80C2B7F, –80C2B8F, and –80C2D1F engines, inspect at or before accumulating 800 CSO.

(2) For engines listed in paragraphs (f)(1)(i) and (f)(1)(ii) of this AD that are already beyond the initial inspection thresholds, inspect at or before accumulating an additional 200 CSO after the effective date of this AD.

**Reinspection**

(g) Reinspect or remove from service NGVs following the Conditions and Reinspection intervals listed in the “Inspection Table for Cracking in the Airfoil Outer Fillet”, Figure 5, Sheets 1 and 2, of GE SB No. CF6–80C2 S/B 72–0952, Revision 6, dated May 5, 2003.

(h) If the recommendation contained in Figure 5, Sheets 1 and 2, of GE SB No. CF6–80C2 S/B 72–0952, Revision 6, dated May 5, 2003, states “reinspect at next regular S2 Blade inspection,” then for the purposes of this AD, the next regular S2 Blade Inspection must be within the following intervals:

(1) For CF6–80C2D1F engines with 5.0 or more cycles per flight leg, the next regular S2 Blade inspection means within 250 cycles-since-last-inspection (CSLI).

(2) For all other engines listed in paragraph (c) of this AD, the next regular S2 Blade inspection means within 400 CSLI.

**Engines Operated as More Than One Engine Model Configuration (Thrust Level)**

(i) For NGVs installed in engines operated as more than one engine model configuration (thrust level), use the lowest applicable initial inspection threshold, and use the reinspection intervals associated with the current engine model.

**Alternative Methods of Compliance**

(j) The Manager, Engine Certification Office, has the authority to approve alternative methods of compliance for this AD if requested using the procedures found in 14 CFR 39.19.

**Material Incorporated by Reference**

(k) You must use GE Service Bulletin No. CF6–80C2 S/B 72–0952, Revision 6, dated May 5, 2003, to perform the inspections and removals required by this AD. The Director of the Federal Register approved the incorporation by reference of this service bulletin in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. You can get a copy from General Electric Company via Lockheed Martin Technology Services, 10525 Chester Road, suite C, Cincinnati, Ohio 45215, telephone (513) 672–8400; fax (513) 672–8422. You can review copies at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA; or at the National Archives

and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

**Related Information**

(l) None.

Issued in Burlington, Massachusetts, on October 20, 2004.

**Francis A. Favara,**

*Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 04–23929 Filed 10–26–04; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF HOMELAND SECURITY****Coast Guard****33 CFR Parts 100 and 165**

[USCG–2004–19416]

**Quarterly Listings; Safety Zones, Security Zones, Special Local Regulations and Regulated Navigation Areas**

**AGENCY:** Coast Guard, DHS.

**ACTION:** Notice of temporary rules issued.

**SUMMARY:** This document provides required notice of substantive rules issued by the Coast Guard and temporarily effective between July 1, 2004, and September 30, 2004, that were not published in the **Federal Register**. This quarterly notice lists temporary special local regulations, security zones, safety zones, and regulated navigation areas, all of limited duration and for which timely publication in the **Federal Register** was not possible.

**DATES:** This document lists temporary Coast Guard rules that became effective and were terminated between July 1, 2004, and September 30, 2004.

**ADDRESSES:** The Docket Management Facility maintains the public docket for this notice. Documents indicated in this notice will be available for inspection or copying at the Docket Management Facility, U.S. Department of Transportation, Room PL–401, 400 Seventh Street, SW., Washington, DC 20593–0001 between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. You may electronically access the public docket for this notice on the Internet at <http://dms.dot.gov>.

**FOR FURTHER INFORMATION CONTACT:** For questions on this notice contact LT Jeff Bray, Office of Regulations and Administrative Law, telephone (202) 267–2830. For questions on viewing, or

on submitting material to the docket, contact Andrea M. Jenkins, Program Manager, Docket Operations, telephone 202–366–0271.

**SUPPLEMENTARY INFORMATION:** Coast Guard District Commanders and Captains of the Port (COTP) must be immediately responsive to the safety and security needs within their jurisdiction; therefore, District Commanders and COTPs have been delegated the authority to issue certain regulations. Safety zones may be established for safety or environmental purposes. A safety zone may be stationary and described by fixed limits or it may be described as a zone around a vessel in motion. Security zones limit access to prevent injury or damage to vessels, ports, or waterfront facilities and may also describe a zone around a vessel in motion. Special local regulations are issued to enhance the safety of participants and spectators at regattas and other marine events. Regulated navigation areas establish regulations for vessels navigating within the area. Timely publication of these rules in the **Federal Register** is often precluded when a rule responds to an emergency, or when an event occurs without sufficient advance notice. The affected public is, however, informed of these rules through Local Notices to Mariners, press releases, and other means. Moreover, actual notification is provided by Coast Guard patrol vessels enforcing the restrictions imposed by the rule. Because **Federal Register** publication was not possible before the beginning of the effective period, mariners were personally notified of the contents of these special local regulations, security zones, safety zones or regulated navigation areas by Coast Guard officials; on-scene prior to any enforcement action. However, the Coast Guard, by law, must publish in the **Federal Register** notice of substantive rules adopted. To meet this obligation without imposing undue expense on the public, the Coast Guard periodically publishes a list of these temporary special local regulations, security zones, safety zones and regulated navigation areas. Permanent rules are not included in this list because they are published in their entirety in the **Federal Register**. Temporary rules are also published in their entirety if sufficient time is available to do so before they are placed in effect or terminated. The safety zones, special local regulations, security zones and regulated navigation areas listed in this notice have been exempted from review under Executive Order 12866, Regulatory Planning and Review, because of their emergency nature, or