

(o) *Right of action.* SBA may sue your employer for any amount that the employer fails to withhold from wages owed and payable to you in accordance with paragraphs (g) and (i) of this section. However, SBA may not file such a suit until the collection action involving you has ended unless earlier filing is necessary to avoid expiration of any applicable statute of limitations period. For purposes of this section, the collection action involving you ends when SBA stops the collection action in accordance with the FCCS or other applicable standards. In any event, the collection action involving you will be deemed ended if SBA has not received any payments from you to satisfy your debt, in whole or in part, for a period of one (1) year.

Hector V. Barreto,  
Administrator.  
[FR Doc. 05-6898 Filed 4-6-05; 8:45 am]  
BILLING CODE 8025-01-P

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2005-20026; Directorate Identifier 2004-NM-150-AD; Amendment 39-14040; AD 2005-07-16]

RIN 2120-AA64

**Airworthiness Directives; Boeing Model 767-400ER, 777-200, and 777-300 Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain Boeing Model 767-400ER, 777-200, and

777-300 series airplanes. This AD requires replacing, with new parts, the existing tie-down fitting studs that secure galleys, purser work stations, and closets to the seat tracks. This AD is prompted by a report that tie-down fitting studs were found damaged. We are issuing this AD to prevent a galley, purser work station, or closet from detaching from the tie-down fitting studs during an emergency landing, which could injure passengers or crewmembers, or obstruct escape routes and impede emergency evacuation.

**DATES:** This AD becomes effective May 12, 2005.

The incorporation by reference of certain publications listed in the AD is approved by the Director of the Federal Register as of May 12, 2005.

**ADDRESSES:** For service information identified in this AD, contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207.

**Docket:** The AD docket contains the proposed AD, comments, and any final disposition. You can examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the U.S. Department of Transportation, 400 Seventh Street, SW., room PL-401, Washington, DC. This docket number is FAA-2005-20026; the directorate identifier for this docket is 2004-NM-150-AD.

**FOR FURTHER INFORMATION CONTACT:** Robert Kaufman, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 917-6433; fax (425) 917-6590.

**SUPPLEMENTARY INFORMATION:** The FAA proposed to amend 14 CFR part 39 with an AD for certain Boeing Model 767-400ER, 777-200, and 777-300 series airplanes. That action, published in the **Federal Register** on January 12, 2005 (70 FR 2064), proposed to require replacing, with new parts, the existing tie-down fitting studs that secure galleys, purser work stations, and closets to the seat tracks.

**Comments**

We provided the public the opportunity to participate in the development of this AD. We have considered the comment that has been submitted on the proposed AD. The commenter supports the proposed AD.

**Explanation of Change to Proposed AD**

We have changed the number of airplanes in the Costs of Compliance paragraph to reflect information received from the airplane manufacturer.

**Conclusion**

We have carefully reviewed the available data, including the comment that has been submitted, and determined that air safety and the public interest require adopting the AD with the change described previously. We have determined that this change will neither increase the economic burden on any operator nor increase the scope of the AD.

**Costs of Compliance**

There are about 355 airplanes of the affected design in the worldwide fleet, including about 124 U.S.-registered airplanes. The following table provides the estimated costs for U.S. operators to comply with this proposed AD, at an average labor rate of \$65 per hour.

**ESTIMATED COSTS**

Airplane model	Work hours	Parts	Cost per airplane	Number of U.S.-registered airplanes	Fleet cost
767-400ER .....	10 .....	\$6,221	\$6,871	6	\$41,226
777-200 and -300 .....	6-30 (depending on configuration).	1,464-19,761	1,854-21,711	118	218,772-2,561,898

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more

detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in

air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

### Regulatory Findings

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2005-07-16 Boeing:** Amendment 39-14040. Docket No. FAA-2005-20026; Directorate Identifier 2004-NM-150-AD.

#### Effective Date

(a) This AD becomes effective May 12, 2005.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Boeing Model 767-400ER series airplanes, certificated in any category, having Variable Numbers VQ071 through VQ076 inclusive; and Model 777-200 and -300 series airplanes, certificated in

any category, as identified in Boeing Service Bulletin 777-25-0217, dated July 17, 2003.

### Unsafe Condition

(d) This AD was prompted by a report that tie-down fitting studs were found damaged. We are issuing this AD to prevent a galley, purser work station, or closet from detaching from the tie-down fitting studs during an emergency landing, which could injure passengers or crewmembers, or obstruct escape routes and impede emergency evacuation.

### Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

### Replacement

(f) Within 60 months after the effective date of this AD: Replace, with new parts, the existing tie-down fitting studs that secure galleys, purser work stations, and floor-mounted closets to the seat tracks, by doing all of the actions specified in the Accomplishment Instructions of Boeing Service Bulletin 767-25-0338, dated October 9, 2003 (for Boeing Model 767-400ER series airplanes); or Boeing Service Bulletin 777-25-0217, dated July 17, 2003 (for Boeing Model 777-200 and -300 series airplanes); as applicable.

### Replacements Accomplished According to Previous Issue of Service Bulletin

(g) For Boeing Model 777-200 and -300 series airplanes: Replacements accomplished before the effective date of this AD according to Boeing Service Bulletin 777-25-0217, dated July 18, 2002, are considered acceptable for compliance with the corresponding action specified in this AD.

### Alternative Methods of Compliance (AMOCs)

(h) The Manager, Seattle Aircraft Certification Office, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

### Material Incorporated by Reference

(i) You must use Boeing Service Bulletin 767-25-0338, dated October 9, 2003; or Boeing Service Bulletin 777-25-0217, dated July 17, 2003; as applicable; to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approves the incorporation by reference of these documents in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. To get copies of the service information, contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124-2207. To view the AD docket, go to the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., room PL-401, Nassif Building, Washington, DC. To review copies of the service information, go to the National Archives and Records Administration (NARA). For information on the availability of this material at the NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/](http://www.archives.gov/federal_register/)

[code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on March 24, 2005.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 05-6684 Filed 4-6-05; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2004-19762; Directorate Identifier 2004-NM-168-AD; Amendment 39-14038; AD 2005-07-14]

**RIN 2120-AA64**

### Airworthiness Directives; Airbus Model A318, A319, A320, and A321 Series Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all Airbus Model A318, A319, A320, and A321 series airplanes. This AD requires an inspection of the spoiler servo control for certain part numbers, and corrective action if necessary. This AD is prompted by a report of a broken piston rod bearing of the spoiler servo control. We are issuing this AD to prevent breakage of the piston rod bearing, which could cause loss of the associated hydraulic system and spoiler extension, and could result in reduced controllability of the airplane.

**DATES:** This AD becomes effective May 12, 2005.

The incorporation by reference of certain publications listed in the AD is approved by the Director of the Federal Register as of May 12, 2005.

**ADDRESSES:** For service information identified in this AD, contact Airbus, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France.

**Docket:** The AD docket contains the proposed AD, comments, and any final disposition. You can examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the U.S. Department of Transportation, 400 Seventh Street, SW., room PL-401,