

**Note 1:** For the purposes of this AD, a general visual inspection is: "A visual examination of an interior or exterior area, installation, or assembly to detect obvious damage, failure, or irregularity. This level of inspection is made from within touching distance unless otherwise specified. A mirror may be necessary to ensure visual access to all surfaces in the inspection area. This level of inspection is made under normally available lighting conditions such as daylight, hangar lighting, flashlight, or droplight and may require removal or opening of access panels or doors. Stands, ladders, or platforms may be required to gain proximity to the area being checked."

(1) For airplanes that have accumulated 20,000 total flight hours or more as of the effective date of this AD: Within 6 months after the effective date of this AD.

(2) For airplanes that have accumulated less than 20,000 total flight hours as of the effective date of this AD: Within 12 months after the effective date of this AD.

(g) If, during accomplishment of the corrective actions required by paragraph (f) of this AD, the service bulletin requires contacting the manufacturer for instructions on repairing heat damage to a component, wiring, or structure: Before further flight, repair according to a method approved by either the Manager, International Branch, ANM-116, FAA, Transport Airplane Directorate; or the Civil Aviation Authority—The Netherlands (or its delegated agent).

#### Modification

(h) Before further flight after accomplishing the inspection required by paragraph (f) of this AD: Replace the blanking plugs of the bleed air supply ducts with clamping devices, in accordance with Part D of the Accomplishment Instructions of Fokker Service Bulletin SBF50-36-006, dated October 1, 2001.

#### Alternative Methods of Compliance (AMOCs)

(i)(1) The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with 14 CFR 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

#### Related Information

(j) Dutch airworthiness directive 2001-130, dated October 31, 2001, also addresses the subject of this AD.

#### Material Incorporated by Reference

(k) You must use Fokker Service Bulletin SBF50-36-006, dated October 1, 2001, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Fokker Services B.V., P.O. Box 231, 2150 AE Nieuw-Vennep, the Netherlands, for a copy of this service

information. You may review copies at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., room PL-401, Nassif Building, Washington, DC; on the Internet at <http://dms.dot.gov>; or at the National Archives and Records Administration (NARA). For information on the availability of this material at the NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on November 7, 2005.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 05-22589 Filed 11-15-05; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2005-22427; Directorate Identifier 2004-NM-263-AD; Amendment 39-14373; AD 2005-23-15]**

**RIN 2120-AA64**

#### **Airworthiness Directives; British Aerospace Model BAC 1-11 200 and 400 Series Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for all British Aerospace Model BAC 1-11 200 and 400 series airplanes. This AD requires revising the airplane flight manual (AFM) to contain applicable AFM amendments, which advise the flightcrew of information pertaining to safely operating the fuel system. The AD also requires revising the FAA-approved maintenance program to include certain repetitive maintenance tasks intended to improve the safety of the fuel system. This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent potential ignition sources inside the fuel system, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

**DATES:** This AD becomes effective December 21, 2005.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of December 21, 2005.

**ADDRESSES:** You may examine the AD docket on the Internet at [\[dms.dot.gov\]\(http://dms.dot.gov\) or in person at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, room PL-401, Washington, DC.](http://</a></p>
</div>
<div data-bbox=)

Contact British Aerospace, Service Support, Airbus Limited, P.O. Box 77, Bristol BS99 7AR, England, for service information identified in this AD.

**FOR FURTHER INFORMATION CONTACT:** Todd Thompson, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98055-4056; telephone (425) 227-1175; fax (425) 227-1149.

#### **SUPPLEMENTARY INFORMATION:**

##### **Examining the Docket**

You may examine the airworthiness directive (AD) docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the street address stated in the **ADDRESSES** section.

##### **Discussion**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to all British Aerospace Model BAC 1-11 200 and 400 series airplanes. That NPRM was published in the **Federal Register** on September 16, 2005 (70 FR 54671). That NPRM proposed to require revising the airplane flight manual (AFM) to contain applicable AFM amendments, which advise the flightcrew of information pertaining to safely operating the fuel system. The NPRM also proposed to require revising the FAA-approved maintenance program to include certain repetitive maintenance tasks intended to improve the safety of the fuel system.

##### **Clarification of Alternative Method of Compliance (AMOC) Paragraph**

We have revised this action to clarify the appropriate procedure for notifying the principal inspector before using any approved AMOC on any airplane to which the AMOC applies.

##### **Comments**

We provided the public the opportunity to participate in the development of this AD. We received no comments on the NPRM or on the determination of the cost to the public.

##### **Conclusion**

We have carefully reviewed the available data and determined that air

safety and the public interest require adopting the AD with the change described previously. We have determined that this change will neither

increase the economic burden on any operator nor increase the scope of the AD.

**Costs of Compliance**

The following table provides the estimated costs for U.S. operators to comply with this AD.

ESTIMATED COSTS

Action	Work hours	Average labor rate per hour	Cost per airplane	Number of U.S.-registered airplanes	Fleet cost
AFM Revision .....	1	\$65	\$65	11	\$715
Maintenance Program Revision .....	1	65	65	11	715

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866;
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**2005–23–15 British Aerospace Airbus Limited:** Amendment 39–14373. Docket No. FAA–2005–22427; Directorate Identifier 2004–NM–263–AD.

**Effective Date**

(a) This AD becomes effective December 21, 2005.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to all British Aerospace Model BAC 1–11 200 and 400 series airplanes, certificated in any category.

**Unsafe Condition**

(d) This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to ensure that the flightcrew and maintenance personnel are advised of procedures pertaining to the safety of the fuel system. These procedures are needed to prevent potential ignition sources inside the fuel system, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

**Compliance**

(e) You are responsible for having the actions required by this AD performed within

the compliance times specified, unless the actions have already been done.

**Airplane Flight Manual and Maintenance Program Revisions**

(f) Within 3 months after the effective date of this AD, do the actions specified in paragraphs (f)(1) and (f)(2) of this AD to improve the safety of the fuel system, in accordance with the Accomplishment Instructions of Airbus UK BAC One-Eleven Alert Service Bulletin 28–A–PM6057, Issue 1, dated May 10, 2004.

(1) Revise the airplane flight manual to include the applicable amendments advising the flightcrew of appropriate procedures to check for proper operation of the fuel system, and to address tripped circuit breakers, failure of a fuel pump in flight, and operations in a low-fuel situation, as specified in Table 2 (under Section 4.11) of the service bulletin.

**Note 1:** The actions required by paragraph (f)(1) of this AD may be done by inserting a copy of the applicable advance amendment bulletins (AABs) specified in Table 2 of Airbus UK BAC One-Eleven Alert Service Bulletin 28–A–PM6057, Issue 1, dated May 10, 2004, into the AFM. When information identical to that in the applicable AABs has been included in the general revisions of the AFM, the AABs no longer need to be inserted into the AFM.

(2) Revise the FAA-approved maintenance program to include all repetitive maintenance tasks specified in Table 1 (under Section 4.10.2.) of the service bulletin. Then, thereafter, comply with the requirements of these maintenance tasks at the interval specified in Table 1 of the service bulletin; except for airplanes that operate fewer than a total of 1,250 flight hours per year, accomplish the requirements of these maintenance tasks at the earlier of the times specified in columns 2 and 3 of Table 1 of the service bulletin. Where Table 1 of the service bulletin specifies a repetitive interval in “hours,” for the purposes of this AD, this means “flight hours.” Any applicable corrective actions must be done before further flight.

**Note 2:** After revising the maintenance program to include the required periodic maintenance tasks according to paragraph (f)(2) of this AD, operators do not need to make a maintenance log entry to show compliance with this AD every time those maintenance tasks are accomplished thereafter.

**Alternative Methods of Compliance (AMOCs)**

(g)(1) The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

**Related Information**

(h) British airworthiness directive G-2004-0012, dated June 21, 2004, also addresses the subject of this AD.

**Material Incorporated by Reference**

(i) You must use Airbus UK BAC One-Eleven Alert Service Bulletin 28-A-PM6057, Issue 1, dated May 10, 2004, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact British Aerospace, Service Support, Airbus Limited, P.O. Box 77, Bristol BS99 7AR, England, for a copy of this service information. You may review copies at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., room PL-401, Nassif Building, Washington, DC; on the Internet at <http://dms.dot.gov>; or at the National Archives and Records Administration (NARA). For information on the availability of this material at the NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on November 7, 2005.

**Kalene C. Yanamura,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 05-22592 Filed 11-15-05; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2005-22421; Airspace Docket No. 05-ASW-1]

**RIN 2120-AA66**

**Revision of Jet Routes J-8, J-18, J-19, J-58, J-76, J-104 and J-244; and VOR Federal Airways V-60, V-190, V-263 and V-611; Las Vegas, NM**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; delay of effective date.

**SUMMARY:** This action changes the effective date of a final rule published

in the **Federal Register** on October 18, 2005 (70 FR 60424), Airspace Docket No. 05-ASW-1. In that rule, the effective date was inadvertently published as December 22, 2005. This action changes the effective date to April 13, 2006.

**EFFECTIVE DATE:** In the final rule published October 18, 2005 (70 FR 60424), the effective date is corrected to read April 13, 2006.

**FOR FURTHER INFORMATION CONTACT:** Steve Rohring, Airspace and Rules, Office of System Operations Airspace and AIM, Federal Aviation Administration, 800 Independence Avenue, SW., Washington, DC 20591; telephone: (202) 267-8783.

**SUPPLEMENTARY INFORMATION:****History**

On October 18, 2005, a final rule was published in the **Federal Register** (70 FR 60424), Airspace Docket No. 05-ASW-1. This rule revised Jet Routes J-8, J-18, J-19, J-58, J-76, J-104 and J-244; and VOR Federal Airways V-60, V-190, V-263 and V-611; Las Vegas, NM. In that rule, the effective date was inadvertently published as December 22, 2005. This action changes the effective date to April 13, 2006.

**Delay of Effective Date**

Accordingly, pursuant to the authority delegated to me, the effective date for Airspace Docket No. 05-ASW-1, as published in the **Federal Register** on October 18, 2005 (70 FR 60424), Airspace Docket No. 05-ASW-1, is hereby delayed from December 22, 2005 to April 13, 2006.

**Authority:** 49 U.S.C. 106(g), 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959-1963 Comp., p. 389.

Issued in Washington, DC, on November 4, 2005.

**Edith V. Parish,**

*Manager, Airspace and Rules.*

[FR Doc. 05-22578 Filed 11-15-05; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF COMMERCE****Bureau of Industry and Security****15 CFR Parts 740, 742, 772 and 774**

[Docket No. 051028279-5279-01]

**RIN 0694-AD57**

**Establishment of New License Exception for the Export or Reexport to U.S. Persons in Libya of Certain Items Controlled for Anti-Terrorism Reasons Only on the Commerce Control List**

**AGENCY:** Bureau of Industry and Security, Commerce.

**ACTION:** Interim rule with request for comments.

**SUMMARY:** In this interim rule, the Bureau of Industry and Security (BIS) amends the Export Administration Regulations (EAR) to implement changes to export and reexport controls with respect to Libya. Specifically, in this rule, BIS establishes a License Exception authorizing the export or reexport to U.S. persons in Libya of certain items listed on the Commerce Control List and controlled for anti-terrorism (AT) reasons only. This rule is consistent with the President's decision to modify United States' sanctions against Libya, in response to Libya's continuing efforts to dismantle its weapons of mass destruction (WMD) and missile programs and its renunciation of terrorism.

**DATES:** This rule is effective November 16, 2005. Comments must be received on or before December 16, 2005.

**ADDRESSES:** Written comments on this rule may be sent to the Federal eRulemaking Portal: <http://www.regulations.gov>, or by e-mail to [publiccomments@bis.doc.gov](mailto:publiccomments@bis.doc.gov). Include RIN 0694-AD57 in the subject line of the message. Comments may be submitted by mail or hand delivery to Sheila Quarterman, Office of Exporter Services, Regulatory Policy Division, Bureau of Industry and Security, Department of Commerce, 14th & Pennsylvania Avenue, NW., Room 2705, Washington, DC 20230, ATTN: RIN 0694-AD57; or by fax: 202-482-3355.

Send comments regarding the collection of information to David Rostker, Office of Management and Budget (OMB), by e-mail to [David\\_Rostker@omb.eop.gov](mailto:David_Rostker@omb.eop.gov), or by fax to (202) 395-7285.

**FOR FURTHER INFORMATION CONTACT:** Joan Roberts, Director, Foreign Policy Division, Office of Nonproliferation and Treaty Compliance, Bureau of Industry and Security, Department of Commerce,