

**What Must I Do To Address This Problem?**

(e) To address this problem, you must do the following:

Actions	Compliance	Procedures
(1) Insert the following information into the Limitations Section of the Airplane Flight Manual (AFM). You may do this by inserting a copy of this AD into the Limitations Section of the AFM. "The maximum takeoff weight is reduced from 7,500 pounds to 7,125 pounds."	Before further flight after January 16, 2006 (the effective date of AD 2005-26-53), except for those who received emergency AD 2005-26-53, issued December 22, 2005, unless already done. Emergency AD 2005-26-53 contained the requirements of AD 2005-26-53 and became effective immediately upon receipt.	The owner/operator holding at least a private pilot certificate as authorized by section 43.7 of the Federal Aviation Regulations (14 CFR 43.7) may do the flight manual changes requirement of this AD. Make an entry in the aircraft records showing compliance with this portion of the AD following section 43.9 of the Federal Aviation Regulations (14 CFR 43.9).
(2) Remove rivets, part number (P/N) MS20470 DD6, and replace with bolts, P/N NAS 6203-7X or NAS 6203-6X; washers, P/N AN960-10; and nuts, P/N MS21044N3.	Within 100 hours time-in-service after the effective date of this AD.	Following Pacific Aerospace Corporation Ltd. service bulletin PACSB/XL/018 Issue 3, issued December 23, 2005, and amended January 16, 2006.
(3) Remove the restrictive information from the Limitations Section of the AFM that you were required to insert in paragraph (e)(1) of this AD.	After doing the action required in paragraph (e)(2) of this AD.	The owner/operator holding at least a private pilot certificate as authorized by section 43.7 of the Federal Aviation Regulations (14 CFR 43.7) may do the flight manual changes requirement of this AD.

**May I Request an Alternative Method of Compliance?**

(f) The Manager, Standards Office, Small Airplane Directorate, FAA, has the authority to approve alternative methods of compliance (AMOCs) for this AD, if requested using the procedures found in 14 CFR 39.19.

(1) For information on any already approved AMOCs or for information pertaining to this AD, contact Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4146; facsimile: (816) 329-4090.

(2) AMOCS approved for AD 2005-26-53 are approved for this AD.

**Is There Other Information That Relates to This Subject?**

(g) New Zealand AD No. DCA/750XL/7A, dated December 24, 2005 and Pacific Aerospace Corporation Ltd. Service Bulletin No. PACSB/XL/018 Issue 3, issued December 23, 2005, amended January 16, 2006 also apply to this AD.

**May I Get Copies of the Documents Referenced in this AD?**

(h) To get copies of the documents referenced in this AD, contact Pacific Aerospace Corporation Ltd., Hamilton Airport, Private Bag HN3027, Hamilton, New Zealand. To view the AD docket, go to the Docket Management Facility; U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC, or on the Internet at <http://dms.dot.gov>. The docket number is Docket No. FAA-2005-23579; Directorate Identifier 2006-CE-02-AD.

Issued in Kansas City, Missouri, on March 3, 2006.

**David R. Showers,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E6-3442 Filed 3-9-06; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF THE TREASURY****Internal Revenue Service****26 CFR Part 301**

[REG-157271-05]

RIN 1545-BF21

**Procedures for Administrative Review of a Determination That an Authorized Recipient Has Failed To Safeguard Tax Returns or Return Information: Correction**

**AGENCY:** Internal Revenue Service (IRS), Treasury.

**ACTION:** Correction to notice of proposed rulemaking by cross-reference to temporary regulations.

**SUMMARY:** This document corrects a notice of proposed rulemaking by cross-reference to temporary regulations that was published in the **Federal Register** on Friday, February 24, 2006 (71 FR 9487) regarding administrative review procedures for certain government agencies and other authorized recipients of tax returns or return information (authorized recipients) whose receipt of

returns and return information may be suspended or terminated because they do not maintain proper safeguards.

**FOR FURTHER INFORMATION CONTACT:**

Melinda K. Fisher, (202) 622-4580 (not a toll-free number).

**SUPPLEMENTARY INFORMATION:****Background**

The notice of proposed rulemaking by cross-reference to temporary regulations (REG-157271-05), that is the subject of this correction, is under section 6103 of the Internal Revenue Code.

**Need for Correction**

As published, the notice of proposed rulemaking by cross-reference to temporary regulations (REG-157271-05) contains an error that may prove to be misleading and is in need of clarification.

**Correction of Publication**

Accordingly, the notice of proposed rulemaking by cross-reference to temporary regulations (REG-157271-05) that was the subject of FR Doc. 06-1714, is corrected as follows:

On page 9487, column 3, in the preamble, under the caption **ADDRESSES**, last line, the language "148864-03)." is corrected to read, "157271-05)."

**Guy R. Traynor,**

*Chief, Publications and Regulations Branch, Legal Processing Division, Associate Chief Counsel (Procedure and Administration).*

[FR Doc. 06-2336 Filed 3-9-06; 8:45 am]

**BILLING CODE 4830-01-P**