

Flight Standards Certificate Holding District Office.

#### Related Information

(i) Canadian airworthiness directive CF-2006-16, dated July 6, 2006, also addresses the subject of this AD.

Issued in Renton, Washington, on November 8, 2006.

Ali Bahrami,

Manager, Transport Airplane Directorate,  
Aircraft Certification Service.

[FR Doc. E6-19539 Filed 11-17-06; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2006-26354; Directorate Identifier 2006-NM-196-AD]

RIN 2120-AA64

#### Airworthiness Directives; Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-135 Airplanes and Model EMB-145, -145ER, -145MR, -145LR, -145XR, -145MP, and -145EP Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** The FAA proposes to adopt a new airworthiness directive (AD) for certain EMBRAER Model EMB-135 airplanes and Model EMB-145, -145ER, -145MR, -145LR, -145XR, -145MP, and -145EP airplanes. This proposed AD would require replacing the metallic tubes enclosing the vent and pilot valve wires in the left- and right-hand wing fuel tanks with non-conductive hoses. This proposed AD results from fuel system reviews conducted by the manufacturer. We are proposing this AD to prevent an ignition source inside the fuel tank that could ignite fuel vapor and cause a fuel tank explosion and loss of the airplane.

**DATES:** We must receive comments on this proposed AD by December 20, 2006.

**ADDRESSES:** Use one of the following addresses to submit comments on this proposed AD.

- *DOT Docket Web site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- *Government-wide rulemaking Web site:* Go to <http://www.regulations.gov> and follow the instructions for sending your comments electronically.

- *Mail:* Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590.

- *Fax:* (202) 493-2251.

- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Contact Empresa Brasileira de Aeronautica S.A. (EMBRAER), P.O. Box 343—CEP 12.225, Sao Jose dos Campos—SP, Brazil, for service information identified in this proposed AD.

#### FOR FURTHER INFORMATION CONTACT:

Rosanne Ryburn, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2139; fax (425) 227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to submit any relevant written data, views, or arguments regarding this proposed AD. Send your comments to an address listed in the **ADDRESSES** section. Include the docket number “FAA-2006-26354; Directorate Identifier 2006-NM-196-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the proposed AD. We will consider all comments received by the closing date and may amend the proposed AD in light of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this proposed AD. Using the search function of that Web site, anyone can find and read the comments in any of our dockets, including the name of the individual who sent the comment (or signed the comment on behalf of an association, business, labor union, etc.). You may review the DOT’s complete Privacy Act Statement in the **Federal Register** published on April 11, 2000 (65 FR 19477-78), or you may visit <http://dms.dot.gov>.

##### Examining the Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket

Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the DOT street address stated in the **ADDRESSES** section. Comments will be available in the AD docket shortly after the Docket Management System receives them.

##### Discussion

The FAA has examined the underlying safety issues involved in fuel tank explosions on several large transport airplanes, including the adequacy of existing regulations, the service history of airplanes subject to those regulations, and existing maintenance practices for fuel tank systems. As a result of those findings, we issued a regulation titled “Transport Airplane Fuel Tank System Design Review, Flammability Reduction and Maintenance and Inspection Requirements” (66 FR 23086, May 7, 2001). In addition to new airworthiness standards for transport airplanes and new maintenance requirements, this rule included Special Federal Aviation Regulation No. 88 (“SFAR 88,” Amendment 21-78, and subsequent Amendments 21-82 and 21-83).

Among other actions, SFAR 88 requires certain type design (*i.e.*, type certificate (TC) and supplemental type certificate (STC)) holders to substantiate that their fuel tank systems can prevent ignition sources in the fuel tanks. This requirement applies to type design holders for large turbine-powered transport airplanes and for subsequent modifications to those airplanes. It requires them to perform design reviews and to develop design changes and maintenance procedures if their designs do not meet the new fuel tank safety standards. As explained in the preamble to the rule, we intended to adopt airworthiness directives to mandate any changes found necessary to address unsafe conditions identified as a result of these reviews.

In evaluating these design reviews, we have established four criteria intended to define the unsafe conditions associated with fuel tank systems that require corrective actions. The percentage of operating time during which fuel tanks are exposed to flammable conditions is one of these criteria. The other three criteria address the failure types under evaluation: single failures, single failures in combination with a latent condition(s), and in-service failure experience. For all four criteria, the evaluations included consideration of previous actions taken that may mitigate the need for further action.

We have determined that the actions identified in this AD are necessary to

reduce the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

The Agência Nacional de Aviação Civil (ANAC), which is the airworthiness authority for Brazil, notified us that an unsafe condition may exist on certain EMBRAER Model EMB-135 airplanes and Model EMB-145, -145ER, -145MR, -145LR, -145XR, -145MP, and -145EP airplanes. The ANAC advises that sparking may occur between wires of the vent and pilot valves of the pressure refueling system inside the wing fuel tanks and the metallic tubes enclosing the wires. This condition, if not corrected, could provide an ignition source inside the fuel tank that could ignite fuel vapor and cause a fuel tank explosion and loss of the airplane.

#### Relevant Service Information

EMBRAER has issued Service Bulletins 145-28-0023, Revision 05, dated May 15, 2006 (for Model EMB-135ER, -135KE, -135KL, -135LR, -145, -145ER, -145MR, -145LR, -145XR, -145MP, and -145EP airplanes), and 145LEG-28-0018, Revision 01, dated April 20, 2005 (for Model EMB-135BJ airplanes). The service bulletins describe procedures for replacing the metallic tubes enclosing the vent and pilot valve wires in the left- and right-hand wing fuel tanks with non-conductive hoses. Accomplishing the actions specified in the service information is intended to adequately address the unsafe condition. The ANAC mandated the service information and issued Brazilian airworthiness directive 2006-06-02, dated June 28, 2006, to ensure the continued airworthiness of these airplanes in Brazil.

#### FAA's Determination and Requirements of the Proposed AD

These airplane models are manufactured in Brazil and are type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Pursuant to this bilateral airworthiness agreement, the ANAC has kept the FAA informed of the situation described above. We have examined ANAC's findings, evaluated all pertinent information, and determined that we need to issue an AD for airplanes of this type design that are certificated for operation in the United States.

Therefore, we are proposing this AD, which would require accomplishing the actions specified in the service information described previously.

#### Costs of Compliance

This proposed AD would affect about 620 airplanes of U.S. registry. The proposed actions would take about 1 work hour per airplane, at an average labor rate of \$80 per work hour. Required parts would cost between \$1,121 and \$1,796 per airplane. Based on these figures, the estimated cost of the proposed AD for U.S. operators is between \$744,620, and \$1,163,120, or between \$1,201 and \$1,876 per airplane.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in subtitle VII, part A, subpart III, section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We have determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the

AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**Empresa Brasileira de Aeronautica S.A. (EMBRAER);** Docket No. FAA-2006-26354; Directorate Identifier 2006-NM-196-AD.

#### Comments Due Date

- (a) The FAA must receive comments on this AD action by December 20, 2006.

#### Affected ADs

- (b) None.

#### Applicability

- (c) This AD applies to EMBRAER Model EMB-135BJ, -135ER, -135KE, -135KL, and -135LR airplanes and Model EMB-145, -145ER, -145MR, -145LR, -145XR, -145MP, and -145EP airplanes, certificated in any category; as identified in EMBRAER Service Bulletins 145-28-0023, Revision 05, dated May 15, 2006, and 145LEG-28-0018, Revision 01, dated April 20, 2005.

#### Unsafe Condition

- (d) This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent an ignition source inside the fuel tank that could ignite fuel vapor and cause a fuel tank explosion and loss of the airplane.

#### Compliance

- (e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Tube Replacement

- (f) Within 5,000 flight hours or 48 months after the effective date of this AD, whichever occurs first, replace the metallic tubes enclosing the vent and pilot valve wires in the left- and right-hand wing fuel tanks with new, improved, non-conductive hoses, in accordance with the Accomplishment Instructions of the service bulletin specified in paragraph (f)(1) or (f)(2) of this AD, as applicable.

(1) For Model EMB-135ER, -135KE, -135KL, -135LR, -145, -145ER, -145MR, -145LR, -145XR, -145MP, and -145EP airplanes: EMBRAER Service Bulletin 145-28-0023, Revision 05, dated May 15, 2006.

(2) For Model EMB-135BJ airplanes: EMBRAER Service Bulletin 145LEG-28-0018, Revision 01, dated April 20, 2005.

**Credit for Actions Accomplished Using Prior Revisions of Service Information**

(g) Actions accomplished before the effective date of this AD in accordance with

the service information specified in Table 1 of this AD are considered acceptable for compliance with the corresponding actions specified in this AD.

TABLE 1.—EMBRAER SERVICE INFORMATION

Service Bulletin	Revision level	Dated
145-28-0023 .....	04 .....	November 7, 2005.
145-28-0023 .....	03 .....	April 27, 2005.
145-28-0023 .....	02 .....	November 8, 2004.
145-28-0023 .....	01 .....	June 9, 2004.
145-28-0023 .....	Original .....	April 19, 2004.
145LEG-28-0018 .....	Original .....	April 23, 2004.

**Alternative Methods of Compliance (AMOCs)**

(h)(1) The Manager, ANM-116, International Branch, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

**Related Information**

(i) Brazilian airworthiness directive 2006-06-02, dated June 28, 2006, also addresses the subject of this AD.

Issued in Renton, Washington, on November 8, 2006.

**Ali Bahrami,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E6-19540 Filed 11-17-06; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA-2006-26191; Directorate Identifier 2006-CE-60-AD]

**RIN 2120-AA64**

**Airworthiness Directives; EADS SOCATA Model TBM 700 Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI)

issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as an excessive lateral play caused by a nonconforming washer might lead to the deterioration of the elevator trim tab bearing fatigue resistance. The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by December 20, 2006.

**ADDRESSES:** You may send comments by any of the following methods:

- *DOT Docket Web Site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.
- *Fax:* (202) 493-2251.
- *Mail:* Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.
- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.
- *Federal eRulemaking Portal:* <http://www.regulations.gov>. Follow the instructions for submitting comments.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the **ADDRESSES** section.

Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Albert J. Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri, 64106; *telephone:* (816) 329-4119; *fax:* (816) 329-4090.

**SUPPLEMENTARY INFORMATION:**

**Streamlined Issuance of AD**

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. The streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative Procedure Act, and **Federal Register** requirements. We also continue to meet our technical decision-making responsibilities to identify and correct unsafe conditions on U.S.-certificated products.

This proposed AD references the MCAI and related service information that we considered in forming the engineering basis to correct the unsafe condition. The proposed AD contains text copied from the MCAI and for this reason might not follow our plain language principles.

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2006-26191; Directorate Identifier 2006-CE-60-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this