

Dated: March 27, 2007.

Robert D. Lenhard,

Chairman, Federal Election Commission.

[FR Doc. E7-6185 Filed 4-4-07; 8:45 am]

BILLING CODE 6715-01-P

FARM CREDIT ADMINISTRATION

12 CFR Parts 611, 612, 614, 615, 618, 619, 620, and 630

RIN 3052-AC19

Organization; Standards of Conduct and Referral of Known or Suspected Criminal Violations; Loan Policies and Operations; Funding and Fiscal Affairs, Loan Policies and Operations, and Funding Operations; General Provisions; Definitions; Disclosure to Shareholders; Disclosure to Investors in System-Wide and Consolidated Bank Debt Obligations of the Farm Credit System; Effective Date

AGENCY: Farm Credit Administration.

ACTION: Announcement of effective date.

SUMMARY: The Farm Credit Administration (FCA) published a final rule under parts 611, 612, 614, 615, 618, 619, 620, and 630 on February 2, 2006. This final rule amended our regulations affecting the governance of the Farm Credit System and became effective on April 5, 2006 (71 FR 18168, April 11, 2006), except for the amendments to §§ 611.210(a)(2), 611.220(a)(2)(i) and (ii), 611.325, and 620.21(d)(2). This document announces the effective date of those delayed portions of the rule.

EFFECTIVE DATE: The effective date for the amendments to §§ 611.210(a)(2), 611.220(a)(2)(i) and (ii), 611.325, and 620.21(d)(2), published February 2, 2006, at 71 FR 5740, is April 5, 2007.

FOR FURTHER INFORMATION CONTACT: Gary Van Meter, Deputy Director, Office of Regulatory Policy, Farm Credit Administration, McLean, VA 22102-5090, (703) 883-4232, TTY (703) 883-4434; or Laura D. McFarland, Senior Attorney, Office of General Counsel, Farm Credit Administration, McLean, VA 22102-5090, (703) 883-4020, TTY (703) 883-4020.
(12 U.S.C. 2252(a)(9) and (10))

Dated: April 2, 2007.

Roland E. Smith,

Secretary, Farm Credit Administration Board.

[FR Doc. E7-6357 Filed 4-4-07; 8:45 am]

BILLING CODE 6705-01-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2007-27757; Directorate Identifier 2007-NM-030-AD; Amendment 39-15014; AD 2007-07-13]

RIN 2120-AA64

Airworthiness Directives; Gulfstream Aerospace LP Model Galaxy Airplanes and Model Gulfstream 200 Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule; request for comments.

SUMMARY: We are adopting a new airworthiness directive (AD) for the products listed above. This AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

Avionics and electrical wire harnesses are routed behind the Primary Flight Displays (PFD) tray at the rear of the instrument panel. In some cases, the wire harness has been found to be chafing on the PFD tray. That could result in electrical arcing and shorting and subsequent loss of systems essential for safe flight.

This AD requires actions that are intended to address the unsafe condition described in the MCAI.

DATES: This AD becomes effective April 20, 2007.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of April 20, 2007.

We must receive comments on this AD by May 7, 2007.

ADDRESSES: You may send comments by any of the following methods:

- *DOT Docket Web site:* Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.
- *Fax:* (202) 493-2251.
- *Mail:* Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.
- *Hand Delivery:* Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.
- *Federal eRulemaking Portal:* <http://www.regulations.gov>. Follow the instructions for submitting comments.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5227) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT:

Mike Borfitz, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2677; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:

Streamlined Issuance of AD

The FAA is implementing a new process for streamlining the issuance of ADs related to MCAI. This streamlined process will allow us to adopt MCAI safety requirements in a more efficient manner and will reduce safety risks to the public. This process continues to follow all FAA AD issuance processes to meet legal, economic, Administrative Procedure Act, and **Federal Register** requirements. We also continue to meet our technical decision-making responsibilities to identify and correct unsafe conditions on U.S.-certificated products.

This AD references the MCAI and related service information that we considered in forming the engineering basis to correct the unsafe condition. The AD contains text copied from the MCAI and for this reason might not follow our plain language principles.

Discussion

The Civil Aviation Authority of Israel (CAAI), which is the aviation authority for Israel, has issued Israeli Airworthiness Directive 31-07-01-12, dated February 15, 2007 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

Avionics and electrical wire harnesses are routed behind the Primary Flight Displays (PFD) tray at the rear of the instrument panel. In some cases, the wire harness has been found to be chafing on the PFD tray. That could result in electrical arcing and shorting and subsequent loss of systems essential for safe flight.

The corrective actions include inspecting the wiring harness for chafing, performing repairs if required; and inspecting the wire harnesses for

proper clearance, and rerouting/relocating wire harnesses to obtain proper clearance if required. You may obtain further information by examining the MCAI in the AD docket.

Relevant Service Information

Gulfstream has issued Service Bulletin 200-31-301, dated January 19, 2007. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

FAA's Determination and Requirements of This AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

Differences Between the AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have required different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the AD.

FAA's Determination of the Effective Date

An unsafe condition exists that requires the immediate adoption of this AD. The FAA has found that the risk to the flying public justifies waiving notice and comment prior to adoption of this rule because avionics and electrical wire harnesses are routed behind the primary flight displays (PFD) tray at the rear of the instrument panel. In some cases, the wire harness has been found to be chafing on the PFD tray. That could result in electrical arcing and shorting and subsequent loss of systems essential for safe flight. Therefore, we determined that notice and opportunity for public comment before issuing this AD are impracticable and that good cause exists

for making this amendment effective in fewer than 30 days.

Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2007-27757; Directorate Identifier 2007-NM-030-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may amend this AD because of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;

2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and

3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new AD:

2007-07-13 GULFSTREAM AEROSPACE LP (Formerly Israel Aircraft Industries, Ltd.): Amendment 39-15014. Docket No. FAA-2007-27757; Directorate Identifier 2007-NM-030-AD.

Effective Date

(a) This airworthiness directive (AD) becomes effective April 20, 2007.

Affected ADs

(b) None.

Applicability

(c) This AD applies to Gulfstream Model Galaxy airplanes and Model Gulfstream 200 airplanes, certificated in any category, serial numbers 004 through 056.

Subject

(d) Instruments.

Reason

(e) The mandatory continued airworthiness information (MCAI) states:

Avionics and electrical wire harnesses are routed behind the Primary Flight Displays (PFD) tray at the rear of the instrument panel. In some cases, the wire harness has been found to be chafing on the PFD tray. That could result in electrical arcing and shorting and subsequent loss of systems essential for safe flight.

The corrective actions include inspecting the wiring harness for chafing, performing repairs if required; inspecting the wire harnesses for proper clearance, and rerouting/relocating wire harnesses to obtain proper clearance if required.

Actions and Compliance

(f) Within 50 flight hours or 1 month, whichever occurs first, after the effective date of this AD, unless already done: Do the actions in paragraphs (f)(1) and (f)(2) of this AD.

(1) Inspect the wiring harness for chafing and perform repairs, as applicable, according to Gulfstream Service Bulletin 200-31-301, dated January 19, 2007.

(2) After doing the inspection and all applicable repairs required by paragraph (f)(1) of this AD, before further flight, inspect to make sure the wire harnesses have proper clearance and reroute/relocate wire harnesses to obtain proper clearance, as applicable, according to Gulfstream Service Bulletin 200-31-301, dated January 19, 2007.

FAA AD Differences

Note: This AD differs from the MCAI and/or service information as follows: No differences.

Other FAA AD Provisions

(g) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Borfritz, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2677; fax (425) 227-1149. Before using any AMOC approved in accordance with § 39.19 on any airplane to which the AMOC applies, notify the appropriate principal inspector in the FAA Flight Standards Certificate Holding District Office.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act, the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

Related Information

(h) Refer to MCAI Israeli Airworthiness Directive 31-07-01-12, dated February 15, 2007, and Gulfstream Service Bulletin 200-31-301, dated January 19, 2007, for related information.

Material Incorporated by Reference

(i) You must use Gulfstream Service Bulletin 200-31-301, dated January 19, 2007, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Gulfstream Aerospace Corporation, P.O. Box 2206, Mail Station D-25, Savannah, Georgia 31402-2206.

(3) You may review copies at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on March 23, 2007.

Ali Bahrami,

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. E7-6263 Filed 4-4-07; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION**Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2006-26685; Directorate Identifier 2006-NM-200-AD; Amendment 39-15015; AD 2007-07-14]

RIN 2120-AA64

Airworthiness Directives; Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-135BJ Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for all Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-135BJ airplanes. This AD requires modifying the forward and aft auxiliary fuel tanks. This AD results from a fuel system reassessment according to SFAR 88 criteria, which revealed the possibility of sparks due to chafing between the harnesses of the forward and aft auxiliary fuel tanks, between certain harnesses attached to the aircraft structure, or between certain harnesses attached to certain mechanical components. We are issuing this AD to prevent a potential ignition source inside a fuel tank, which, in combination with flammable fuel vapors, could result in a fuel tank explosion.

DATES: This AD becomes effective May 10, 2007.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of May 10, 2007.

ADDRESSES: You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility, U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC.

Contact Empresa Brasileira de Aeronautica S.A. (EMBRAER), P.O. Box 343—CEP 12.225, Sao Jose dos Campos—SP, Brazil, for service information identified in this AD.

FOR FURTHER INFORMATION CONTACT: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone (425) 227-2125; fax (425) 227-1149.

SUPPLEMENTARY INFORMATION:**Examining the Docket**

You may examine the airworthiness directive (AD) docket on the Internet at <http://dms.dot.gov> or in person at the Docket Management Facility office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Management Facility office (telephone (800) 647-5227) is located on the plaza level of the Nassif Building at the street address stated in the **ADDRESSES** section.

Discussion

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to all Empresa Brasileira de Aeronautica S.A. (EMBRAER) Model EMB-135BJ airplanes. That NPRM was published in the **Federal Register** on December 27, 2006 (71 FR 77629). That NPRM proposed to require modifying the forward and aft auxiliary fuel tanks.

Comments

We provided the public the opportunity to participate in the development of this AD. We have considered the comments received.

Request To Change Applicability

Embraer states that the applicability in paragraph (c) of the NPRM specifies the following: "This AD applies to all EMBRAER Model EMB-135BJ airplanes, certificated in any category." Embraer's position is that the applicability statement would be better as follows: "This AD applies to all EMBRAER Model EMB-135BJ airplanes, certificated in any category, as listed in Embraer Service Bulletin 145LEG-28-0022, original issue, dated February 17, 2005."

We agree with Embraer. We have determined that changing the applicability of the AD as the