

person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new AD:

**2007-13-14 APEX Aircraft:** Amendment 39-15118; Docket No. FAA-2007-27530; Directorate Identifier 2007-CE-019-AD.

#### Effective Date

(a) This airworthiness directive (AD) becomes effective August 3, 2007.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Model CAP 10 B airplanes, all serial numbers, that are:

(1) Fitted with a rudder lower support, part number (P/N) CAP10-30-08-01\* or CAP230-30-08-01\* (\* with or without a letter at the reference end), as applicable, supplied by APEX Aircraft after January 1, 2001; and

(2) Certificated in any category.

#### Subject

(d) Air Transport Association of America (ATA) Code 55: Stabilizers.

#### Reason

(e) The mandatory continuing airworthiness information (MCAI) states:

Two cases of rudder lower support with cracks have been reported, waiting for a technical solution, inspections are required.

#### Actions and Compliance

(f) Unless already done, do the following actions:

(1) Within the next 50 hours time-in-service (TIS) after August 3, 2007 (the effective date of this AD), do inspection A using Apex Aircraft Service Bulletin No. 040707, dated July 29, 2004.

(2) Every 50 hours TIS after the inspection required by paragraph (f)(1) of this AD, do inspection B using Apex Aircraft Service Bulletin No. 040707, dated July 29, 2004.

(3) When a crack is detected as a result of any inspection required by paragraph (f)(1) or (f)(2) of this AD, before further flight, return the part to APEX Aviation using Apex Aircraft Service Bulletin No. 040707, dated July 29, 2004, and install an airworthy part or incorporate the repair. Continued operation with any rudder lower support with cracks is prohibited.

(4) Before further flight after the inspection required in paragraph (f)(1) of this AD, do not install a rudder lower support, P/N CAP10-30-08-01\* or CAP230-30-08-01\*, unless it is inspected and found to be crack free following the requirements of this AD.

#### FAA AD Differences

**Note:** This AD differs from the MCAI and/or service information as follows: The MCAI and service bulletin require inspection A before the next flight and inspection B every 25 flight hours. We consider before the next flight as an urgent safety of flight compliance time, and we do not consider this unsafe condition to be an urgent safety of flight condition. Because we do not consider this unsafe condition to be an urgent safety of flight condition, we issued this action through the normal notice of proposed rulemaking (NPRM) AD process followed by this final rule. The time of 50 hours TIS is an adequate compliance for this AD action and meets the FAA requirements of an NPRM followed by a final rule.

#### Other FAA AD Provisions

(g) The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, Standards Staff, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Sarjapur Nagarajan, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4145; fax: (816) 329-4090. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) Airworthy Product: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) Reporting Requirements: For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 *et seq.*), the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

#### Related Information

(h) Refer to MCAI EASA AD No. F-2004-143, dated August 18, 2004; and Apex Aircraft Service Bulletin No. 040707, dated July 29, 2004, for related information.

#### Material Incorporated by Reference

(i) You must use Apex Aircraft Service Bulletin No. 040707, dated July 29, 2004, to do the actions required by this AD, unless the AD specifies otherwise.

(1) The Director of the Federal Register approved the incorporation by reference of this service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) For service information identified in this AD, contact Apex Aircraft, Bureau de Navigabilité, 1 route de Troyes, 21121 DAROIS—France, telephone: (33) 380 35 65 10; fax: (33) 380 35 65 15; e-mail: [apex-aircraft.com](mailto:apex-aircraft.com).

(3) You may review copies at the FAA, Central Region, Office of the Regional Counsel, 901 Locust, Room 506, Kansas City, Missouri 64106; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on June 19, 2007.

**Kim Smith,**

*Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-12319 Filed 6-28-07; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2006-24978; Directorate Identifier 2006-NM-108-AD; Amendment 39-15113; AD 2007-13-09]

RIN 2120-AA64

#### Airworthiness Directives; McDonnell Douglas Model 717-200 Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain McDonnell Douglas Model 717-200 airplanes. This AD requires modifying the fuel boost pump container of the center tank. This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent exposing the fuel pump container vapor area to electrical arcing during a fuel pump motor case or connector burn through, which could result in a fuel tank explosion.

**DATES:** This AD becomes effective August 3, 2007.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of August 3, 2007.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC.

Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024), for service information identified in this AD.

**FOR FURTHER INFORMATION CONTACT:** William Bond, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5253; fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:**

**Examining the Docket**

You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Operations office (telephone (800) 647-5527) is located on the ground floor of the West Building at the street address stated in the **ADDRESSES** section.

**Discussion**

The FAA issued a supplemental notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to certain McDonnell Douglas Model 717-200 airplanes. That supplemental NPRM was published in the **Federal Register** on April 30, 2007 (72 FR 21169). That supplemental NPRM proposed to require modifying the fuel boost pump container of the center tank. That supplemental NPRM also proposed to add airplanes to the applicability.

**Comments**

We provided the public the opportunity to participate in the

development of this AD. No comments have been received on the supplemental NPRM or on the determination of the cost to the public.

**Clarification of Alternative Method of Compliance (AMOC) Paragraph**

We have revised this action to clarify the appropriate procedure for notifying the principal inspector before using any approved AMOC on any airplane to which the AMOC applies.

**Conclusion**

We have carefully reviewed the available data and determined that air safety and the public interest require adopting the AD with the change described previously. We have determined that this change will neither increase the economic burden on any operator nor increase the scope of the AD.

**Costs of Compliance**

There are about 145 airplanes of the affected design in the worldwide fleet. The following table provides the estimated costs for U.S. operators to comply with this AD.

ESTIMATED COSTS

Action	Work hours	Average labor rate per hour	Parts	Cost per airplane	Number of U.S.-registered airplanes	Fleet cost
Modification .....	2	\$80	\$1,180	\$1,340	114	\$152,760

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We have determined that this AD will not have federalism implications under

Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket. See the **ADDRESSES** section for a location to examine the regulatory evaluation.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

■ Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

**2007-13-09 McDonnell Douglas:**  
Amendment 39-15113. Docket No. FAA 2006-24978; Directorate Identifier 2006-NM-108-AD.

**Effective Date**

(a) This AD becomes effective August 3, 2007.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to McDonnell Douglas Model 717-200 airplanes, certificated in any category; as identified in Boeing Service Bulletin 717-28-0013, Revision 2, dated September 13, 2006.

**Unsafe Condition**

(d) This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent exposing the fuel pump container vapor area to electrical arcing during a fuel pump motor case or connector burn through, which could result in a fuel tank explosion.

**Compliance**

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**Modification**

(f) Within 78 months after the effective date of this AD, modify the fuel boost pump container of the center tank by doing all the actions specified in the Accomplishment Instructions of Boeing Service Bulletin 717-28-0013, Revision 2, dated September 13, 2006.

**Actions Accomplished According to Previous Issue of Service Bulletin**

(g) Modifications accomplished before the effective date of this AD in accordance with Boeing Service Bulletin 717-28-0013, dated July 28, 2004; or Boeing Service Bulletin 717-28-0013, Revision 1, dated April 7, 2006; are considered acceptable for compliance with the corresponding action specified in this AD.

**Alternative Methods of Compliance (AMOCs)**

(h)(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

**Material Incorporated by Reference**

(i) You must use Boeing Service Bulletin 717-28-0013, Revision 2, dated September 13, 2006, to perform the actions that are required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024), for a copy of this service information. You may review copies at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington; or at the National Archives and Records

Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on June 13, 2007.

**Ali Bahrami,**

*Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. E7-11927 Filed 6-28-07; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2007-27302; Directorate Identifier 2006-NM-273-AD; Amendment 39-15114; AD 2007-13-10]**

**RIN 2120-AA64**

**Airworthiness Directives; McDonnell Douglas DC-10-30 and DC-10-30F Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** The FAA is adopting a new airworthiness directive (AD) for certain McDonnell Douglas DC-10-30 and DC-10-30F airplanes. This AD requires installing Teflon sleeving around the fuel pump wire harness inside the conduit in the aft supplemental fuel tank. This AD results from fuel system reviews conducted by the manufacturer. We are issuing this AD to prevent the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

**DATES:** This AD becomes effective August 3, 2007.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of August 3, 2007.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://dms.dot.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

Contact Boeing Commercial Airplanes, Long Beach Division, 3855 Lakewood Boulevard, Long Beach, California 90846, Attention: Data and Service Management, Dept. C1-L5A (D800-0024), for service information identified in this AD.

**FOR FURTHER INFORMATION CONTACT:**

Samuel Lee, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5262; fax (562) 627-5210.

**SUPPLEMENTARY INFORMATION:****Examining the Docket**

You may examine the airworthiness directive (AD) docket on the Internet at <http://dms.dot.gov> or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Operations office (telephone (800) 647-5527) is located on the ground floor of the West Building at the street address stated in the **ADDRESSES** section.

**Discussion**

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to certain McDonnell Douglas DC-10-30 and DC-10-30F (Model KC-10A and KDC-10) airplanes. That NPRM was published in the **Federal Register** on February 22, 2007 (72 FR 7939). That NPRM proposed to require installing Teflon sleeving around the fuel pump wire harness inside the conduit in the aft supplemental fuel tank.

**Comments**

We provided the public the opportunity to participate in the development of this AD. We have considered the comment received.

**Request To Delete Certain Airplanes From the Applicability**

A private citizen requests that we delete McDonnell Douglas Model KC-10A and KDC-10 airplanes from the applicability of the NPRM. As justification for the request, the commenter states that none of the five affected airplanes identified in the effectivity of McDonnell Douglas DC-10 Service Bulletin 24-128, dated January 19, 1984, are Model KC-10A or KDC-10 airplanes.

We agree to delete Model KC-10A and KDC-10 airplanes from the applicability of this AD. Boeing has confirmed that none of the affected airplanes are Model KC-10A or KDC-10 airplanes.

**Clarification of Alternative Method of Compliance (AMOC) Paragraph**

We have revised this action to clarify the appropriate procedure for notifying the principal inspector before using any