

Temporary Revision 2A-47, dated May 27, 2009, to Appendix A—Certification Maintenance Requirements, of Part 2 of the Bombardier CL-600-2B19 Maintenance Requirements Manual.

**Note 4:** The actions required by paragraph (j) of this AD may be done by inserting a copy of Bombardier Temporary Revision 2A-47, dated May 27, 2009, into the AWL section of Appendix A—Certification Maintenance Requirements, of Part 2 of the Bombardier CL-600-2B19 Maintenance Requirements Manual. When this temporary revision has been included in the limitation section of the general revisions of the document, the general revisions may be inserted in the document, provided the relevant information in the general revision is identical to that in Bombardier Temporary Revision 2A-47, dated May 27, 2009.

(k) For the task identified in Bombardier Temporary Revision 2A-47, dated May 27, 2009, do the initial inspection within 1,000 flight hours after the effective date of this AD. Doing the initial inspection required by this paragraph terminates the requirements of paragraph (g) of this AD and the inspection requirements of paragraph (h) of this AD.

(l) Thereafter, except as provided by paragraph (m) of this AD, no alternative intervals may be approved for the task identified in Bombardier Temporary Revision 2A-47, dated May 27, 2009, which requires a special detailed inspection of the throttle control gearbox for gear and rack teeth wear.

#### FAA AD Differences

**Note 5:** This AD differs from the MCAI and/or service information as follows: No differences.

#### Other FAA AD Provisions

(m) The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC on any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

(2) Airworthy Product: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) Reporting Requirements: For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 *et seq.*), the Office of

Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

#### Related Information

(n) Refer to MCAI Canadian Airworthiness Directive CF-2004-01R2, dated September 29, 2009; Bombardier Service Bulletin 601R-76-019, Revision C, dated July 5, 2007; and Bombardier Temporary Revision 2A-47, dated May 27, 2009, to Appendix A—Certification Maintenance Requirements, of Part 2 of the Bombardier CL-600-2B19 Maintenance Requirements Manual; for related information.

Issued in Renton, Washington, on October 13, 2010.

**John Piccola,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2010-26550 Filed 10-20-10; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2010-1038; Directorate Identifier 2009-NM-250-AD]

RIN 2120-AA64

#### Airworthiness Directives; Fokker Services B.V. Model F.28 Mark 0070 and 0100 Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

During a normal walkaround check on a F28 Mark 0100 aeroplane, a large crack was discovered in the lower portion of the right (RH) MLG [main landing gear] piston. The affected MLG unit had accumulated 7909 flight cycles (FC) at the time of detection.  
\* \* \*

This condition, if not detected and corrected, could lead to MLG failure, possibly resulting in loss of control of the aeroplane during the landing roll-out.

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by December 6, 2010.

**ADDRESSES:** You may send comments by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** (202) 493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 231, 2150 AE Nieuw-Vennep, the Netherlands; telephone +31 (0)252-627-350; fax +31 (0)252-627-211; e-mail [technicalservices.fokkerservices@stork.com](mailto:technicalservices.fokkerservices@stork.com); Internet <http://www.myfokkerfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone 425-227-1137; fax 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2010-1038; Directorate Identifier 2009-NM-250-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory,

economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued EASA Airworthiness Directive 2009–0221, dated October 14, 2009 (referred to after this as “the MCAI”), to correct an unsafe condition for the specified products. The MCAI states:

During a normal walkaround check on a F28 Mark 0100 aeroplane, a large crack was discovered in the lower portion of the right (RH) MLG [main landing gear] piston. The affected MLG unit had accumulated 7909 flight cycles (FC) at the time of detection. The piston has been sent to Goodrich, the landing gear manufacturer, for detailed investigation.

This condition, if not detected and corrected, could lead to MLG failure, possibly resulting in loss of control of the aeroplane during the landing roll-out.

For the reasons described above, this AD requires a one-time detailed visual inspection of the MLG pistons, the replacement of any MLG pistons on which cracks are detected, and the reporting of all findings to the aeroplane TC [type certificate] holder. The inspection results, in combination with the findings of the crack/metallurgical investigation of the cracked piston by Goodrich, will be used to determine the necessity of additional and/or more detailed inspections, or any other corrective action. This AD is considered an interim measure, and further action is likely to follow.

You may obtain further information by examining the MCAI in the AD docket.

### Relevant Service Information

Fokker Services B.V. has issued Service Bulletin SBF100–32–158, dated October 2, 2009. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this

AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

### Differences Between This AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in general, agree with their substance. But we might have found it necessary to use different words from those in the MCAI to ensure the AD is clear for U.S. operators and is enforceable. In making these changes, we do not intend to differ substantively from the information provided in the MCAI and related service information.

We might also have proposed different actions in this AD from those in the MCAI in order to follow FAA policies. Any such differences are highlighted in a NOTE within the proposed AD.

### Costs of Compliance

Based on the service information, we estimate that this proposed AD would affect about 6 products of U.S. registry. We also estimate that it would take about 3 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$1,530, or \$255 per product.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a

substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new AD:

**Fokker Services B.V.:** Docket No. FAA–2010–1038; Directorate Identifier 2009–NM–250–AD.

#### Comments Due Date

(a) We must receive comments by December 6, 2010.

#### Affected ADs

(b) None.

#### Applicability

(c) This AD applies to Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes, certificated in any category, equipped with Goodrich (formerly Menasco, Colt Industries) main landing gear (MLG) units having part number (P/N) 41050–7, 41050–8, 41050–9, 41050–10, 41050–11, 41050–12, 41050–13, 41050–14, 41050–15, 41050–16, 41060–1, 41060–2, 41060–3, 41060–4, 41060–5, or 41060–6.

#### Subject

(d) Air Transport Association (ATA) of America Code 32: Landing gear.

#### Reason

(e) The mandatory continuing airworthiness information (MCAI) states:

During a normal walkaround check on a F28 Mark 0100 aeroplane, a large crack was discovered in the lower portion of the right (RH) MLG piston. The affected MLG unit had accumulated 7909 flight cycles (FC) at the time of detection. The piston has been sent to Goodrich, the landing gear manufacturer, for detailed investigation.

This condition, if not detected and corrected, could lead to MLG failure, possibly resulting in loss of control of the aeroplane during the landing roll-out.

For the reasons described above, this AD requires a one-time detailed visual inspection of the MLG pistons, the replacement of any MLG pistons on which cracks are detected, and the reporting of all findings to the aeroplane TC [type certificate] holder. The inspection results, in combination with the findings of the crack/metallurgical investigation of the cracked piston by Goodrich, will be used to determine the necessity of additional and/or more detailed inspections, or any other corrective action. This AD is considered an interim measure, and further action is likely to follow.

#### Compliance

(f) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### Inspection

(g) Within 30 days after the effective day of this AD, do a detailed visual inspection for cracks of the MLG pistons, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100-32-158, dated October 2, 2009.

(h) If any cracked MLG piston is found during the inspection required by paragraph (g) of this AD, before further flight replace the affected piston with a serviceable part, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100-32-158, dated October 2, 2009.

(i) At the applicable time specified in paragraph (i)(1) or (i)(2) of this AD, report the inspection results (including no findings) to Fokker Services B.V. by using the Questionnaire provided in Fokker Service Bulletin SBF100-32-158, dated October 2, 2009.

(1) If the inspection was done on or after the effective date of this AD: Submit the report within 30 days after the inspection.

(2) If the inspection was done before the effective date of this AD: Submit the report within 30 days after the effective date of this AD.

#### FAA AD Differences

**Note:** This AD differs from the MCAI and/or service information as follows: The applicability of the MCAI includes MLG part number (P/N) 41050-6, which is not an affected part. P/N 41060-6, however, is an affected part, and is included in the applicability of this AD.

#### Other FAA AD Provisions

(j) The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International

Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue, SW., Renton, Washington 98057-3356; telephone 425-227-1137; fax 425-227-1149. Before using any approved AMOC on any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, under the provisions of the Paperwork Reduction Act (44 U.S.C. 3501 *et seq.*), the Office of Management and Budget (OMB) has approved the information collection requirements and has assigned OMB Control Number 2120-0056.

#### Related Information

(k) For related information, refer to MCAI European Aviation Safety Agency Airworthiness Directive 2009-0221, dated October 14, 2009; and Fokker Service Bulletin SBF100-32-158, dated October 2, 2009.

Issued in Renton, Washington, on October 13, 2010.

#### John Piccola,

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2010-26561 Filed 10-20-10; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2010-0771; Airspace Docket No. 10-AGL-12]

#### Proposed Amendment of Class E Airspace; Mansfield, OH

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** This action proposes to amend Class E airspace at Mansfield, OH. Additional controlled airspace is necessary to accommodate new Standard Instrument Approach Procedures (SIAPs) at Mansfield Lahm

Regional Airport. The FAA is taking this action to enhance the safety and management of Instrument Flight Rules (IFR) operations at the airport.

**DATES:** Comments must be received on or before December 6, 2010.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, 1200 New Jersey Avenue, SE., West Building Ground Floor, Room W12-140, Washington, DC 20590-0001. You must identify the docket number FAA-2010-0771/Airspace Docket No. 10-AGL-12, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone 1-800-647-5527), is on the ground floor of the building at the above address.

#### FOR FURTHER INFORMATION CONTACT:

Scott Enander, Central Service Center, Operations Support Group, Federal Aviation Administration, Southwest Region, 2601 Meacham Blvd., Fort Worth, TX 76137; telephone: 817-321-7716.

#### SUPPLEMENTARY INFORMATION:

#### Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal. Communications should identify both docket numbers and be submitted in triplicate to the address listed above. Commenters wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. FAA-2010-0771/Airspace Docket No. 10-AGL-12." The postcard will be date/time stamped and returned to the commenter.

#### Availability of NPRMs

An electronic copy of this document may be downloaded through the Internet at <http://www.regulations.gov>. Recently published rulemaking