

**(j) Parts Installation**

As of the effective date of this AD, no person may install a separation bolt harness having P/N 7292520-678, on any airplane.

**(k) Credit for Actions Accomplished in Accordance With Previous Service Information**

Actions done before the effective date of this AD in accordance with Saab Service Bulletin 340-32-139, dated January 12, 2010, are acceptable for compliance with the requirements of paragraph (i) of this AD.

**(l) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, Washington 98057-3356; telephone (425) 227-1112; fax (425) 227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(m) Related Information**

Refer to MCAI EASA Airworthiness Directive 2011-0003, dated January 17, 2011, and the service information specified in paragraphs (m)(1) through (m)(5) of this AD, as applicable, for related information.

(1) Saab Service Bulletin 340-32-139, Revision 01, dated November 1, 2010.

(2) Saab Service Bulletin 340-32-127, dated December 18, 2002.

(3) Saab Service Bulletin 340-32-127, Revision 01, dated January 23, 2003.

(4) Saab Service Bulletin 340-32-041, Revision 01, dated October 9, 1987.

(5) Saab Service Bulletin 340-32-028, Revision 01, dated November 25, 1986.

**(n) Material Incorporated by Reference**

(1) You must use the following service information to do the actions required by this AD, unless the AD specifies otherwise. The Director of the Federal Register approved the incorporation by reference (IBR) of the following service information under 5 U.S.C.

552(a) and 1 CFR part 51 on the date specified:

(i) Saab Service Bulletin 340-32-028, Revision 01, dated November 25, 1986, approved for IBR July 29, 2004 (69 FR 35235, June 24, 2004).

(ii) Saab Service Bulletin 340-32-041, Revision 01, dated October 9, 1987, approved for IBR July 29, 2004 (69 FR 35235, June 24, 2004).

(iii) Saab Service Bulletin 340-32-127, dated December 18, 2002, approved for IBR July 29, 2004 (69 FR 35235, June 24, 2004).

(iv) Saab Service Bulletin 340-32-127, Revision 01, dated January 23, 2003, approved for IBR July 29, 2004 (69 FR 35235, June 24, 2004).

(v) Saab Service Bulletin 340-32-139, Revision 01, dated November 1, 2010, approved for IBR February 7, 2012.

(2) For service information identified in this AD, contact Saab AB, Saab Aerosystems, SE-581 88, Linköping, Sweden; telephone +46 13 18 5591; fax +46 13 18 4874; email [saab2000.techsupport@saabgroup.com](mailto:saab2000.techsupport@saabgroup.com); Internet <http://www.saabgroup.com>.

(3) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call (425) 227-1221.

(4) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at an NARA facility, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on December 23, 2011.

**John P. Piccola,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2011-33565 Filed 12-30-11; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2011-1061; Directorate Identifier 2011-NM-053-AD; Amendment 39-16908; AD 2011-27-06]**

**RIN 2120-AA64**

**Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Dassault Aviation Model FALCON 7X airplanes equipped with certain ram air

turbine (RAT) transformer rectifier units (TRUs). This AD was prompted by a report of incorrect design of the TRU part of the RAT system. This AD requires replacing any affected RAT TRU with a modified RAT TRU. We are issuing this AD to prevent loose internal wiring in the RAT generator, which could result in degraded direct current power to essential airplane systems while the RAT is deployed, which could adversely affect continued safe flight and landing of the airplane.

**DATES:** This AD becomes effective February 7, 2012.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of February 7, 2012.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, Washington 98057-3356; telephone (425) 227-1137; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:****Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM was published in the **Federal Register** on October 11, 2011 (76 FR 62671). That NPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

The manufacturer of the Transformer Rectifier Unit (TRU) part of the Ram Air Turbine (RAT) system has identified an incorrect design of the part.

The internal wiring that conducts the high voltage alternative current from the RAT generator may become loose due to insufficient crimping of the wire and contacts.

This condition, if not corrected, and if occurring while the RAT is deployed, could result in a degraded direct current power which is distributed to essential aeroplane systems and therefore aeroplane operations might be impaired.

To address this unsafe condition, the manufacturer of the RAT TRU has developed an improved RAT TRU with a new Part Number (P/N).

This [European Aviation Safety Agency (EASA)] AD requires replacement of the affected RAT TRU by a modified RAT TRU.

You may obtain further information by examining the MCAI in the AD docket.

## Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (76 FR 62671, October 11, 2011) or on the determination of the cost to the public.

## Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed—except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (76 FR 62671, October 11, 2011) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (76 FR 62671, October 11, 2011).

## Costs of Compliance

We estimate that this AD will affect about 27 products of U.S. registry. We also estimate that it will take about 13 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$16,310 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these parts. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of the AD on U.S. operators to be \$470,205, or \$17,415 per product.

## Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

## Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

## Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM (76 FR 62671, October 11, 2011), the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

## List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

## Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2011-27-06 Dassault Aviation:**  
Amendment 39-16908. Docket No. FAA-2011-1061; Directorate Identifier 2011-NM-053-AD.

## (a) Effective Date

This airworthiness directive (AD) becomes effective February 7, 2012.

## (b) Affected ADs

None.

## (c) Applicability

This AD applies to Dassault Aviation Model FALCON 7X airplanes, all serial numbers, certificated in any category; equipped with any ram air turbine (RAT) transformer rectifier unit (TRU) having part number (P/N) 5913703.

## (d) Subject

Air Transport Association (ATA) of America Code 24: Electrical Power.

## (e) Reason

This AD was prompted by a report of incorrect design of the transformer rectifier unit (TRU) part of the ram air turbine (RAT) system. The Federal Aviation Administration is issuing this AD to prevent loose internal wiring in the RAT generator, which could result in degraded direct current power to essential airplane systems while the RAT is deployed, which could adversely affect continued safe flight and landing of the airplane.

## (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

## (g) Actions

Within 28 months after the effective date of this AD, replace any RAT TRU having P/N 5913703 with a RAT TRU having P/N 5915825, in accordance with the Accomplishment Instructions of Dassault Mandatory Service Bulletin 7X-163, dated December 1, 2010.

## (h) Parts Installation

As of the effective date of this AD, no person may install any RAT TRU having P/N 5913703, on any airplane.

## (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, Washington 98057-3356; telephone (425) 227-1137; fax (425) 227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC

approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (j) Related Information

Refer to MCAI European Aviation Safety Agency Airworthiness Directive 2011-0008, dated January 18, 2011; and Dassault Mandatory Service Bulletin 7X-163, dated December 1, 2010; for related information.

#### (k) Material Incorporated by Reference

(1) You must use the following service information to do the actions required by this AD, unless the AD specifies otherwise. The Director of the **Federal Register** approved the incorporation by reference (IBR) of the following service information under 5 U.S.C. 552(a) and 1 CFR part 51:

(i) Dassault Mandatory Service Bulletin 7X-163, dated December 1, 2010.

(2) For service information identified in this AD, contact Dassault Falcon Jet, P.O. Box 2000, South Hackensack, New Jersey 07606; telephone (201) 440-6700; Internet <http://www.dassaultfalcon.com>.

(3) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call (425) 227-1221.

(4) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at an NARA facility, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on December 23, 2011.

**John P. Piccola,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2011-33569 Filed 12-30-11; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2011-0866; Airspace Docket No. 11-AAL-15]

#### Amendment of Class E Airspace; Kipnuk, AK

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action modifies Class E airspace at Kipnuk, AK. The revision of two standard instrument approach procedures at the Kipnuk Airport has made this action necessary to enhance safety and management of Instrument Flight Rules (IFR) operations.

**DATES:** Effective date, 0901 UTC, April 5, 2012. The Director of the Federal Register approves this incorporation by reference action under 1 CFR part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

#### FOR FURTHER INFORMATION CONTACT:

Jeanette Roller, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone (425) 203-4541.

#### SUPPLEMENTARY INFORMATION:

##### History

On August 31, 2011, the FAA published in the **Federal Register** a notice of proposed rulemaking (NPRM) to amend controlled airspace at Kipnuk, AK (76 FR 54149). Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.9V dated August 9, 2011, and effective September 15, 2011, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designations listed in this document will be published subsequently in that Order. Except for editorial changes, this rule is the same as published in the NPRM.

##### The Rule

This action amends Title 14 Code of Federal Regulations (14 CFR) part 71 by modifying Class E airspace extending upward from 700 feet above the surface, at Kipnuk Airport, to accommodate IFR aircraft executing the two revised standard instrument approach procedures at the airport. This action is necessary for the safety and management of IFR operations. The portion of the airspace that lies further than 12 miles offshore and overlaps Norton Sound Low and Control 1234L is being amended under a separate rulemaking.

The FAA has determined this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this regulation: (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT

Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that will only affect air traffic procedures and air navigation, it is certified this rule, when promulgated, will not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the U.S. Code. Subtitle 1, section 106 discusses the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in subtitle VII, part A, subpart I, section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it modifies controlled airspace at Kipnuk Airport, Kipnuk, AK.

#### List of Subjects in 14 CFR Part 71

Airspace, Incorporation by reference, Navigation (air).

#### Adoption of the Amendment

In consideration of the foregoing, the Federal Aviation Administration amends 14 CFR part 71 as follows:

#### PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS

■ 1. The authority citation for 14 CFR part 71 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959-1963 Comp., p. 389.

##### § 71.1 [Amended]

■ 2. The incorporation by reference in 14 CFR 71.1 of the Federal Aviation Administration Order 7400.9V, Airspace Designations and Reporting Points, dated August 9, 2011, and effective September 15, 2011 is amended as follows:

*Paragraph 6005 Class E airspace areas extending upward from 700 feet or more above the surface of the earth.*

\* \* \* \* \*

#### AAL AK E5 Kipnuk, AK [Modified]

Kipnuk Airport, AK

(Lat. 59°55'59" N., long. 164°01'50" W.)

That airspace extending upward from 700 feet above the surface within a 6.9-mile