

# Rules and Regulations

Federal Register

Vol. 77, No. 157

Tuesday, August 14, 2012

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents. Prices of new books are listed in the first FEDERAL REGISTER issue of each week.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2011-1418; Directorate Identifier 2011-NM-187-AD; Amendment 39-17157; AD 2012-16-10]

RIN 2120-AA64

#### Airworthiness Directives; Bombardier, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Bombardier, Inc. Model DHC-8-400 series airplanes. This AD was prompted by chafing on high pressure fuel lines due to improper installation of an expandable pin on the lower cowl assembly. This AD requires installing spring clips and repositioning the lanyard attachment points at the forward end and the forward firefloor of the lower cowl. We are issuing this AD to prevent chafing of the high pressure fuel lines, which if not corrected, could cause fuel leakage in a fire zone.

**DATES:** This AD becomes effective September 18, 2012.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of September 18, 2012.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Mazdak Hobbi, Aerospace Engineer, Propulsion and Services Branch, ANE-

173, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone (516) 228-7330; fax (516) 794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM was published in the **Federal Register** on January 19, 2012 (77 FR 2658). That NPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

During routine maintenance, an operator discovered evidence of chafing on a high pressure (HP) fuel line. The source of chafing was related to the improper installation of an expandable pin on the lower cowl assembly, which caused the lanyard to foul against the HP fuel line. This condition, if not corrected, may cause fuel leakage in a fire zone.

Bombardier has issued Service Bulletin (SB) 84-71-13 to introduce spring clips to positively retain and control the lanyards, regardless of the installation orientation of the expandable pin to rectify this problem.

You may obtain further information by examining the MCAI in the AD docket.

##### Comments

We gave the public the opportunity to participate in developing this AD. We have considered the comments received.

##### Request To Use Lanyard

Horizon Air requested the use of parts manufacturer approval (PMA) lanyard having part having number (P/N) QXD671217-001 in lieu of Bombardier Service Bulletin 84-71-13, dated May 19, 2011, or use of the PMA part when accomplishing Bombardier Service Bulletin 84-71-13, dated May 19, 2011, since the NPRM (77 FR 2658, January 19, 2012) affects the clipping of the lanyard only but not the lanyard itself.

We disagree because the PMA part would have to be evaluated for this modification and the commenter did not submit justifiable data. Therefore, we cannot add this PMA part as an alternative within the final rule. We recommend that the operator request approval of an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (h)(1) of this AD in order to have the PMA part evaluated to the Bombardier

part currently referenced by Bombardier Service Bulletin 84-71-13, dated May 19, 2011. We have not changed the final rule in regard to this issue.

##### Conclusion

We reviewed the available data, including the comment received, and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (77 FR 2658, January 19, 2012) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (77 FR 2658, January 19, 2012).

##### Costs of Compliance

We estimate that this AD will affect 83 products of U.S. registry. We also estimate that it will take about 3 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$19 per product. Where the service information lists required parts costs that are covered under warranty, we have assumed that there will be no charge for these parts. As we do not control warranty coverage for affected parties, some parties may incur costs higher than estimated here. Based on these figures, we estimate the cost of this AD to the U.S. operators to be \$22,742, or \$274 per product.

##### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition

that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM (77 FR 2658, January 19, 2012), the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2012-16-10 Bombardier, Inc.:** Amendment 39-17157. Docket No. FAA-2011-1418; Directorate Identifier 2011-NM-187-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective September 18, 2012.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Bombardier, Inc. Model DHC-8-400, -401, and -402 airplanes; certificated in any category; serial numbers 4001, 4003 through 4354 inclusive; and 4356 through 4363 inclusive.

#### (d) Subject

Air Transport Association (ATA) of America Code 71: Power Plant.

#### (e) Reason

This AD was prompted by chafing on high pressure fuel lines due to improper installation of an expandable pin on the lower cowl assembly. We are issuing this AD to prevent chafing of the high pressure fuel lines, which if not corrected, could cause fuel leakage in a fire zone.

#### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### (g) Actions

Within 6,000 flight hours or 36 months after the effective date of this AD, whichever occurs first, install new or serviceable spring clips and re-position the lanyard attachment points, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-71-13, dated May 19, 2011.

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to Attn: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority

(or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (i) Related Information

Refer to MCAI Canadian Airworthiness Directive CF-2011-21, dated July 12, 2011; and Bombardier Service Bulletin 84-71-13, dated May 19, 2011; for related information.

#### (j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the following service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use the following service information to do the actions required by this AD, unless the AD specifies otherwise.

(i) Bombardier Service Bulletin 84-71-13, dated May 19, 2011.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at an NARA facility, call 202-741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on July 31, 2012.

**Michael Kaszycki,**

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2012-19410 Filed 8-13-12; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2012-0332; Directorate Identifier 2011-NM-130-AD; Amendment 39-17155; AD 2012-16-08]

RIN 2120-AA64

#### Airworthiness Directives; BAE Systems (Operations) Limited Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain