

notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (j) Related Information

Refer to MCAI Canadian Airworthiness Directive CF-2011-34, dated August 16, 2011; and Bombardier Service Bulletin 84-30-14, dated May 20, 2011; for related information.

#### (k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the following service information under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use the following service information to do the actions required by this AD, unless the AD specifies otherwise.

(i) Bombardier Service Bulletin 84-30-14, dated May 20, 2011.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may also review copies of the service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at an NARA facility, call 202-741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal\\_regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html).

Issued in Renton, Washington, on September 4, 2012.

**Ali Bahrami,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2012-22335 Filed 9-14-12; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2011-0816; Directorate Identifier 2011-CE-022-AD; Amendment 39-17180; AD 2012-18-04]

RIN 2120-AA64

#### Airworthiness Directives; Costruzioni Aeronautiche Tecnam srl Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for Costruzioni Aeronautiche Tecnam srl Model P2006T airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as cracking, bulging, deformation, or oil leakage in the lower lid of the landing gear emergency accumulator, which could result in decreasing the airplane's structural integrity and jeopardizing the landing gear emergency extension in case of system failure in normal mode. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective October 22, 2012.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in the AD as of October 22, 2012.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact Costruzioni Aeronautiche TECNAM Airworthiness Office, Via Maiorise—81043 Capua (CE) Italy; telephone: +39 0823 620134; fax: +39 0823 622899; email: [m.oliva@tecnam.com](mailto:m.oliva@tecnam.com) or [g.paduan@tecnam.com](mailto:g.paduan@tecnam.com); Internet: [www.tecnam.com](http://www.tecnam.com). You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the

availability of this material at the FAA, call (816) 329-4148.

#### FOR FURTHER INFORMATION CONTACT:

Albert Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; phone: (816) 329-4119; fax: (816) 329-4090; email: [albert.mercado@faa.gov](mailto:albert.mercado@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a supplemental notice of proposed rulemaking (SNPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That SNPRM was published in the **Federal Register** on June 13, 2012 (77 FR 35304). That SNPRM proposed to correct an unsafe condition for the specified products. The MCAI states:

During a pre-flight inspection of a P2006T aeroplane, the lower skin of the fuselage aft tail cone was found damaged. This damage was caused by the lower lid of the LG emergency accumulator, which had detached from the LG emergency accumulator, violently hitting the lower skin of the fuselage aft tail cone and damaging the accumulator cylinder.

This condition, if not detected and corrected, could impair the aeroplane structural integrity and jeopardize the LG emergency extension in case of system failure in normal mode.

For the reasons described above, EASA issued Emergency AD 2011-0063-E to require a one-time inspection of the LG emergency accumulator cylinder for cracks, deformation or oil leakage and, depending on findings, the accomplishment of the applicable corrective actions.

After that AD was issued, Costruzioni Aeronautiche TECNAM developed a modification (MOD 2006-108) and published Service Bulletin (SB) SB-048-CS Revision 1, dated 06 July 2011, that contained the instructions for that modification. Prompted by this development, EASA issued PAD 11-070 for consultation until 16 August 2011, proposing to require incorporation of this modification on all affected aeroplanes, and to require certain post-modification repetitive inspections.

During the consultation period of PAD 11-070, an operator who had applied Costruzioni Aeronautiche TECNAM SB-048-CS on his aeroplane, reported finding abnormal deformation of the emergency accumulator, to such an extent that it would jeopardize the LG emergency extension in case of system failure in normal mode. To address this additional safety concern, Costruzioni Aeronautiche TECNAM issued SB-068-CS which contains instructions to inspect post-modification aeroplanes.

For the reasons described above, EASA AD 2011-0153-E retained the requirements of EASA AD 2011-0063-E, which was superseded, and required modification of the landing gear emergency accumulator by installation of safety rings and repetitive inspections after modification. In addition,

prompted by the recent post-modification findings, EASA AD 2011–0153–E reduced the compliance time for the modification as originally proposed and required additional first-flight-of-the-day repetitive inspections for the LG emergency accumulator cylinder and replacement of the LG emergency accumulator if cracks, deformation, or oil leakage is detected.

AD Revision 2011–0153R1 was issued in order to allow Pilot-Owners to accomplish the daily pre-flight inspection of the modified LG emergency accumulator.

After that AD Revision, Costruzioni Aeronautiche TECNAM designed a new LG emergency accumulator part number 26–9–9500–000, identified as modification MOD 2006–121, and published SB–080–CS dated 02 January 2012, which contains instructions for replacement and installation of the newly designed LG emergency accumulator.

This AD, which supersedes EASA AD 2011–0153R1, requires the installation of the new landing gear emergency accumulator part number 26–9–9500–000, as well as to inspect after the installation the LG emergency accumulator and the LG retraction/extension system.

### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the SNPRM or on the determination of the cost to the public.

### Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the SNPRM (77 FR 35304, June 13, 2012) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the SNPRM (77 FR 35304, June 13, 2012).

### Costs of Compliance

We estimate that this proposed AD will affect 7 products of U.S. registry. We also estimate that it would take about 7 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$1,300 per product.

Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$13,265, or \$1,895 per product.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I,

section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2012–18–04 Costruzioni Aeronautiche Tecnam srl:** Amendment 39–17180; Docket No. FAA–2011–0816; Directorate Identifier 2011–CE–022–AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective October 22, 2012.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Costruzioni Aeronautiche Tecnam srl Model P2006T airplanes, serial numbers (S/N) 001/US through S/N 88/US, certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 32: Landing Gear.

#### (e) Reason

This AD was prompted by cracking, bulging, deformation, or oil leakage in the lower lid of the landing gear emergency accumulator, which could result in decreasing the airplane's structural integrity and jeopardizing the landing gear emergency extension in case of system failure in normal mode. We are issuing this AD to require actions to address the unsafe condition on these products.

#### (f) Actions and Compliance

Unless already done, do the following actions:

(1) Within 90 days after October 22, 2012 (the effective date of this AD), replace the landing gear (LG) emergency accumulator with a new emergency accumulator part number 26–9–9500–000, following the instructions in Costruzioni Aeronautiche Tecnam Service Bulletin SB 80–CS, dated January 2, 2012.

(2) Within 300 hours time-in-service (TIS) after compliance with paragraph (f)(1) of this AD and repetitively thereafter at intervals not to exceed 300 hours TIS, inspect the LG emergency accumulator and the LG retraction/extension system for damage and leakage following the applicable instructions in Chapter 5, Section 5–20 Inspection Program Costruzioni Aeronautiche Tecnam P2006T Aircraft Maintenance Manual, Document No. 2006/045, 2nd Edition—Revision 1, dated April 27, 2011.

(3) If any damage or leakage is found as a result of any inspection required in paragraph (f)(2) of this AD, before further flight, do the applicable corrective actions following the instructions in *Costruzioni Aeronautiche TECNAM P2006T Aircraft Maintenance Manual*, Document No. 2006/045, 2nd Edition—Revision 1, dated April 27, 2011.

#### (g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Albert Mercado, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4119; fax: (816) 329-4090; email: [albert.mercado@faa.gov](mailto:albert.mercado@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements*: For any reporting requirement in this AD, a federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

#### (h) Related Information

Refer to MCAI European Aviation Safety Agency (EASA) AD No.: 2012-0043, dated March 19, 2012; *Costruzioni Aeronautiche Tecnam Service Bulletin SB 80-CS*, dated January 2, 2012; and *Costruzioni Aeronautiche Tecnam P2006T Maintenance Manual*, 2nd Edition, Revision 1, dated April 7, 2011, for related information. For service information related to this AD, contact *Costruzioni Aeronautiche TECNAM Airworthiness Office*, Via Maiorise—81043 Capua (CE) Italy; telephone: +39 0823 620134; fax: +39 0823 622899; email:

[m.oliva@tecnam.com](mailto:m.oliva@tecnam.com), or [g.paduano@tecnam.com](mailto:g.paduano@tecnam.com); Internet: [www.tecnam.com](http://www.tecnam.com). You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

#### (i) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) *Costruzioni Aeronautiche TECNAM Service Bulletin SB 80-CS*, dated January 2, 2012; and

(ii) *Costruzioni Aeronautiche TECNAM P2006T Aircraft Maintenance Manual*, Document No. 2006/045, 2nd Edition—Revision 1, dated April 27, 2011.

(3) For *Costruzioni Aeronautiche TECNAM* service information identified in this AD, contact *Costruzioni Aeronautiche TECNAM Airworthiness Office*, Via Maiorise—81043 Capua (CE) Italy; telephone: +39 0823 620134; fax: +39 0823 622899; email: [m.oliva@tecnam.com](mailto:m.oliva@tecnam.com), or [g.paduano@tecnam.com](mailto:g.paduano@tecnam.com); Internet: [www.tecnam.com](http://www.tecnam.com).

(4) You may review copies of the service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on August 29, 2012.

#### Earl Lawrence,

Manager, Small Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2012-21927 Filed 9-14-12; 8:45 am]

BILLING CODE 4910-13-P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2011-0639; Directorate Identifier 2011-CE-016-AD; Amendment 39-17169; AD 2012-17-06]

RIN 2120-AA64

#### Airworthiness Directives; Piper Aircraft, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Piper Aircraft, Inc. Models PA-24, PA-24-250, and PA-24-260 airplanes. This AD was prompted by reports of cracks developing in the stabilator horn assembly. This AD requires replacement of the stabilator horn assembly and/or repetitive inspections of the stabilator horn assembly for corrosion or cracks, as applicable. Corrosion or cracks could lead to failure of the stabilator horn. Consequently, failure of the stabilator horn could lead to a loss of pitch control in flight. We are issuing this AD to correct the unsafe condition on these products.

**DATES:** This AD is effective October 22, 2012.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of October 22, 2012.

**ADDRESSES:** For service information identified in this AD, contact Piper Aircraft, Inc., 2926 Piper Drive, Vero Beach, Florida 32960; telephone: (772) 567-4361; fax: (772) 978-6573; Internet: <http://www.newpiper.com/company/publications.asp>. You may review copies of the referenced service information at the FAA, Small Airplane Directorate, 901 Locust St., Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

#### FOR FURTHER INFORMATION CONTACT:

Gregory K. Noles, Aerospace Engineer, FAA, Atlanta Aircraft Certification Office, 1701 Columbia Avenue, College Park, Georgia 30337; phone: (404) 474-5551; fax: (404) 474-5606; email: [gregory.noles@faa.gov](mailto:gregory.noles@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That