

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM (77 FR 63268, October 16, 2012), the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2013-02-11 Airbus:** Amendment 39-17332. Docket No. FAA-2012-1071; Directorate Identifier 2012-NM-070-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective March 8, 2013.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to all Airbus Model A310-203 airplanes, certificated in any category.

#### (d) Subject

Air Transport Association (ATA) of America Code 71, Powerplant.

#### (e) Reason

This AD was prompted by a report of an analysis that demonstrated a reduced fatigue life for the side link bolts, center sway link bolts, and thrust link bolts on the forward engine mounts. We are issuing this AD to prevent deterioration of the structural integrity of the bolts, which could result in possible damage to an engine or wing.

#### (f) Compliance

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

#### (g) Actions

Within 18 months after the effective date of this AD, replace all side link bolts on left hand (LH) and right hand (RH) side of the engines, and all center sway link bolts and thrust link bolts of both engines, having any part number (P/N) identified in paragraphs (g)(1) through (g)(6) of this AD, with new bolts having the same part number, in accordance with the Accomplishment Instructions of Airbus Mandatory Service Bulletin A310-71-2037, including Appendices 01 and 02, dated September 30, 2011. Repeat the bolt replacements thereafter at intervals not exceeding 134 months.

- (1) P/N 9021M88P01.
- (2) P/N 9021M88P02.
- (3) P/N 9205M81P01.
- (4) P/N 9021M88P03.
- (5) P/N 9021M88P04.
- (6) P/N 9205M82P01.

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Dan Rodina, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-2125; fax (425) 227-1147. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority

(or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (i) Related Information

Refer to MCAI European Aviation Safety Agency Airworthiness Directive 2012-0056, dated April 3, 2012; and Airbus Mandatory Service Bulletin A310-71-2037, including Appendices 01 and 02, dated September 30, 2011; for related information.

#### (j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Airbus Mandatory Service Bulletin A310-71-2037, including Appendices 01 and 02, dated September 30, 2011.

(ii) Reserved.

(3) For service information identified in this AD, contact Airbus SAS—EAW (Airworthiness Office), 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>.

(4) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on January 17, 2013.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-01820 Filed 1-31-13; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2012-1102; Directorate Identifier 2012-NM-062-AD; Amendment 39-17333; AD 2013-02-12]**

**RIN 2120-AA64**

### Airworthiness Directives; EADS CASA (Type Certificate Previously Held by Construcciones Aeronáuticas, S.A.) Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all EADS CASA (Type Certificate previously held by Construcciones Aeronáuticas, S.A.) Model CN-235, CN-235-100, CN-235-200, and CN-235-300 airplanes. This AD was prompted by reports of incorrect electrical polarity connections on engine fire extinguishing discharge cartridges. This AD requires a one-time inspection to identify the correct polarity for each pair of electrical connectors on each engine fire extinguisher cartridge, and repair if necessary. We are issuing this AD to detect and correct incorrect polarity connections, which could prevent the actuation of the discharge cartridge in case of automatic fire detection or manual initiation during a potential engine fire, and could result in damage to the airplane and injury to passengers.

**DATES:** This AD becomes effective March 8, 2013.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of March 8, 2013.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> or in person at the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

**FOR FURTHER INFORMATION CONTACT:** Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1112; fax (425) 227-1149.

**SUPPLEMENTARY INFORMATION:****Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM was published in the **Federal Register** on October 18, 2012 (77 FR 64053). That NPRM proposed to correct an unsafe condition for the specified products. The Mandatory Continuing Airworthiness Information (MCAI) states:

Reports have been received of finding wrong electrical polarity connections of engine fire extinguishing discharge cartridges on CASA CN-235 aeroplanes. The results of the subsequent investigation showed that the incorrect discharge cartridge assembly was caused by production line errors.

This condition, if not detected and corrected, could prevent the actuation of the

discharge cartridge in case of automatic fire detection or manual initiation in case of engine fire, possibly resulting in damage to the aeroplane and injury to occupants.

To address this potential unsafe condition, EADS CASA (Airbus Military) developed instructions to identify erroneous wiring polarity installation.

For the reasons described above this [European Aviation Safety Agency] AD requires a one-time inspection to verify proper electrical polarity of wiring of each engine fire extinguisher discharge cartridge and, depending on findings, corrective action [accomplish the repair].

You may obtain further information by examining the MCAI in the AD docket.

**Comments**

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (77 FR 64053, October 18, 2012) or on the determination of the cost to the public.

**Conclusion**

We reviewed the available data and determined that air safety and the public interest require adopting the AD as proposed.

**Costs of Compliance**

We estimate that this AD will affect 6 products of U.S. registry. We also estimate that it will take about 4 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this AD to the U.S. operators to be \$2,040, or \$340 per product.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM (77 FR 64053, October 18, 2012), the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new AD:

**2013-02-12 EADS CASA (Type Certificate previously held by Construcciones Aeronáuticas, S.A.): Amendment 39-**

17333. Docket No. FAA-2012-1102;  
Directorate Identifier 2012-NM-062-AD.

**(a) Effective Date**

This airworthiness directive (AD) becomes effective March 8, 2013.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to all EADS CASA (Type Certificate previously held by Construcciones Aeronáuticas, S.A.) Model CN-235, CN-235-100, CN-235-200, and CN-235-300 airplanes, certificated in any category, all serial numbers.

**(d) Subject**

Air Transport Association (ATA) of America Code 26, Fire protection.

**(e) Reason**

This AD was prompted by reports of incorrect electrical polarity connections on engine fire extinguishing discharge cartridges. We are issuing this AD to detect and correct incorrect polarity connections, which could prevent the actuation of the discharge cartridge in case of automatic fire detection or manual initiation during a potential engine fire, and could result in damage to the airplane and injury to passengers.

**(f) Compliance**

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**(g) Inspection**

Within 30 days after the effective date of this AD, do a one-time inspection to identify the correct polarity for each pair of electrical connectors on each engine fire extinguisher cartridge, in accordance with the Instructions of Airbus Military All Operator Letter 235-020, dated March 9, 2012.

**(h) Corrective Action**

If, during the inspection required by paragraph (g) of this AD, erroneous wiring polarity is detected: Before further flight, repair in accordance with a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or European Aviation Safety Agency (EASA) (or its delegated agent).

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Shahram Daneshmandi, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind

Avenue SW., Renton, WA 98057-3356; telephone (425) 227-1112; fax (425) 227-1149. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(j) Related Information**

Refer to MCAI EASA Airworthiness Directive 2012-0045, dated March 21, 2012, and Airbus Military All Operator Letter 235-020, dated March 9, 2012, for related information.

**(k) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Airbus Military All Operator Letter 235-020, dated March 9, 2012.

(ii) Reserved.

(3) For service information identified in this AD, contact EADS-CASA, Military Transport Aircraft Division (MTAD), Integrated Customer Services (ICS), Technical Services, Avenida de Aragón 404, 28022 Madrid, Spain; telephone +34 91 585 55 84; fax +34 91 585 55 05; email [MTA.TechnicalService@casa.eads.net](mailto:MTA.TechnicalService@casa.eads.net); Internet <http://www.eads.net>.

(4) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on January 23, 2013.

**Ali Bahrami,**

Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2013-02074 Filed 1-31-13; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF THE TREASURY**

**Internal Revenue Service**

**26 CFR Part 1**

[TD 9611]

RIN 1545-BL49

**Health Insurance Premium Tax Credit**

**AGENCY:** Internal Revenue Service (IRS), Treasury.

**ACTION:** Final regulations.

**SUMMARY:** This document contains final regulations relating to the health insurance premium tax credit enacted by the Patient Protection and Affordable Care Act and the Health Care and Education Reconciliation Act of 2010. These final regulations provide guidance to individuals related to employees who may enroll in eligible employer-sponsored coverage and who wish to enroll in qualified health plans through Affordable Insurance Exchanges (Exchanges) and claim the premium tax credit.

**DATES:** *Effective date:* These regulations are effective on February 1, 2013.

*Applicability date:* For date of applicability, see § 1.36B-1(o).

**FOR FURTHER INFORMATION CONTACT:** Andrew S. Braden, (202) 622-4960 (not a toll-free number).

**SUPPLEMENTARY INFORMATION:**

**Background**

This document contains final regulations that amend the Income Tax Regulations (26 CFR part 1) under section 36B of the Internal Revenue Code (Code) regarding whether health coverage under an employer-sponsored plan is affordable for individuals who are eligible to enroll in the plan by reason of their relationship to an employee (related individuals).

On August 17, 2011, a notice of proposed rulemaking (REG-131491-10) was published in the **Federal Register** (76 FR 50931). On May 23, 2012, final regulations (TD 9590) were published in the **Federal Register** (77 FR 30377). The final regulations reserved a rule (§ 1.36B-2(c)(3)(v)(A)(2)) for determining affordability of employer-sponsored coverage for related individuals. Written comments responding to the proposed and final regulations were received. The comments are available for public inspection at [www.regulations.gov](http://www.regulations.gov) or on request. A public hearing was held on November 17, 2011. After consideration of all the comments, the proposed rule is adopted without change by this Treasury decision.