

**(d) Subject**

Air Transport Association (ATA) of America Code 57; Wings.

**(e) Reason**

This AD was prompted by reports of a fractured wing lower rear spar cap and reinforcing strap. We are issuing this AD to detect and correct cracked wing structure, which could result in failure of the wing.

**(f) Compliance**

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**(g) Inspection and Repair**

Within 10 flight hours after the effective date of this AD, do a detailed inspection for cracking of the left-hand (LH) and right-hand (RH) wing lower skin between wing stations (WS) 45.00 and 51.00, in accordance with Part A of Bombardier Alert Service Bulletin 215-A558, dated April 5, 2013. Repeat the inspection thereafter at intervals not to exceed 25 flight hours, until the inspection specified in paragraph (h)(1) or (h)(2) of this AD has been accomplished. If any cracking is found during the inspection required by paragraph (g) of this AD, before further flight, repair the crack using a method approved by the Manager, New York Aircraft Certification Office (ACO), FAA; or Transport Canada Civil Aviation (TCCA) (or its delegated agent).

**(h) Optional Terminating Actions**

(1) Accomplishing a one-time detailed inspection for cracking of the LH and RH wing lower skin, front and rear spar caps, front and rear spar webs, and reinforcing straps, in accordance with Part B of Bombardier Alert Service Bulletin 215-A558, dated April 5, 2013, terminates the actions required by paragraph (g) of this AD. If any cracking is found during the one-time detailed inspection, before further flight, repair the crack using a method approved by the Manager, New York ACO, FAA; or TCCA (or its delegated agent).

(2) Accomplishing a one-time eddy current inspection for cracking of the LH and RH wing lower front and rear spar caps, in accordance with paragraph 3.B. and paragraphs 4. through 9. (Part C-1), and paragraphs 10. through 16. (Part C-2), of Bombardier Alert Service Bulletin 215-A558, dated April 5, 2013, terminates the actions required by paragraph (g) of this AD. If any cracking is found during the one-time eddy current inspection, before further flight, repair the crack using a method approved by the Manager, New York ACO, FAA; or TCCA (or its delegated agent).

**(i) Reporting Requirement**

Submit a report of the crack findings of the inspections specified in paragraphs (g), (h)(1), and (h)(2) of this AD to Bombardier Aerospace Specialized and Amphibious Aircraft Technical Support at email: [mtl.saa.tech.support@aero.bombardier.com](mailto:mtl.saa.tech.support@aero.bombardier.com). Submit the report at the applicable time specified in paragraph (i)(1) or (i)(2) of this AD. The report must include the inspection

results, a description of any discrepancies found, the airplane serial number, and the number of landings and flight hours on the airplane.

(1) If the inspection was done on or after the effective date of this AD: Submit the report within 14 days after the inspection.

(2) If the inspection was done before the effective date of this AD: Submit the report within 14 days after the effective date of this AD.

**(j) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO, ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements*: A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120-0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES-200.

**(k) Related Information**

Refer to Mandatory Continuing Airworthiness Information Canadian Emergency Airworthiness Directive CF-2013-11, dated April 17, 2013; and Bombardier Alert Service Bulletin 215-A558, dated April 5, 2013; for related information.

**(l) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Bombardier Alert Service Bulletin 215-A558, dated April 5, 2013.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on May 17, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-12615 Filed 5-29-13; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2012-0793; Airspace Docket No. 12-ANE-14]

**Establishment of Class E Airspace; Bass Harbor, ME**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action establishes Class E Airspace at Bass Harbor, ME, to accommodate a new Area Navigation (RNAV) Global Positioning System (GPS) special Standard Instrument Approach Procedure (SIAP) serving Bass Harbor Heliport. This action enhances the safety and airspace management of Instrument Flight Rules (IFR) operations within the National Airspace System. Also, geographic coordinates are corrected under their proper heading.

**DATES:** Effective 0901 UTC, August 22, 2013. The Director of the Federal

Register approves this incorporation by reference action under title 1, Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.9 and publication of conforming amendments.

**FOR FURTHER INFORMATION CONTACT:** John Fornito, Operations Support Group, Eastern Service Center, Federal Aviation Administration, P.O. Box 20636, Atlanta, Georgia 30320; telephone (404) 305-6364.

**SUPPLEMENTARY INFORMATION:**

**History**

On March 28, 2013, the FAA published in the **Federal Register** a notice of proposed rulemaking (NPRM) to establish Class E airspace at Bass Harbor, ME (78 FR 18931). Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received. Subsequent to publication the FAA found that the points of space coordinates were incorrect. This action makes the correction. Except for editorial changes and the changes listed above, this rule is the same as published in the NPRM.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.9W dated August 8, 2012, and effective September 15, 2012, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designations listed in this document will be published subsequently in the Order.

**The Rule**

This amendment to Title 14, Code of Federal Regulations (14 CFR) part 71 establishes Class E airspace extending upward from 700 feet above the surface at Bass Harbor, ME, providing the controlled airspace required to support the new Copter RNAV (GPS) special standard instrument approach procedures for Bass Harbor Heliport. Controlled airspace within a 6-mile radius of the point in space coordinates of the heliport is necessary for the safety and management of IFR operations at the heliport. Geographic coordinates for the heliport and points in space are corrected and separately listed.

The FAA has determined that this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current, is non-controversial and unlikely to result in adverse or negative comments. It, therefore, (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT

Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a Regulatory Evaluation as the anticipated impact is so minimal. Since this is a routine matter that only affects air traffic procedures and air navigation, it is certified that this rule, when promulgated, does not have a significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act. The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it establishes controlled airspace at Bass Harbor Heliport, Bass Harbor, ME.

**Environmental Review**

The FAA has determined that this action qualifies for categorical exclusion under the National Environmental Policy Act in accordance with FAA Order 1050.1E, "Environmental Impacts: Policies and Procedures," paragraph 311a. This airspace action is not expected to cause any potentially significant environmental impacts, and no extraordinary circumstances exist that warrant preparation of an environmental assessment.

**Lists of Subjects in 14 CFR Part 71**

Airspace, Incorporation by reference, Navigation (air).

**Adoption of the Amendment**

In consideration of the foregoing, the Federal Aviation Administration amends 14 CFR part 71 as follows:

**PART 71—DESIGNATION OF CLASS A, B, C, D AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS**

- 1. The authority citation for part 71 continues to read as follows:

**Authority:** 49 U.S.C. 106(g); 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959–1963 Comp., p. 389.

**§ 71.1 [Amended]**

- 2. The incorporation by reference in 14 CFR 71.1 of Federal Aviation

Administration Order 7400.9W, Airspace Designations and Reporting Points, dated August 8, 2012, effective September 15, 2012, is amended as follows:

*Paragraph 6005 Class E airspace areas extending upward from 700 feet or more above the surface of the earth.*

\* \* \* \* \*

**ANE ME E5 Bass Harbor, ME [New]**

Bass Harbor Heliport, ME  
(Lat. 44°15'16" N., long. 68°20'57" W.)  
Point in Space Coordinates  
(Lat. 44°14'49" N., long. 68°20'18" W.)

That airspace extending upward from 700 feet above the surface within a 6-mile radius of the Point in Space Coordinates (lat. 44°14'49" N., long. 68°20'18" W.) serving Bass Harbor Heliport

Issued in College Park, Georgia, on May 21, 2013.

**Jackson Allen,**

*Acting Manager, Operations Support Group, Eastern Service Center, Air Traffic Organization.*

[FR Doc. 2013–12705 Filed 5–29–13; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF HOMELAND SECURITY**

**U.S. Customs and Border Protection**

**DEPARTMENT OF THE TREASURY**

**19 CFR Parts 10, 24, 162, 163, and 178**

[USCBP–2012–0007; CBP Dec. 13–08]

RIN 1515–AD86

**United States-Korea Free Trade Agreement**

**AGENCIES:** U.S. Customs and Border Protection, Department of Homeland Security; Department of the Treasury.

**ACTION:** Final rule.

**SUMMARY:** This document adopts as a final rule, with two changes, interim amendments to the U.S. Customs and Border Protection ("CBP") regulations which were published in the **Federal Register** on March 19, 2012, as CBP Dec. 12–03, to implement the preferential tariff treatment and other customs-related provisions of the United States-Korea Free Trade Agreement entered into by the United States and the Republic of Korea.

**DATES:** Effective July 1, 2013.

**FOR FURTHER INFORMATION CONTACT:**

*Textile Operational Aspects:* Jackie Sprungle, Trade Policy and Programs, Office of International Trade, (202) 863–6517.

*Other Operational Aspects:* Katrina Chang, Trade Policy and Programs,