

August 18, 2008, excluding Figure 2 sheets 1 and 4.

(i) Reserved.

(3) For BHTC service information identified in this AD, contact Bell Helicopter Textron Canada Limited, 12,800 Rue de l'Avenir, Mirabel, Quebec J7Y1R4; telephone (450) 437-2862 or (800) 363-8023; fax (450) 433-0272; or at <http://www.bellcustomer.com/files/>.

(4) You may view this service information at FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137. For information on the availability of this material at the FAA, call (817) 222-5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Fort Worth, Texas, on June 3, 2013.

**Kim Smith,**

*Directorate Manager, Rotorcraft Directorate, Aircraft Certification Service.*

[FR Doc. 2013-14857 Filed 6-26-13; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2013-0205; Directorate Identifier 2012-NM-226-AD; Amendment 39-17493; AD 2013-13-05]**

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all The Boeing Company Model 747SP series airplanes, and certain The Boeing

Company Model 747-100B SUD and 747-300 series airplanes. This AD was prompted by an evaluation by the design approval holder indicating that the fuselage skin just above certain lap splice locations is subject to widespread fatigue damage. This AD requires repetitive inspections for cracking of the fuselage skin above certain lap splice locations, and repair if necessary. We are issuing this AD to detect and correct fatigue cracking of the fuselage skin, which could result in reduced structural integrity of the airplane and sudden loss of cabin pressure.

**DATES:** This AD is effective August 1, 2013.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in the AD as of August 1, 2013.

**ADDRESSES:** For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may review copies of the service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Nathan Weigand, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6428; fax: 425-917-6590; email: [Nathan.P.Weigand@faa.gov](mailto:Nathan.P.Weigand@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 to include an AD that would apply to the specified products. That NPRM published in the **Federal Register** on March 7, 2013 (78 FR 14719). That NPRM proposed to require repetitive inspections for cracking of the fuselage skin above certain lap splice locations, and repair if necessary.

**Comments**

We gave the public the opportunity to participate in developing this AD. We have considered the comment received. Boeing supported the NPRM (78 FR 14719, March 7, 2013).

**Conclusion**

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting the AD as proposed—except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (78 FR 14719, March 7, 2013) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (78 FR 14719, March 7, 2013).

**Costs of Compliance**

We estimate that this AD affects 4 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection .....	Up to 57 work-hours × \$85 per hour = \$4,845, per inspection cycle.	\$0	Up to \$4,845, per inspection cycle.	Up to \$19,380, per inspection cycle.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of

the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII,

Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

*For the reasons discussed above, I certify that this AD:*

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2013-13-05 The Boeing Company:** Amendment 39-17493; Docket No. FAA-2013-0205; Directorate Identifier 2012-NM-226-AD.

#### (a) Effective Date

This AD is effective August 1, 2013.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to The Boeing Company airplanes, certificated in any category, identified in paragraphs (c)(1), (c)(2), and (c)(3) of this AD.

- (1) All Model 747SP airplanes.
- (2) Model 747-100B SUD airplanes, line numbers 636 and 655.
- (3) Model 747-300 airplanes, line numbers 692 through 695 inclusive.

#### (d) Subject

Joint Aircraft System Component (JASC)/ Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Unsafe Condition

This AD was prompted by an evaluation by the design approval holder indicating that the fuselage skin just above certain lap splice locations is subject to widespread fatigue damage. We are issuing this AD to detect and correct fatigue cracking of the fuselage skin, which could result in reduced structural integrity of the airplane and sudden loss of cabin pressure.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Repetitive Inspections

Perform external sliding probe eddy current inspections of the fuselage skin for cracking, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 747-53A2854, dated September 17, 2012, except where this service bulletin specifies to contact Boeing for inspection instructions, this AD requires doing the inspection using a method approved in accordance with the procedures specified in paragraph (h) of this AD. Do the inspection at the applicable initial compliance time specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 747-53A2854, dated September 17, 2012, except that where this service bulletin specifies a compliance time after the "original issue date of this service bulletin," this AD requires compliance within the specified compliance time after the effective date of this AD.

(1) If no cracking is found during any inspection required by paragraph (g) of this AD, repeat the inspection thereafter at the applicable intervals specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 747-53A2854, dated September 17, 2012.

(2) If any cracking is found during any inspection required by paragraph (g) of this AD: Before further flight, repair the cracking using a method approved in accordance with the procedures specified in paragraph (h) of this AD.

#### (h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14

CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in the Related Information section of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

#### (i) Related Information

For more information about this AD, contact Nathan Weigand, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6428; fax: 425-917-6590; email: [Nathan.P.Weigand@faa.gov](mailto:Nathan.P.Weigand@faa.gov).

#### (j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 747-53A2854, dated September 17, 2012.

(ii) Reserved.

(3) For Boeing service information identified in this AD, Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>.

(4) You may review this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on June 12, 2013.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-15179 Filed 6-26-13; 8:45 am]

**BILLING CODE 4910-13-P**