

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2013-0705; Directorate Identifier 2013-NM-052-AD]

RIN 2120-AA64

**Airworthiness Directives; Bombardier, Inc. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc. Model BD-700-1A10 airplanes. This proposed AD was prompted by a report that the manufacturer has determined that some completion centers used the heater/brake monitoring unit (HBMU) logic circuit to control the line voltage of the drain mast heaters. Since the drain mast heaters are connected in parallel with the number 2 pitot static (PS) probe heater circuit, a number 2 PS probe heater failure may not be detected by the fault monitoring capabilities of the HBMU. This proposed AD would require a modification of the air data probes and sensors. We are proposing this AD to detect and correct an unannounced failure of two PS probe heaters, which could affect controllability of the airplane in icing conditions.

**DATES:** We must receive comments on this proposed AD by October 28, 2013.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email

[thd.crij@aero.bombardier.com](mailto:thd.crij@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the MCAI, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:**

Assata Dessaline, Aerospace Engineer, Avionics and Flight Test Branch, ANE-172, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone (516) 228-7301; fax (516) 794-5531.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2013-0705; Directorate Identifier 2013-NM-052-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

**Discussion**

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2012-32, dated December 13, 2012 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition

for the specified products. The MCAI states:

The aeroplane manufacturer has determined that some completion centers used the Heater/Brake Monitoring Unit (HBMU) logic circuit to control the line voltage of the drain mast heaters. This same logic circuit is also used to control the line voltage of the number 2 pitot static (PS) probe heater. Since the drain mast heaters are connected in parallel with the number 2 PS probe heater circuit, a number 2 PS probe heater failure may not be detected by the fault monitoring capabilities of the HBMU.

The unannounced failure of two PS probe heaters could adversely affect the aeroplane's flight characteristics in icing conditions.

This [Canadian] AD mandates a modification to the existing drain mast heater wiring to correct the fault-monitoring capabilities of the HBMU and eliminate the potential dormant failure of the number 2 PS probe heater.

You may obtain further information by examining the MCAI in the AD docket.

**Relevant Service Information**

Bombardier, Inc. has issued Service Bulletin 700-30-021, Revision 01, dated November 21, 2012. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

**FAA's Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type design.

**Differences Between This Proposed AD and the MCAI or Service Information**

This AD applies only to airplanes that have been modified by any FAA supplemental type certificate (STC) specified in table 1 of paragraph 1.A., "Effectivity," of Bombardier Service Bulletin 700-30-021, Revision 01, dated November 21, 2012.

**Costs of Compliance**

We estimate that this proposed AD affects 32 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

## ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Modification .....	35 work-hours × \$85 per hour =	\$0	\$2,975	\$95,200

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new AD:

**Bombardier, Inc.:** Docket No. FAA-2013-0705; Directorate Identifier 2013-NM-052-AD.

**(a) Comments Due Date**

We must receive comments by October 28, 2013.

**(b) Affected ADs**

None.

**(c) Applicability**

(1) This AD applies to Bombardier, Inc. Model BD-700-1A10 airplanes, certificated in any category, equipped with any electrical wiring heater current/brake temperature monitor unit (HBMU) installed in accordance with any FAA supplemental type certificate specified in table 1 of paragraph 1.A., "Effectivity," of Bombardier Service Bulletin 700-30-021, Revision 01, dated November 21, 2012.

(2) For airplanes on which the applicable service request for product support action (SRPSA) specified in table 3 and table 4 of paragraph 1.A., "Effectivity," of Bombardier Service Bulletin 700-30-021, Revision 01, dated November 21, 2012, has been incorporated, the requirements of this AD have been met.

**(d) Subject**

Air Transport Association (ATA) of America Code 30, Ice and Rain Protection.

**(e) Reason**

This AD was prompted by a report that the manufacturer has determined that some completion centers used the HBMU logic circuit to control the line voltage of the drain mast heaters. This same logic circuit is also used to control the line voltage of the number 2 pitot static (PS) probe heater. Since the drain mast heaters are connected in parallel with the number 2 PS probe heater circuit, a number 2 PS probe heater failure may not be detected by the fault monitoring capabilities of the HBMU. We are issuing this AD to detect and correct an unannounced

failure of two PS probe heaters, which could affect controllability of the airplane in icing conditions.

**(f) Compliance**

You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**(g) Modification**

Within 800 flight hours or 15 months after the effective date of this AD, whichever occurs first: Modify the air data probes and sensors, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 700-30-021, Revision 01, dated November 21, 2012.

**(h) Credit for Previous Actions**

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 700-30-021, dated August 28, 2012.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, New York 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2012-32, dated December 13, 2012. The MCAI can be found in the AD docket on the Internet at <http://www.regulations.gov>.

(2) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-

Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crj@aero.bombardier.com](mailto:thd.crj@aero.bombardier.com); Internet <http://www.bombardier.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 30, 2013.

**Stephen P. Boyd,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2013-22145 Filed 9-10-13; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2013-0706; Directorate Identifier 2013-NM-067-AD]

RIN 2120-AA64

#### Airworthiness Directives; the Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain the Boeing Company Model DC-9-10, DC-9-30, and DC-9-40 series airplanes. This proposed AD was prompted by an evaluation by the design approval holder (DAH) indicating that the aft pressure bulkhead web area is subject to widespread fatigue damage (WFD). This proposed AD would require modifying the aft pressure bulkhead. The modification includes inspecting for cracks around the rivet holes, and repair of any cracking. We are proposing this AD to prevent fatigue cracking of the aft pressure bulkhead, which could result in reduced structural integrity of the airplane.

**DATES:** We must receive comments on this proposed AD by October 28, 2013.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, 3855 Lakewood Boulevard, MC D800-0019, Long Beach, CA 90846-0001; telephone 206-544-5000, extension 2; fax 206-766-5683; Internet <https://www.myboeingfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Eric Schrieber, Aerospace Engineer, Airframe Branch, ANM-120L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, CA 90712-4137; phone: (562) 627-5348; fax: (562) 627-5210; email: [eric.schrieber@faa.gov](mailto:eric.schrieber@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2013-0706; Directorate Identifier 2013-NM-067-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

Structural fatigue damage is progressive. It begins as minute cracks, and those cracks grow under the action of repeated stresses. This can happen because of normal operational conditions and design attributes, or because of isolated situations or incidents such as material defects, poor fabrication quality, or corrosion pits, dings, or scratches. Fatigue damage can occur locally, in small areas or structural design details, or globally. Global fatigue damage is general degradation of large areas of structure with similar structural details and stress levels. Multiple-site damage is global damage that occurs in a large structural element such as a single rivet line of a lap splice joining two large skin panels. Global damage can also occur in multiple elements such as adjacent frames or stringers. Multiple-site-damage and multiple-element-damage cracks are typically too small initially to be reliably detected with normal inspection methods. Without intervention, these cracks will grow, and eventually compromise the structural integrity of the airplane, in a condition known as widespread fatigue damage (WFD). As an airplane ages, WFD will likely occur, and will certainly occur if the airplane is operated long enough without any intervention.

The FAA's WFD final rule (75 FR 69746, November 15, 2010) became effective on January 14, 2011. The WFD rule requires certain actions to prevent structural failure due to WFD throughout the operational life of certain existing transport category airplanes and all of these airplanes that will be certificated in the future. For existing and future airplanes subject to the WFD rule, the rule requires that DAHs establish a limit of validity (LOV) of the engineering data that support the structural maintenance program. Operators affected by the WFD rule may not fly an airplane beyond its LOV, unless an extended LOV is approved.

The WFD rule (75 FR 69746, November 15, 2010) does not require identifying and developing maintenance actions if the DAHs can show that such actions are not necessary to prevent WFD before the airplane reaches the LOV. Many LOVs, however, do depend on accomplishment of future maintenance actions. As stated in the WFD rule, any maintenance actions necessary to reach the LOV will be mandated by airworthiness directives through separate rulemaking actions.

In the context of WFD, this action is necessary to enable DAHs to propose