

(1) Insert a copy of the Sikorsky S-92A Rotorcraft Flight Manual (RFM) Supplement No. 45, Part I, dated July 30, 2012, into the RFM.

(2) For helicopters with S/N 920006 through 920132:

(i) Install an MGB failed pump sensor, Modification Kit Part Number (P/N) 92070-35007-011.

(ii) Install MGB vacuum switch wiring, Modification Kit P/N 92070-55039-013.

(3) For helicopters with S/N 920006 through 920179:

(i) Install an MGB auto bypass system, Modification Kit P/N 92070-55061-011.

(ii) Activate Aircraft Management System 7.1 software to show a new MGB "OIL OUT" visual warning.

(iii) Install enhanced ground proximity warning system software version 030.

#### (f) Special Flight Permit

Special flight permits are prohibited.

#### (g) Alternative Methods of Compliance (AMOC)

(1) The Manager, Boston Aircraft Certification Office, FAA, may approve AMOCs for this AD. Send your proposal to: Michael Schwetz, Aviation Safety Engineer, Boston Aircraft Certification Office, Engine & Propeller Directorate, FAA, 12 New England Executive Park, Burlington, Massachusetts 01803; telephone (781) 238-7761; email [michael.schwetz@faa.gov](mailto:michael.schwetz@faa.gov).

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office before operating any aircraft complying with this AD through an AMOC.

#### (h) Additional Information

Sikorsky Alert Service Bulletin (ASB) No. 92-63-024C, Revision C, dated October 7, 2011; Sikorsky ASBs 92-63-027 and 92-34-002, both Basic Issue and both dated January 21, 2013; Sikorsky Customer Service Notice (CSN) 92-068C, Revision C, dated March 27, 2012; CSN 92-069A, Revision A, dated November 10, 2011; CSN 92-089, Basic Issue, dated January 10, 2013; and Honeywell International, Inc., Service Bulletin 965-1595-34-23, Revision 0, dated March 13, 2012, which are not incorporated by reference, contain additional information about the subject of this AD. For service information identified in this AD, contact Sikorsky Aircraft Corporation, Customer Service Engineering, 124 Quarry Road, Trumbull, CT 06611; telephone 1-800-Winged-S or 203-416-4299; email [sikorskywcs@sikorsky.com](mailto:sikorskywcs@sikorsky.com); or at <http://www.sikorsky.com> and Honeywell International, Inc., at 15001 NE 36 Street, Redmond, WA 98052-5316, telephone (800) 601-3099; or at [www.myaerospace.com](http://www.myaerospace.com). You may review a copy of this service information at the FAA, Office of the Regional Counsel, Southwest Region, 2601 Meacham Blvd., Room 663, Fort Worth, Texas 76137.

#### (i) Subject

Joint Aircraft Service Component (JASC) Code: 6320 Main Rotor Gearbox.

Issued in Fort Worth, Texas, on July 17, 2014.

**S. Frances Cox,**

*Acting Directorate Manager, Rotorcraft Directorate, Aircraft Certification Service.*

[FR Doc. 2014-17334 Filed 7-22-14; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2014-0494; Directorate Identifier 2014-CE-017-AD]

RIN 2120-AA64

#### Airworthiness Directives; Pacific Aerospace Limited Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for Pacific Aerospace Limited Model 750XL airplanes. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as failure of the fin forward pickup due to possible fatigue cracks. We are issuing this proposed AD to require actions to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by September 8, 2014.

**ADDRESSES:** You may send comments by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** (202) 493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Pacific Aerospace Unlimited, Airport Road,

Hamilton, Private Bag HN3027, Hamilton 3240, New Zealand, phone: +64 7 843 6144; fax: +64 7 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz), internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may review this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0494; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4123; fax: (816) 329-4090; email: [Karl.Schletzbaum@faa.gov](mailto:Karl.Schletzbaum@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2014-0494; Directorate Identifier 2014-CE-017-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The Civil Aviation Authority (CAA), which is the aviation authority for New Zealand, has issued AD DCA/750XL/16A, dated June 18, 2014 (referred to after this as "the MCAI"), to correct an

unsafe condition for Pacific Aerospace Limited Model 750XL airplanes and was based on mandatory continuing airworthiness information originated by an aviation authority of another country. The MCAI states:

To prevent failure of the fin forward pickup due to possible fatigue cracks, inspect the fitting per the instructions in Pacific Aerospace Limited Mandatory Service Bulletin (MSB) PACSB/XL/068 issue 3, dated 29 May 2014.

If any cracks are found, replace both plates per PACSB/XL/068, before further flight.

You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0494.

### Relevant Service Information

Pacific Aerospace Limited has issued Mandatory Service Bulletin (MSB) PACSB/XL/068, issue 3, dated May 29, 2014. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

### FAA's Determination and Requirements of the Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

### Costs of Compliance

We estimate that this proposed AD will affect 17 products of U.S. registry. We also estimate that it would take about 1 work-hour per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the proposed AD on U.S. operators to be \$1,445, or \$85 per product.

In addition, we estimate that any necessary follow-on actions would take about 5 work-hours and require parts costing \$328, for a cost of \$753 per product. We have no way of determining the number of products that may need these actions.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I,

section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This proposed regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**Pacific Aerospace Limited:** Docket No. FAA-2014-0494; Directorate Identifier 2014-CE-017-AD.

#### (a) Comments Due Date

We must receive comments by September 8, 2014.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Pacific Aerospace Limited Model 750XL airplanes, all serial numbers, certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 53: Fuselage.

#### (e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as failure of the fin forward pickup due to possible fatigue cracks. We are issuing this proposed AD to detect and correct cracked fin forward pickup fittings to prevent failure of the fin forward pickup.

#### (f) Actions and Compliance

Do the following actions as specified in paragraphs (f)(1) through (f)(2), including all subparagraphs, of this AD, unless already done:

(1) Inspect the fin forward pickup fittings for cracks on or before 2,000 hours total time-in-service (TTIS) or 150 hours time-in-service (TIS) after the effective date of this AD, whichever occurs later, and repetitively thereafter at intervals not to exceed 600 hours TIS or annual inspection, whichever occurs first. Follow Pacific Aerospace Limited Mandatory Service Bulletin (MSB) PACSB/XL/068, issue 3, dated May 29, 2014.

**Note 1 to paragraph (f)(1) of this AD:** The MCAI mentions actions that are different for standard category versus restricted category airplanes. The Pacific Aerospace Limited Model 750XL airplane is only type certificated in the normal (standard) category in the United States so these are the actions that are specified in this AD.

(2) If you find any cracks as a result of any inspection required by paragraph (f)(1) of this AD, before further flight, replace both plates. Do the replacement following Pacific Aerospace Limited Mandatory Service Bulletin (MSB) PACSB/XL/068, issue 3, dated May 29, 2014.

#### (g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Karl Schletzbaum, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4123; fax: (816) 329-4090; email: [Karl.Schletzbaum@faa.gov](mailto:Karl.Schletzbaum@faa.gov).

Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product*: For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

#### (h) Related Information

Refer to MCAI New Zealand Civil Aviation Authority (CAA) AD DCA/750XL/16A, dated June 18, 2014, for related information. You may examine the MCAI on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0494. For service information related to this AD, contact Pacific Aerospace Unlimited, Airport Road, Hamilton, Private Bag HN3027, Hamilton 3240, New Zealand, phone: +64 7 843 6144; fax: +64 7 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz), internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may review this referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on July 17, 2014.

**Kelly A. Broadway**,  
Acting Manager, Small Airplane Directorate,  
Aircraft Certification Service.

[FR Doc. 2014-17339 Filed 7-22-14; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2014-0309; Airspace  
Docket No. 14-AWP-3]

#### Proposed Amendment of Class E Airspace; Lakeport, CA

**AGENCY**: Federal Aviation  
Administration (FAA), DOT.

**ACTION**: Notice of proposed rulemaking  
(NPRM).

**SUMMARY**: This action proposes to amend Class E airspace at Lakeport, CA. Controlled airspace is necessary to accommodate Area Navigation (RNAV) Global Positioning System (GPS) standard instrument approach procedures at Lampson Field. The FAA is proposing this action to enhance the safety and management of aircraft operations at the airport.

**DATES**: Comments must be received on or before September 8, 2014.

**ADDRESSES**: Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590; telephone (202) 366-9826. You must identify FAA Docket No. FAA-2014-0309; Airspace Docket No. 14-AWP-3, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>.

#### FOR FURTHER INFORMATION CONTACT:

Richard Roberts, Federal Aviation Administration, Operations Support Group, Western Service Center, 1601 Lind Avenue SW., Renton, WA 98057; telephone (425) 203-4517.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers (FAA Docket No. FAA-2014-0309 and Airspace Docket No. 14-AWP-3) and be submitted in triplicate to the Docket Management System (see **ADDRESSES** section for address and phone number). You may also submit comments through the Internet at <http://www.regulations.gov>.

Commenters wishing the FAA to acknowledge receipt of their comments on this action must submit with those comments a self-addressed stamped postcard on which the following statement is made: "Comments to FAA Docket No. FAA-2014-0309 and Airspace Docket No. 14-AWP-3". The postcard will be date/time stamped and returned to the commenter.

All communications received on or before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this action may be changed in light of comments received. All comments submitted will be available for examination in the public docket both before and after the closing date for comments. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

#### Availability of NPRM's

An electronic copy of this document may be downloaded through the Internet at <http://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's Web page at [http://www.faa.gov/airports\\_airtraffic/air\\_traffic/publications/airspace\\_amendments/](http://www.faa.gov/airports_airtraffic/air_traffic/publications/airspace_amendments/).

You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office (see the **ADDRESSES** section for the address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined during normal business hours at the Northwest Mountain Regional Office of the Federal Aviation Administration, Air Traffic Organization, Western Service Center, Operations Support Group, 1601 Lind Avenue SW., Renton, WA 98057.

Persons interested in being placed on a mailing list for future NPRM's should contact the FAA's Office of Rulemaking, (202) 267-9677, for a copy of Advisory Circular No. 11-2A, Notice of Proposed Rulemaking Distribution System, which describes the application procedure.

#### The Proposal

The FAA is proposing an amendment to Title 14 Code of Federal Regulations (14 CFR) Part 71 by creating Class E airspace extending upward from 700 feet above the surface within a 4-mile radius of Lampson Field, Lakeport, CA. Controlled airspace is needed for RNAV (GPS) standard instrument approaches and departures. This action would enhance the safety and management of aircraft operations at the airport.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.9X, dated August 7, 2013, and effective September 15, 2013, which is incorporated by reference in 14 CFR Part 71.1. The Class E airspace designation listed in this document will be published subsequently in this Order.

The FAA has determined this proposed regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current. Therefore, this proposed regulation; (1) is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated