

25–1141, dated August 19, 2013; as applicable.

(1) If, during the measurement required by paragraph (i) of this AD, it is determined that there is a gap equal to or greater than 6 mm (0.236 inch): Before further flight, re-install the LH and RH Type III Emergency Exit Doors, in accordance with the Accomplishment Instructions of ATR Service Bulletin ATR42–25–0180, dated August 19, 2013; or ATR72–25–1141, dated August 19, 2013; as applicable.

(2) If, during the measurement required by paragraph (i) of this AD, it is determined that there is a gap less than 6 mm (0.236 inch): Before further flight, repair using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or ATR—GIE Avions de Transport Régional's EASA Design Organization Approval (DOA).

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1137; fax: 425–227–1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or EASA; or ATR—GIE Avions de Transport Régional's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

#### (k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA Airworthiness Directive 2013–0280, dated November 26, 2013, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–0077.

(2) For service information identified in this AD, contact ATR—GIE Avions de Transport Régional, 1, Allée Pierre Nadot, 31712 Blagnac Cedex, France; telephone +33 (0) 5 62 21 62 21; fax +33 (0) 5 62 21 67 18; email [continued.airworthiness@atr.fr](mailto:continued.airworthiness@atr.fr);

Internet <http://www.aerochain.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on January 15, 2015.

**John P. Piccola, Jr.,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015–00956 Filed 1–22–15; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2014–1047; Directorate Identifier 2014–NM–157–AD]

RIN 2120–AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A318, A319, A320, and A321 series airplanes. This proposed AD was prompted by a report that, during the assembly process, several gaps between the two parts of the girt bar fittings for the aft passenger doors were found to exceed tolerances. This proposed AD would require an inspection of the gap between the two parts of the girt bar fittings on left-hand (LH) and right-hand (RH) aft passenger doors, and corrective actions if necessary. We are proposing this AD to detect and correct incorrect gaps between the girt bar fittings. Detachment of a girt bar could lead to the separation of the slide or slide-raft from the fuselage, making the emergency exit inoperative, which could impede an emergency evacuation.

**DATES:** We must receive comments on this proposed AD by March 9, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal*: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax*: 202–493–2251.
- *Mail*: U.S. Department of

Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

• *Hand Delivery*: U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–1047; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1405; fax 425–227–1149.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2014–1047; Directorate Identifier 2014–NM–157–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each

substantive verbal contact we receive about this proposed AD.

### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2014–0178, dated July 25, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus Model A318, A319, A320, and A321 series airplanes. The MCAI states:

During final assembly line process, several AFT passenger door lower fitting gaps were found excessive and out of tolerance between two parts of the girt bar fittings. The gap contributes to the correct locking of the girt bar during the door lifting movement, ensuring the retention of the girt bar when the loads applied on the girt by the slide are directed from the outside to the inside. If the gap is too large, there is a risk that the girt bar, when subjected to these loads, will detach from one of the girt bar fittings.

This condition, if not detected and corrected, could lead to the separation of the slide/slide-raft from the fuselage, making the emergency exit inoperative and, consequently, significantly reducing the safety margin for the occupants during an evacuation.

For the reason described above, this [EASA] AD requires a detailed inspection (DET) to check the gap between the two parts of the girt bar fittings, on AFT passenger doors, left-hand (LH) and right-hand (RH) sides, and, depending on findings, accomplishment of the applicable corrective actions [such as modifying or replacing the automatic latch].

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–1047.

### Related Service Information

Airbus has issued Service Bulletin A320–53–1289, dated May 28, 2014. The service information describes procedures for a detailed inspection of the gap in the girt bar fittings of the aft passenger doors, LH and RH sides, and corrective actions. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information

referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

### Explanation of “RC” Procedures and Tests in Service Information

The FAA worked in conjunction with industry, under the Airworthiness Directives Implementation Aviation Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement was a new process for annotating which procedures and tests in the service information are required for compliance with an AD. Differentiating these procedures and tests from other tasks in the service information is expected to improve an owner’s/operator’s understanding of crucial AD requirements and help provide consistent judgment in AD compliance. The actions specified in the service information identified previously include procedures and tests that are identified as RC (required for compliance) because these procedures have a direct effect on detecting, preventing, resolving, or eliminating an identified unsafe condition.

As specified in a **NOTE** under the Accomplishment Instructions of the specified service information, procedures and tests identified as RC must be done to comply with the proposed AD. However, procedures and tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an alternative method of compliance (AMOC), provided the procedures and tests identified as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to procedures or tests identified as RC will require approval of an AMOC.

### Costs of Compliance

We estimate that this proposed AD affects 838 airplanes of U.S. registry.

We also estimate that it would take about 3 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$213,690, or \$255 per product.

In addition, we estimate that any necessary follow-on actions would take about 4 work-hours and require parts costing \$435, for a cost of \$775 per

product. We have no way of determining the number of aircraft that might need these actions.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

*For the reasons discussed above, I certify this proposed regulation:*

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

## PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA–2014–1047; Directorate Identifier 2014–NM–157–AD.

#### (a) Comments Due Date

We must receive comments by March 9, 2015.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Airbus airplanes identified in paragraphs (c)(1) through (c)(4) of this AD, certificated in any category, except those on which Airbus Modification 154966 has been embodied during production.

(1) Model A318–111, –112, –121, and –122 airplanes.

(2) Model A319–111, –112, –113, –114, –115, –131, –132, and –133 airplanes.

(3) Model A320–211, –212, –214, –231, –232, and –233 airplanes.

(4) Model A321–111, –112, –131, –211, –212, –213, –231, and –232 airplanes.

#### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Reason

This AD was prompted by a report that, during the assembly process, several gaps between the two parts of the girt bar fittings for the aft passenger doors were found to exceed tolerances. We are issuing this AD to detect and correct incorrect gaps between the girt bar fittings. Detachment of a girt bar could lead to the separation of the slide or slide-raft from the fuselage, making the emergency exit inoperative, which could impede an emergency evacuation.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Inspection and Corrective Action

Except as provided by paragraph (h) of this AD, within 36 months after the effective date of this AD, do a detailed inspection of the gap in the girt bar fittings of the aft passenger doors, LH and RH sides, and do all applicable corrective actions, in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320–53–1289, dated May 28, 2014. Do all applicable corrective actions before further flight.

#### (h) Exception

For any airplane that has been modified to a configuration where one or both LH and RH aft passenger doors are permanently

inoperative or deactivated: If any aft passenger door is reactivated, after reactivation but before further flight, do the detailed inspection of the reactivated aft passenger door(s) and all applicable corrective actions, as required by paragraph (g) of this AD.

#### (i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM–116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057–3356; telephone 425–227–1405; fax 425–227–1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Required for Compliance (RC):* If the service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures and tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(3) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM–116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (j) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency (EASA) Airworthiness Directive 2014–0178, dated July 25, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2014–1047.

(2) For service information identified in this AD, contact Airbus, Airworthiness

Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on January 14, 2015.

**John P. Piccola,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015–00943 Filed 1–22–15; 8:45 am]

**BILLING CODE 4910–13–P**

## CONSUMER PRODUCT SAFETY COMMISSION

### 16 CFR Part 1422

[Docket No. CPSC–2009–0087]

### Recreational Off-Highway Vehicles (ROVs); Notice of Extension of Comment Period

**AGENCY:** U.S. Consumer Product Safety Commission.

**ACTION:** Extension of comment period.

**SUMMARY:** The Consumer Product Safety Commission (Commission or CPSC) published a notice of proposed rulemaking (NPR) in the **Federal Register** on November 19, 2014, concerning recreational off-highway vehicles (ROVs). The NPR invited the public to submit written comments by February 2, 2015. In response to two requests for an extension, the Commission is extending the comment period.

**DATES:** Submit comments by April 8, 2015.

**ADDRESSES:** You may submit comments, identified by Docket No. CPSC–2009–0087, by any of the following methods:

#### *Electronic Submissions*

*Submit electronic comments in the following way:*

*Federal eRulemaking Portal:* <http://www.regulations.gov>. Follow the instructions for submitting comments. The Commission does not accept comments submitted by electronic mail (email), except through: <http://www.regulations.gov>. The Commission encourages you to submit electronic comments by using the Federal eRulemaking Portal, as described above.

#### *Written Submissions*

*Submit written submissions in the following way:*

*Mail/Hand delivery/Courier, preferably in five copies, to:* Office of the