

accordance with Part 5 of the Accomplishment Instructions of Boeing 707 Alert Service Bulletin A3515, dated December 19, 2007, or Boeing 707 Alert Service Bulletin A3515, Revision 1, dated October 10, 2014; or replace the chord, in accordance with Part 6 of the Accomplishment Instructions of Boeing 707 Alert Service Bulletin A3515, dated December 19, 2007, or Boeing 707 Alert Service Bulletin A3515, Revision 1, dated October 10, 2014.

**(m) Retained Supplemental Structural Inspection Document Inspections**

This paragraph restates the actions required by paragraph (m) of AD 2012–17–13, Amendment 39–17176 (77 FR 55681, September 11, 2012). For all airplanes: Within 180 days or 1,000 flight cycles after October 16, 2012 (the effective date of AD 2012–17–13), whichever occurs first, do the inspections of the applicable structurally significant items specified in and in accordance with the Accomplishment Instructions of Boeing 707 Alert Service Bulletin A3516, dated April 4, 2008. If any cracking is found, before further flight, repair in accordance with the procedures specified in paragraph (r) of this AD. The inspections required by AD 85–12–01 R1, Amendment 39–5439 (51 FR 36002, October 8, 1986), are still required, except, as of October 16, 2012 (the effective date of AD 2012–17–13), the flight-cycle interval for the repetitive inspections specified in paragraph 1.E., “Compliance,” of Boeing 707 Alert Service Bulletin A3516, dated April 4, 2008, must be counted in accordance with the requirements of paragraph (g) of this AD.

**(n) Retained Exception to Certain Service Information: Contacting FAA for Crack Repair**

This paragraph restates the actions required by paragraph (n) of AD 2012–17–13, Amendment 39–17176 (77 FR 55681, September 11, 2012), with revised service information. If any cracking is found during any inspection required by this AD, and Boeing 707 Alert Service Bulletin A3515, dated December 19, 2007, or Boeing 707 Alert Service Bulletin A3515, Revision 1, dated October 10, 2014, specifies to contact Boeing for appropriate action: Before further flight, repair the cracking using a method approved in accordance with the procedures specified in paragraph (r) of this AD.

**(o) Retained Exception to Certain Service Information: Nondestructive Test Compliance Procedures**

This paragraph restates the requirements of paragraph (o) of AD 2012–17–13, Amendment 39–17176 (77 FR 55681, September 11, 2012), with revised service information. Where Boeing 707 Alert Service Bulletin A3515, dated December 19, 2007, or Boeing 707 Alert Service Bulletin A3515, Revision 1, dated October 10, 2014, specifies that operators “refer to” nondestructive test (NDT) procedures, the procedures must be done in accordance with the service information identified in paragraphs (o)(1), (o)(2), and (o)(3) of this AD, as applicable.

(1) Figure 20, “Electrical Conductivity Measurement for Aluminum,” of Subject 51–

00–00, “Structures-General,” of Part 6—Eddy Current, of the Boeing 707/720 Nondestructive Test Manual, Document D6–48023, Revision 118, dated July 15, 2011.

(2) Subject 55–10–07, “Horizontal Stabilizer,” of Part 6—Eddy Current, of the Boeing 707/720 Nondestructive Test Manual, Document D6–48023, Revision 118, dated July 15, 2011.

(3) Subject 51–01–00, “Orientation and Preparation for Testing” of Part 1—General, of the Boeing 707/720 Nondestructive Test Manual, Document D6–48023, Revision 118, dated July 15, 2011.

**(p) Retained Parts Installation Prohibition**

As of October 16, 2012 (the effective date of AD 2012–17–13, Amendment 39–17176 (77 FR 55681, September 11, 2012)), no person may install any horizontal stabilizer assembly with any chord segment having a part number other than that identified in paragraph 2.C.2. of Boeing 707 Alert Service Bulletin A3515, dated December 19, 2007, or Boeing 707 Alert Service Bulletin A3515, Revision 1, dated October 10, 2014, on any airplane.

**(q) New Replacement of 7079 Aluminum Components**

Within 48 months after the effective date of this AD: Replace all 7079 aluminum chord segments of the upper and lower chords installed on the horizontal stabilizer with 7075 aluminum chord segments, in accordance with Part 6 of the Accomplishment Instructions of Boeing 707 Alert Service Bulletin A3515, Revision 1, dated October 10, 2014. Within 4,000 flight cycles after accomplishing the replacements required by this paragraph, repeat the inspection required by paragraph (j) of this AD; and repeat the inspection thereafter at intervals not to exceed 500 flight cycles, and before further flight after any replacement of the horizontal stabilizer.

**(r) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (s)(1) of this AD. Information may be emailed to: [9-ANM-LAACO-AMOC-Requests@faa.gov](mailto:9-ANM-LAACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Los Angeles ACO, to make those findings. For a repair method to be approved, the repair must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) AMOCs approved for AD 2012–17–13, Amendment 39–17176 (77 FR 55681, September 11, 2012), are approved as AMOCs for the corresponding provisions of this AD.

**(s) Related Information**

(1) For more information about this AD, contact Chandra Ramdoss, Aerospace Engineer, Airframe Branch, ANM–120L, FAA, Los Angeles Aircraft Certification Office (ACO), 3960 Paramount Boulevard, Lakewood, CA 90712–4137; phone: 562–627–5239; fax: 562–627–5210; email: [chandraduth.ramdoss@faa.gov](mailto:chandraduth.ramdoss@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, 3855 Lakewood Boulevard, MC D800–0019, Long Beach, CA 90846–0001; telephone 206–544–5000, extension 2; fax 206–766–5683; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

Issued in Renton, Washington, on July 16, 2015.

**Suzanne Masterson,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015–18559 Filed 7–29–15; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

[Docket No. FAA–2015–2964; Directorate Identifier 2014–NM–206–AD]

RIN 2120–AA64

**Airworthiness Directives; Airbus Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Airbus Model A319, A320, and A321 series airplanes. This proposed AD is intended to complete certain mandated programs intended to support the airplane reaching its limit of validity (LOV) of the engineering data that support the established structural maintenance program. This proposed AD would require reinforcing the forward pressure bulkhead at a certain stringer on both the left-hand and right-hand sides, and related investigative and corrective actions if necessary. We are proposing this AD to prevent fatigue cracking of the forward pressure

bulkhead, which could result in reduced structural integrity of the airplane.

**DATES:** We must receive comments on this proposed AD by September 14, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2964; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405; fax 425-227-1149.

#### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA-2015-2964; Directorate Identifier 2014-NM-206-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

As described in FAA Advisory Circular 120-104 ([http://www.faa.gov/documentLibrary/media/Advisory\\_Circular/120-104.pdf](http://www.faa.gov/documentLibrary/media/Advisory_Circular/120-104.pdf)), several programs have been developed to support initiatives that will ensure the continued airworthiness of aging airplane structure. The last element of those initiatives is the requirement to establish a LOV of the engineering data that support the structural maintenance program under 14 CFR 26.21. This proposed AD is the result of an assessment of the previously established programs by the design approval holder (DAH) during the process of establishing the LOV for Model A319, A320, and Model A321 series airplanes. The actions specified in this proposed AD are necessary to complete certain programs to ensure the continued airworthiness of aging airplane structure and to support an airplane reaching its LOV.

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2014-0209, dated September 19, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition on all Model A319, A320, and Model A321 series airplanes. The MCAI states:

During the A320 fatigue test campaign for Extended Service Goal (ESG), it was determined that fatigue damage could develop on the forward pressure bulkhead at Frame (FR) 35 on left hand (LH) side and right hand (RH) side.

This condition, if not detected and corrected, could affect the structural integrity of the aeroplane.

To address this potential unsafe condition, a reinforcement modification was developed, which has been published through Airbus Service Bulletin (SB) A320-53-1268 for in-service application to allow aeroplanes to operate up to the new ESG limit.

For the reasons described above, this [EASA] AD requires reinforcement of the centre fuselage forward pressure bulkhead at FR35.

The forward pressure bulkhead reinforcement includes related investigative actions of measuring the diameters of certain fastener holes, and if they are not oversized, doing a rotating probe inspection for cracking of the fastener holes.

Required corrective actions include cold expanding crack-free holes or repairing oversize or cracked holes by using a method approved by the FAA, EASA, or Airbus’s EASA Design Organization Approval (DOA).

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2964.

#### Related Service Information Under 1 CFR Part 51

Airbus has issued Service Bulletin A320-53-1268, Revision 02, dated July 15, 2014. The service information describes procedures for reinforcing the forward pressure bulkhead at frame 35, stringer 30, on both the left-hand and right-hand sides; and repairs. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this NPRM.

#### FAA’s Determination and Requirements of This Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

#### Explanation of “RC” Procedures and Tests in Service Information

The FAA worked in conjunction with industry, under the Airworthiness Directives Implementation Aviation

Rulemaking Committee (AD ARC), to enhance the AD system. One enhancement was a new process for annotating which procedures and tests in the service information are required for compliance with an AD. Differentiating these procedures and tests from other tasks in the service information is expected to improve an owner's/operator's understanding of crucial AD requirements and help provide consistent judgment in AD compliance. The actions specified in the service information identified previously include procedures and tests that are identified as RC (required for compliance) because these procedures have a direct effect on detecting, preventing, resolving, or eliminating an identified unsafe condition.

As specified in a NOTE under the Accomplishment Instructions of the specified service information, procedures and tests that are identified as RC in any service information must be done to comply with the proposed AD. However, procedures and tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an alternative method of compliance (AMOC), provided the procedures and tests identified as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to procedures or tests identified as RC will require approval of an AMOC.

#### Costs of Compliance

We estimate that this proposed AD affects 48 airplanes of U.S. registry.

We also estimate that it would take about 21 work-hours per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$85,680, or \$1,785 per product.

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII:

Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA-2015-2964; Directorate Identifier 2014-NM-206-AD.

#### (a) Comments Due Date

We must receive comments by September 14, 2015.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to the Airbus airplanes identified in paragraphs (c)(1), (c)(2), and (c)(3) of this AD, certificated in any category, all manufacturer serial numbers.

(1) Airbus Model A319-111, -112, -113, -114, -115, -131, -132, and -133 airplanes.

(2) Airbus Model A320-211, -212, -214, -231, -232, and -233 airplanes.

(3) Airbus Model A321-111, -112, -131, -211, -212, -213, -231, and -232 airplanes.

#### (d) Subject

Air Transport Association (ATA) of America Code 53, Fuselage.

#### (e) Reason

This AD is intended to complete certain mandated programs intended to support the airplane reaching its limit of validity (LOV) of the engineering data that support the established structural maintenance program. We are issuing this AD to prevent fatigue cracking of the forward pressure bulkhead, which could result in reduced structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Reinforcement, Related Investigative Actions, and Corrective Actions

Before the accumulation of 48,000 total flight cycles or 96,000 total flight hours, whichever occurs first: Reinforce the forward pressure bulkhead at frame 35, stringer 30, on both the left-hand and right-hand sides; and do all applicable related investigative and corrective actions; in accordance with the Accomplishment Instructions of Airbus Service Bulletin A320-53-1268, Revision 02, dated July 15, 2014, except as provided by paragraph (h) of this AD. Do all corrective actions before further flight.

#### (h) Exception to Service Information Specifications

Although Airbus Service Bulletin A320-53-1268, Revision 02, dated July 15, 2014, specifies to contact Airbus for repair instructions, and specifies that action as "RC" (Required for Compliance), this AD requires repair before further flight using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA).

#### (i) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Airbus Service Bulletin A320-53-1268, dated January 8, 2013; or Airbus Service Bulletin A320-53-1268, Revision 01, dated July 23, 2013. This service

information is not incorporated by reference in this AD.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Sanjay Ralhan, Aerospace Engineer, International Branch, ANM-116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405; fax 425-227-1149. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (h) of this AD, if any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2014-0209, dated September 19, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2964.

(2) For service information identified in this AD, contact Airbus, Airworthiness Office—ELAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on July 17, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-18534 Filed 7-29-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-2966; Directorate Identifier 2015-NM-051-AD]

RIN 2120-AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 787-8 airplanes. This proposed AD was prompted by a report of fuel leaking onto the hot exhaust portion of an engine as a result of an un-intended leak path from the leading edge through the pylons. This proposed AD would require installing new seal dams in the inboard and outboard corners of the aft pylon frame on the left and right engines, including an inspection for damage of the outboard blade seal and applicable corrective actions. We are proposing this AD to prevent fuel leaking from an unintended drain path from the leading edge through the pylons and onto the hot engine parts or brakes, which could lead to a major ground fire.

**DATES:** We must receive comments on this proposed AD by September 14, 2015.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- Fax: 202-493-2251.

- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing

Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2966.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-2966; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Sherry Vevea, Aerospace Engineer, Propulsion Branch, ANM-140S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6514; fax: 425-917-6590; email: [sherry.vevea@faa.gov](mailto:sherry.vevea@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2015-2966; Directorate Identifier 2015-NM-051-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.