

AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* Where Airbus Service Bulletin A330-78-3021, Revision 03, dated October 15, 2014, contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures and tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operators' maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in a serviceable condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

#### (m) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2014-0062, dated March 11, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2015-0085-0002>.

(2) Airbus service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (n)(3) and (n)(5) of this AD.

(3) Rolls-Royce service information identified in this AD that is not incorporated by reference is available at Rolls-Royce plc, P.O. Box 31, Derby, DE24 8BJ, England; phone: 011-44-1332-242424; fax: 011-244-1332-249936; email: [http://www.rolls-royce.com/contact/civil\\_team.jsp](http://www.rolls-royce.com/contact/civil_team.jsp); Internet: <https://www.aeromanager.com>.

#### (n) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Service Bulletin A330-78-3021, Revision 03, dated October 15, 2014.

(ii) Aircelle Service Bulletin 78-AG924, dated September 26, 2012.

(3) For Airbus service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33

5 61 93 45 80; email [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com); Internet <http://www.airbus.com>.

(4) For Aircelle service information identified in this AD, contact Aircelle Customer support Center, BP 50042, 50, rue Pierre Curie, 78371 Plaisir Cedex, France; telephone +33 (0)1 64 14 80 33; fax +33 (0)1 64 14 84 10.

(5) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(6) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 21, 2015.

**Kevin Hull,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-21475 Filed 9-1-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2015-0680; Directorate Identifier 2014-NM-165-AD; Amendment 39-18236; AD 2015-17-03]**

**RIN 2120-AA64**

#### Airworthiness Directives; Bombardier, Inc. Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Bombardier, Inc. Model DHC-8-400, -401, and -402 airplanes. This AD was prompted by a report of a main landing gear (MLG) parking brake becoming dislodged from its mounting bracket due to an improperly installed quick release pin of the hand pump lever. This AD requires removing the hand pump lever of the parking brake from the right-hand side nacelle. We are issuing this AD to prevent an unsecured lever from migrating from its stowed position, fouling against the MLG, and subsequently puncturing the nacelle structure, which could adversely affect the safe landing of the airplane.

**DATES:** This AD becomes effective October 7, 2015.

The Director of the Federal Register approved the incorporation by reference

of a certain publication listed in this AD as of October 7, 2015.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov/#!docketDetail;D=FAA-2015-0680> or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC.

For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0680.

#### FOR FURTHER INFORMATION CONTACT:

Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7318; fax 516-794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc. Model DHC-8-400, -401, and -402 airplanes. The NPRM published in the **Federal Register** on April 1, 2015 (80 FR 17366).

The Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian Airworthiness Directive CF-2014-18, dated June 19, 2014 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc. Model DHC-8-400, -401, and -402 airplanes. The MCAI states:

There has been one (1) reported in-service incident where the main landing gear (MLG) parking brake hand pump lever was not properly secured in the right-hand (RH) side nacelle and became dislodged from its mounting bracket. During extension of the MLG, the unsecured lever shifted causing a fouling condition with the nacelle and subsequently puncturing the nacelle structure.

An investigation revealed that the safety restraint pin used to securely stow the lever is susceptible to mishandling. An unsecured parking brake hand pump lever could migrate from its stowed position and foul against the MLG, adversely affecting the safe landing of the aeroplane.

This [Canadian] AD mandates the removal of the MLG parking brake hand pump lever from the RH side nacelle.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2015-0680-0002>.

#### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (80 FR 17366, April 1, 2015) or on the determination of the cost to the public.

#### Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (80 FR 17366, April 1, 2015) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (80 FR 17366, April 1, 2015).

#### Related Service Information Under 14 CFR Part 51

Bombardier has issued the following service bulletins.

- Service Bulletin 84–32–99, Revision A, dated October 2, 2012. This service information describes procedures for incorporating ModSum 4–113723 by relocating the hand pump lever of the parking brake from the right-hand side nacelle to the right-hand side equipment bay.
- Service Bulletin 84–32–118, dated April 8, 2014. This service information describes procedures for incorporating Bombardier ModSum 4–113803 by removing the hand pump lever of the parking brake from the right-hand side nacelle.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of this AD.

#### Costs of Compliance

We estimate that this AD affects 82 airplanes of U.S. registry.

We also estimate that it will take about 3 work-hours per product to

comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts will cost \$0 per product. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$20,910, or \$255 per product.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov/#!docketDetail;D=FAA-2015-0680>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other

information. The street address for the Docket Operations office (telephone 800–647–5527) is in the ADDRESSES section.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2015–17–03 Bombardier, Inc.:** Amendment 39–18236. Docket No. FAA–2015–0680; Directorate Identifier 2014–NM–165–AD.

#### (a) Effective Date

This AD becomes effective October 7, 2015.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Bombardier, Inc. Model DHC–8–400, –401, and –402 airplanes, certificated in any category, serial numbers (S/N) 4001 through 4419 inclusive.

#### (d) Subject

Air Transport Association (ATA) of America Code 32, Landing Gear.

#### (e) Reason

This AD was prompted by a report of a main landing gear (MLG) parking brake becoming dislodged from its mounting bracket due to an improperly installed quick release pin of the hand pump lever. We are issuing this AD to prevent an unsecured lever from migrating from its stowed position, fouling against the MLG, and subsequently puncturing the nacelle structure, which could adversely affect the safe landing of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Incorporation of Modification Summary (ModSum) 4–113803

Within 3,000 flight hours or 18 months after the effective date of this AD, whichever occurs first: Incorporate Bombardier ModSum 4–113803 by removing the hand pump lever of the parking brake from the right-hand side nacelle, in accordance with the Accomplishment Instructions of

Bombardier Service Bulletin 84-32-118, dated April 8, 2014.

**Note 1 to paragraph (g) of this AD:** Reinstalling the hand pump lever of the parking brake to the right-hand side equipment bay (Bombardier ModSum 4-113804) may be done at the operator's discretion.

#### (h) Optional Installation

Incorporation of ModSum 4-113723 by relocating the hand pump lever of the parking brake from the right-hand side nacelle to the right-hand side equipment bay, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 84-32-99, Revision A, dated October 2, 2012, is acceptable for compliance with the modification specified in paragraph (g) of this AD, provided the incorporation of ModSum 4-113723 is done within the compliance time specified in paragraph (g) of this AD.

#### (i) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (h) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 84-32-99, dated January 26, 2012, which is not incorporated by reference in this AD.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### (k) Related Information

Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Airworthiness Directive CF-2014-18, dated June 19, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov/#!documentDetail;D=FAA-2015-0680-0002>.

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 84-32-99, Revision A, dated October 2, 2012.

(ii) Bombardier Service Bulletin 84-32-118, dated April 8, 2014.

(3) For service information identified in this AD, contact Bombardier, Inc., Q-Series Technical Help Desk, 123 Garratt Boulevard, Toronto, Ontario M3K 1Y5, Canada; telephone 416-375-4000; fax 416-375-4539; email [thd.qseries@aero.bombardier.com](mailto:thd.qseries@aero.bombardier.com); Internet <http://www.bombardier.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 10, 2015.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2015-20583 Filed 9-1-15; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2014-0777; Directorate Identifier 2014-NM-088-AD; Amendment 39-18257; AD 2015-17-24]**

**RIN 2120-AA64**

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain The Boeing Company Model 787-8 airplanes. This AD was prompted by numerous reports of failures of the proximity sensor within the slat skew detection mechanism assembly (DMA) leading to slats up landing events. This AD requires replacing the slat skew DMAs with new slat skew DMAs, and marking the existing identification plates on the slat with the new part

number. We are issuing this AD to prevent failure of the proximity sensor, which could result in the slats being shut down and a slats up high speed landing. This condition, in combination with abnormal landing conditions such as a short runway or adverse weather conditions, could result in a runway excursion.

**DATES:** This AD is effective October 7, 2015.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of October 7, 2015.

**ADDRESSES:** For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P.O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0777.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2014-0777; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

#### FOR FURTHER INFORMATION CONTACT:

Douglas Tsuji, Senior Aerospace Engineer, Systems and Equipment Branch, ANM-130S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone: 425-917-6546; fax: 425-917-6590; email: [douglas.tsuji@faa.gov](mailto:douglas.tsuji@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company