

A description of the items; (2) whether and why such items are customarily treated as confidential within the industry; (3) whether the information is generally known by or available from other sources; (4) whether the information has previously been made available to others without obligation concerning its confidentiality; (5) an explanation of the competitive injury to the submitting person that would result from public disclosure; (6) when such information might lose its confidential character due to the passage of time; and (7) why disclosure of the information would be contrary to the public interest.

It is DOE's policy that all comments may be included in the public docket, without change and as received, including any personal information provided in the comments (except information deemed to be exempt from public disclosure).

#### C. Issues on Which DOE Seeks Comment

Although DOE welcomes comments on any aspect of this proposal, DOE is particularly interested in receiving comments and views of interested parties concerning the following issues:

1. DOE seeks comment on its assumptions that only minor changes to the DHE market have occurred since the last DOE rulemaking and that overall shipments of DHE have continued to decrease. See section II.

2. DOE seeks comment on its determination that adopting a condensing efficiency level for fan-type wall furnaces would not be economically justified. See section II.

3. DOE seeks data and information pertaining to DHE shipments. See section II.

4. DOE seeks comment on its proposal not to amend energy conservation standards for DHE because more stringent standards would not be economically justified. See section III.

5. DOE seeks comment on its proposal not to amend its standards for DHE to include standby and off mode electrical consumption. See section III.

#### VI. Approval of the Office of the Secretary

The Secretary of Energy has approved publication of this notice of proposed rulemaking.

#### List of Subjects in 10 CFR Part 430

Administrative practice and procedure, Confidential business information, Energy conservation, Household appliances, Imports, Incorporation by reference, Intergovernmental relations, Small businesses.

Issued in Washington, DC, on March 25, 2016.

**David Friedman,**

*Principal Deputy Assistant Secretary, Energy Efficiency and Renewable Energy.*

[FR Doc. 2016-08121 Filed 4-8-16; 8:45 am]

**BILLING CODE 6450-01-P**

Operations Office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the European Aviation Safety Agency (EASA) AD, the economic evaluation, and other information. The street address for the Docket Operations Office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

For service information identified in this proposed rule, contact Airbus Helicopters, 2701 N. Forum Drive, Grand Prairie, TX 75052; telephone (972) 641-0000 or (800) 232-0323; fax (972) 641-3775; or at <http://www.airbushelicopters.com/techpub>. You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177.

#### FOR FURTHER INFORMATION CONTACT:

Robert Grant, Aviation Safety Engineer, Safety Management Group, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222-5110; email [robert.grant@faa.gov](mailto:robert.grant@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to participate in this rulemaking by submitting written comments, data, or views. We also invite comments relating to the economic, environmental, energy, or federalism impacts that might result from adopting the proposals in this document. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. To ensure the docket does not contain duplicate comments, commenters should send only one copy of written comments, or if comments are filed electronically, commenters should submit only one time.

We will file in the docket all comments that we receive, as well as a report summarizing each substantive public contact with FAA personnel concerning this proposed rulemaking. Before acting on this proposal, we will consider all comments we receive on or before the closing date for comments. We will consider comments filed after the comment period has closed if it is possible to do so without incurring expense or delay. We may change this proposal in light of the comments we receive.

#### Discussion

EASA, which is the Technical Agent for the Member States of the European

#### DEPARTMENT OF TRANSPORTATION

##### Federal Aviation Administration

###### 14 CFR Part 39

**[Docket No. FAA-2015-3929; Directorate Identifier 2015-SW-031-AD]**

**RIN 2120-AA64**

##### Airworthiness Directives; Airbus Helicopters

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for Airbus Helicopters Model EC130B4, EC130T2, AS350B, AS350B1, AS350B2, AS350B3, AS350BA, AS350C, AS350D, AS350D1, AS355E, AS355F, AS355F1, AS355F2, AS355N, and AS355NP helicopters. This proposed AD would require inspecting each bi-directional suspension cross-bar (cross-bar) for a crack. This proposed AD is prompted by two reports of cracks in a cross-bar. The proposed actions are intended to detect cracks in a cross-bar and prevent failure of the cross-bar and subsequent loss of control of the helicopter.

**DATES:** We must receive comments on this proposed AD by June 10, 2016.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Docket:* Go to <http://www.regulations.gov>. Follow the online instructions for sending your comments electronically.

- *Fax:* 202-493-2251.

- *Mail:* Send comments to the U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590-0001.

- *Hand Delivery:* Deliver to the "Mail" address between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

##### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-3929 or in person at the Docket

Union, has issued EASA AD No. 2015-0094, dated May 29, 2015, to correct an unsafe condition for Airbus Helicopters Model AS350B, AS350BA, AS350BB, AS350B1, AS350B2, AS350B3, AS350D, AS355E, AS355F, AS355F1, AS355F2, AS355N, AS355NP, EC130B4, and EC130T2 helicopters. EASA advises that two cases of cracks in a cross-bar were reported on AS350B3 helicopters. The cracks were found at the transmission deck attachment fitting holes during a maintenance check, EASA states.

According to EASA, in both cases, the helicopters were equipped with a cargo hook and had completed missions with a significant number of torque cycles. Because of common design features, cracks may also occur on other Model AS350-series, AS355-series, and EC130-series helicopters. EASA advises that crack growth may lead to failure of one of the four yokes and significantly increased stress load on the remaining yokes. This condition, if not detected or corrected, could lead to cracks on the remaining yokes and increased load on the cross-bar, possibly resulting in cross-bar failure and consequently loss of the helicopter. To correct this condition, EASA AD No. 2015-0094 requires repetitive cross-bar inspections and, depending on the findings, replacing the cross-bar.

#### FAA's Determination

These helicopters have been approved by the aviation authority of France and are approved for operation in the United States. Pursuant to our bilateral agreement with France, EASA, its technical representative, has notified us of the unsafe condition described in its AD. We are proposing this AD because we evaluated all known relevant information and determined that an unsafe condition is likely to exist or develop on other products of the same type design.

#### Related Service Information

Airbus Helicopters has issued Alert Service Bulletin (ASB) No. EC130-05A021 for Model EC130B4 helicopters; ASB No. EC130-05A022 for Model EC130T2 helicopters; ASB No. AS350-05.00.84 for Model AS350B, AS350B1, AS350B2, AS350B3, AS350BA, AS350BB, AS350D, and military Model AS350L1 helicopters; and ASB No. 355-05.00.73 for Model AS355E, AS355F, AS355F1, AS355F2, AS355N, and AS355NP helicopters (ASBs). All of the ASBs are Revision 0 and dated May 21, 2015. The ASBs specify visually inspecting the cross-bar. If there is any doubt after the visual inspection, the ASBs call for a dye-penetrant inspection to make sure there are no cracks. If a

crack is detected, the ASBs call for replacing the cross-bar before further flight and sending the damaged cross-bar to Airbus Helicopters.

#### Proposed AD Requirements

This proposed AD would require, within certain initial inspection times or the next time any maintenance of the helicopter involves removing the main gearbox, whichever comes first, inspecting each cross-bar for a crack. If there is a crack, this proposed AD would require replacing the cross-bar before further flight. This proposed AD would also require repeating these inspections at the same intervals as the initial inspection. The compliance times in this proposed AD include torque cycles, which are defined for purposes of this AD, as one landing with or without stopping the rotor or one external load-carrying operation. An external load-carrying operation occurs each time a helicopter picks up an external load and drops it off.

#### Differences Between This Proposed AD and the EASA AD

The EASA AD applies to Airbus Helicopters Model AS350BB helicopters. This proposed AD would not apply to the Model AS350BB because it has no FAA type certificate. However, this proposed AD would apply to Model AS350C and AS350D1 helicopters, while the EASA AD does not. The EASA AD requires a fluorescent dye-penetrant inspection if the visual inspection of the bi-directional suspension cross-bar causes doubts. This proposed AD would not require a fluorescent dye-penetrant inspection. The EASA AD requires returning the damaged bi-directional suspension cross-bar to Airbus Helicopters, and this proposed AD would not.

#### Costs of Compliance

We estimate that this proposed AD would affect 1,132 helicopters of U.S. Registry and that labor costs average \$85 a work-hour. Based on these estimates, we expect the following costs:

- Visually inspecting the cross-bar would require 16.5 work-hours for a labor cost of about \$1,403. No parts would be needed so that the cost for the U.S. fleet would total \$1,588,196 per inspection cycle.
- Replacing the cross-bar would cost \$1,630 for parts. No additional labor costs would be needed.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of

the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed, I certify this proposed regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared an economic evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus Helicopters:** Docket No. FAA-2015-3929; Directorate Identifier 2015-SW-031-AD.

**(a) Applicability**

This AD applies to Airbus Helicopters Model EC130B4, EC130T2, AS350B, AS350B1, AS350B2, AS350B3, AS350BA, AS350C, AS350D, AS350D1, AS355E, AS355F, AS355F1, AS355F2, AS355N, and AS355NP helicopters with a bi-directional suspension cross-bar (cross-bar) part number (P/N) 350A38-1040-20 or P/N 350A38-

1040-00 installed, certificated in any category.

**(b) Unsafe Condition**

This AD defines the unsafe condition as a crack in a bi-directional cross-bar, which could result in failure of a cross-bar and loss of control of the helicopter.

**(c) Comments Due Date**

We must receive comments by June 10, 2016

**(d) Compliance**

You are responsible for performing each action required by this AD within the specified compliance time unless it has already been accomplished prior to that time.

**(e) Required Actions**

(1) Within the initial inspection times shown in Table 1 to paragraph (e) of this AD or the next time maintenance of the helicopter involves removing the main gearbox, whichever comes first; and thereafter at intervals not to exceed the compliance times shown in Table 1 to paragraph (e) of this AD, inspect each cross-bar for a crack. For purposes of this AD, a torque cycle is defined as one landing with or without stopping the rotor or one external load-carrying operation; an external load-carrying operation occurs each time a helicopter picks up an external load and drops it off.

TABLE 1 TO PARAGRAPH (e)

Helicopter model	Initial and recurrent inspection interval
AS350B, AS350BA, AS350B1, AS350B2, AS350C, AS350D, AS350D1	4,500 hours time-in-service (TIS) or 60,000 torque cycles, whichever occurs first.
AS350B3, AS355E, AS355F, AS355F1, AS355F2, AS355N, or AS355 NP.	3,300 hours TIS or 60,000 torque cycles, whichever occurs first.
EC130B4.	
EC130T2 .....	3,300 hours TIS or 40,000 torque cycles, whichever occurs first.

(2) If there is a crack, before further flight, replace the cross-bar.

**(f) Special Flight Permit**

Special flight permits are prohibited.

**(g) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Safety Management Group, FAA, may approve AMOCs for this AD. Send your proposal to: Robert Grant, Aviation Safety Engineer, Safety Management Group, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222-5110; email 9-ASW-FTW-AMOC-Requests@faa.gov.

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office before operating any aircraft complying with this AD through an AMOC.

**(h) Additional Information**

(1) Airbus Helicopters Alert Service Bulletin No. EC130-05A021, No. EC130-05A022, No. AS350-05.00.84, and No. AS355-05.00.73, all Revision 0 and all dated May 21, 2015, which are not incorporated by reference, contain additional information about the subject of this proposed rule. For service information identified in this proposed rule, contact Airbus Helicopters, 2701 N. Forum Drive, Grand Prairie, TX 75052; telephone (972) 641-0000 or (800) 232-0323; fax (972) 641-3775; or at <http://www.airbushelicopters.com/techpub>. You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177.

(2) The subject of this AD is addressed in European Aviation Safety Agency (EASA) AD No. 2015-0094, dated May 29, 2015. You may view the EASA AD on the Internet at <http://www.regulations.gov> in the AD Docket.

**(i) Subject**

Joint Aircraft Service Component (JASC) Code: 6300, Main Rotor Drive.

Issued in Fort Worth, Texas, on March 31, 2016.

**James A. Grigg,**

*Acting Manager, Rotorcraft Directorate, Aircraft Certification Service.*

[FR Doc. 2016-07986 Filed 4-8-16; 8:45 am]

**BILLING CODE 4910-13-P**

8-10 spool, part numbers (P/Ns) 1694M80G04, 1844M90G01, or 1844M90G02, installed. This proposed AD was prompted by reports of cracks found on the seal teeth of the HPC stage 8-10 spool. This proposed AD would require eddy current inspections (ECIs) or fluorescent penetrant inspections (FPIs) of the HPC stage 8-10 spool seal teeth and removing from service those parts that fail inspection. We are proposing this AD to prevent failure of the HPC stage 8-10 spool, uncontained rotor release, damage to the engine, and damage to the airplane.

**DATES:** We must receive comments on this proposed AD by June 10, 2016.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- **Fax:** 202-493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- **Hand Delivery:** Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact General Electric Company, GE-Aviation, Room 285, 1 Neumann Way, Cincinnati, OH 45215, phone: 513-552-3272; email: [aviation.fleetsupport@ge.com](mailto:aviation.fleetsupport@ge.com). You may

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2016-5307; Directorate Identifier 2016-NE-08-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; General Electric Company Turbofan Engines**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all General Electric Company (GE) GE90-76B, GE90-77B, GE90-85B, GE90-90B, and GE90-94B turbofan engines with high-pressure compressor (HPC) stage