

September 26, 2013, which was incorporated by reference in AD 2014-17-51.

(iii) Bombardier Alert Service Bulletin A605-57-004, Revision 01, dated September 26, 2013, including Appendices 1 and 2, dated September 26, 2013, which is incorporated by reference in AD 2014-03-17.

(iv) Bombardier Alert Service Bulletin A604-57-004, Revision 02, dated January 22, 2014, including Appendices 1 and 2, dated September 26, 2013, which is incorporated by reference in AD 2014-17-51.

#### (m) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531.

(i) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(ii) AMOCs previously approved for AD 2014-17-51 are acceptable for the corresponding requirements of this AD.

(2) *Contacting the Manufacturer*: As of the effective date of this AD, for any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, Engine and Propeller Directorate, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### (n) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian Emergency Airworthiness Directive CF-2014-27R1, dated August 29, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-3988.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (o)(6) and (o)(7) of this AD.

#### (o) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(3) The following service information was approved for IBR on June 6, 2016.

(i) Bombardier Alert Service Bulletin A604-57-006, Revision 04, dated November 12, 2014, including Appendices 1 and 2, dated September 26, 2013.

(ii) Bombardier Alert Service Bulletin A605-57-004, Revision 04, dated November 12, 2014, including Appendices 1 and 2, dated September 26, 2013.

(4) The following service information was approved for IBR on November 12, 2014 (79 FR 64088, October 28, 2014).

(i) Bombardier Alert Service Bulletin A604-57-006, Revision 02, dated January 22, 2014, including Appendices 1 and 2, dated September 26, 2013.

(ii) Bombardier Alert Service Bulletin A605-57-004, Revision 02, dated January 22, 2014, including Appendices 1 and 2, dated September 26, 2013.

(5) The following service information was approved for IBR on March 6, 2014 (79 FR 9389, February 19, 2014).

(i) Bombardier Alert Service Bulletin A604-57-006, Revision 01, dated September 26, 2013, including Appendices 1 and 2, dated September 26, 2013.

(ii) Bombardier Alert Service Bulletin A605-57-004, Revision 01, dated September 26, 2013, including Appendices 1 and 2, dated September 26, 2013.

(6) For service information identified in this AD, contact Bombardier, Inc., 400 Côte Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email [thd.crij@aero.bombardier.com](mailto:thd.crij@aero.bombardier.com); Internet <http://www.bombardier.com>.

(7) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(8) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on April 8, 2016.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-08959 Filed 4-29-16; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2015-1130; Directorate Identifier 2015-CE-008-AD; Amendment 39-18492; AD 2015-09-04 R1]

RIN 2120-AA64

#### Airworthiness Directives; DG Flugzeugbau GmbH Gliders

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are revising Airworthiness Directive (AD) 2015-09-04 for DG Flugzeugbau GmbH Model DG-1000T gliders equipped with a Solo Kleinmotoren Model 2350 C engine. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as engine shaft failure and consequent propeller detachment. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective June 6, 2016.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in the AD as of June 6, 2016.

The Director of the Federal Register approved the incorporation by reference of a certain other publication listed in this AD as of May 26, 2015 (80 FR 25591, May 5, 2015).

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1130; or in person at the Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact Solo Kleinmotoren GmbH, Postfach 600152, 71050 Sindelfingen, Germany; telephone: +49 7031 301-0; fax: +49 7031 301-136; email: [aircraft@solo-germany.com](mailto:aircraft@solo-germany.com); Internet: <http://aircraft.solo-online.com> and DG Flugzeugbau GmbH, Otto Lilienthal Weg 2/Am Flugplatz, 76646 Bruchsal, Germany; telephone: +49 7251 3020-0; fax: +49 7251 3020-200; email: [wassenaar@dg-flugzeugbau.de](mailto:wassenaar@dg-flugzeugbau.de); Internet: <http://www.dg-flugzeugbau.de/index.php?id=1329>. You may view this

referenced service information at the FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for Docket No. FAA-2015-1130.

**FOR FURTHER INFORMATION CONTACT:** Jim Rutherford, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4165; fax: (816) 329-4090; email: [jim.rutherford@faa.gov](mailto:jim.rutherford@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to DG Flugzeugbau GmbH Model DG-1000T gliders equipped with a Solo Kleinmotoren Model 2350 C engine. The NPRM was published in the **Federal Register** on February 4, 2016 (81 FR 5944), and proposed to revise AD 2015-09-04, Amendment 39-18150 (80 FR 25591, May 5, 2015).

Since we issued AD 2015-09-04, Amendment 39-18150 (80 FR 25591, May 5, 2015), new service information has been issued that includes procedures for replacement of the excenter axle-pulley assembly and installation of an elastomeric damper element between the propeller and upper pulley. This optional modification will allow resuming engine operation.

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued AD No.: 2015-0052R1, dated November 19, 2015 (referred to after this as “the MCAI”), to correct the above-referenced unsafe condition for the specified products. The MCAI states:

An occurrence of engine shaft failure and consequent propeller detachment was reported on a Solo 2350 C engine.

This condition, if not corrected, could lead to additional cases of release of the propeller from the engine, possibly resulting in damage to the sailplane, or injury to persons on the ground.

To address this unsafe condition, EASA issued Emergency AD 2013-0217-E to prohibit operation of the engine. That AD was later revised to introduce an optional modification, through Solo Kleinmotoren Service Bulletin (SB) 4603-14, to install a modified excenter axle-pulley assembly, allowing to resume operation of the engine.

Since EASA AD 2013-0217R1 was issued, another occurrence of engine shaft failure and propeller detachment was reported on a

Solo 2350 C engine which had been modified in accordance with Solo Kleinmotoren SB 4603-14.

Consequently, EASA issued Emergency AD 2015-0052-E, which superseded AD 2013-0217R1, to prohibit operation of all Solo 2350 C engines, including those engines which had been modified in accordance with Solo Kleinmotoren SB 4603-14. That AD also required a one-time inspection of the propeller shaft to detect cracks and the reporting of findings.

Since that AD was issued, Solo Kleinmotoren GmbH developed modification drawing nb. 2031211-V2 available for in service application through Solo SB 4603-17 and DG Flugzeugbau GmbH developed modifications drawing nb. 10 M 067, available for in service application through DG Flugzeugbau Technical Note (TN) 1000/26 which include replacement of excenter axle-pulley assembly and installation of an elastomeric damper element between the propeller and upper pulley.

This AD is revised to introduce optional modifications to allow resuming operation of an engine.

You may examine the MCAI on the Internet at <https://www.regulations.gov/#!documentDetail;D=FAA-2015-1130-0002>.

##### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM (81 FR 5944, February 4, 2016) or on the determination of the cost to the public.

##### Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting the AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (81 FR 5944, February 4, 2016) for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM (81 FR 5944, February 4, 2016).

##### Related Service Information Under 1 CFR 51

We reviewed Solo Kleinmotoren GmbH Anleitung zur Inspektion (English translation: Inspection Instruction), Nr. 4603-1, Ausgabe (English translation: Dated) March 26, 2015; Solo Kleinmotoren GmbH Technische Mitteilung (English translation: Service Bulletin) Nr. 4603-17, Ausgabe (English translation: Dated) July 15, 2015; and DG Flugzeugbau GmbH Technical note No. 1000/26, dated September 23, 2015, with 10M072 titled Propellermontage nach TM 1000-26 (English translation: Propeller

assembly TN 1000-26), dated July 14, 2015. Solo Kleinmotoren GmbH Anleitung zur Inspektion (English translation: Inspection Instruction), Nr. 4603-1, Ausgabe (English translation: Dated) March 26, 2015, describes procedures for inspecting the propeller shaft for cracking and reporting the results to the manufacturer. Solo Kleinmotoren GmbH Technische Mitteilung (English translation: Service Bulletin) Nr. 4603-17, Ausgabe (English translation: Dated) July 15, 2015, describes procedures for replacement of the excenter axle-pulley assembly. DG Flugzeugbau GmbH Technical note No. 1000/26, dated September 23, 2015, describes procedures for removing the excenter axle-pulley assembly and sending it to Solo Kleinmotoren GmbH for modification with a new rear bearing, axle, and elastomeric damper element. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

##### Costs of Compliance

We estimate that this AD will affect 2 products of U.S. registry. We also estimate that it will take about .5 work-hour per product to comply with the basic operational limitation requirement of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this portion of this AD on U.S. operators to be \$85, or \$42.50 per product.

We also estimate that it will take about 1.5 work-hours per product to comply with the basic axle inspection (remove, inspect, and reinstall) requirement of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this portion of this AD on U.S. operators to be \$255, or \$127.50 per product.

We also estimate that it will take about 2 work-hours per product to comply with the optional axle with drive belt pulley unit replacement and engine test run of this AD. The average labor rate is \$85 per work-hour. Required parts will cost about \$100 per product.

Based on these figures, we estimate the cost of this optional AD action on U.S. operators to be \$540, or \$270 per product.

We also estimate that it will take about .5 work-hour per product to comply with the removal of the operational limitation requirement after doing the optional replacement of this

AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of this AD action on U.S. operators to be \$85, or \$42.50 per product.

#### Paperwork Reduction Act

A federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB control number. The control number for the collection of information required by this AD is 2120-0056. The paperwork cost associated with this AD has been detailed in the Costs of Compliance section of this document and includes time for reviewing instructions, as well as completing and reviewing the collection of information. Therefore, all reporting associated with this AD is mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at 800 Independence Ave. SW., Washington, DC 20591. ATTN: Information Collection Clearance Officer, AES-200.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-1130; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by removing Amendment 39-18150 (80 FR 25591, May 5, 2015) and adding the following new AD:

**2015-09-04 R1 DG Flugzeugbau GmbH:**  
Amendment 39-18492; Docket No. FAA-2015-1130; Directorate Identifier 2015-CE-008-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective June 6, 2016.

#### (b) Affected ADs

This AD replaces AD 2015-09-04, Amendment 39-18150 (80 FR 25591, May 5, 2015) ("AD 2015-09-04").

#### (c) Applicability

This AD applies to DG Flugzeugbau GmbH Model DG-1000T gliders, all serial numbers, that are:

- (1) Equipped with a Solo Kleinmotoren Model 2350 C engine; and
- (2) Certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 72: Engine.

#### (e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) issued by the aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as engine shaft failure with consequent propeller detachment. We are issuing this AD to prevent failure of the engine shaft with consequent propeller detachment, which could result in damage to the glider or injury of persons on the ground.

#### (f) Actions and Compliance

Unless already done, do the following actions:

(1) As of November 25, 2013 (the effective date retained from AD 2013-22-14, Amendment 39-17646 (78 FR 65869, November 4, 2013)), do not operate the engine unless the engine is modified following instructions that are FAA-approved specifically for this AD.

(2) Modification of an engine following the instructions in Solo Kleinmotoren Service Bulletin 4603-14, dated April 28, 2014, is not an acceptable modification to comply with paragraph (f)(1) of this AD.

(3) As of May 26, 2015 (the effective date retained from AD 2015-09-04), place a copy of this AD into the Limitations section of the aircraft flight manual (AFM).

(4) Within the next 30 days after May 26, 2015 (the effective date retained from AD 2015-09-04), do a one-time inspection (magnetic particle or dye penetrant) of the propeller shaft following Solo Kleinmotoren GmbH Anleitung zur Inspektion (English translation: Inspection Instruction), Nr. 4603-1, Ausgabe (English translation: dated) March 26, 2015.

**Note 1 to paragraph (f)(4) of this AD:** This service information contains German to English translation. The EASA used the English translation in referencing the document. For enforceability purposes, we will refer to the Solo Kleinmotoren service information as it appears on the document.

(5) Within the next 30 days after May 26, 2015 (the effective date retained from AD 2015-09-04), report the results of the inspection required in paragraph (f)(4) of this AD to Solo Kleinmotoren GmbH. Include the serial number of the engine and the operational time since change of the axle in your report. You may find contact information for Solo Kleinmotoren GmbH in paragraph (i)(5) of this AD.

(6) At any time after June 6, 2016 (the effective date of this AD), you may modify the engine following Solo Kleinmotoren GmbH Technische Mitteilung (English translation: Service Bulletin) Nr. 4603-17,

Ausgabe (English translation: Dated) July 15, 2015; and DG Flugzeugbau GmbH Technical note No. 1000/26, dated September 23, 2015, with 10M072 titled Propellermontage nach TM 1000–26 (English translation: Propeller assembly TN 1000–26), dated July 14, 2015. This modification allows engine operation.

**Note 2 to paragraph (f)(6) of this AD:** This service information contains German to English translation. The EASA used the English translation in referencing the document. For enforceability purposes, we will refer to the Solo Kleinmotoren service information and the DG Flugzeugbau GmbH as it appears on the document.

(7) Before further flight after doing the modification allowed in (f)(6) of this AD, remove the AD placed into the Limitations section of the AFM as required in paragraph (f)(3) of this AD.

#### (g) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, Standards Office, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Jim Rutherford, Aerospace Engineer, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329–4165; fax: (816) 329–4090; email: [jim.rutherford@faa.gov](mailto:jim.rutherford@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Airworthy Product:* For any requirement in this AD to obtain corrective actions from a manufacturer or other source, use these actions if they are FAA-approved. Corrective actions are considered FAA-approved if they are approved by the State of Design Authority (or their delegated agent). You are required to assure the product is airworthy before it is returned to service.

(3) *Reporting Requirements:* For any reporting requirement in this AD, a federal agency may not conduct or sponsor, and a person is not required to respond to, nor shall a person be subject to a penalty for failure to comply with a collection of information subject to the requirements of the Paperwork Reduction Act unless that collection of information displays a current valid OMB Control Number. The OMB Control Number for this information collection is 2120–0056. Public reporting for this collection of information is estimated to be approximately 5 minutes per response, including the time for reviewing instructions, completing and reviewing the collection of information. All responses to this collection of information are mandatory. Comments concerning the accuracy of this burden and suggestions for reducing the burden should be directed to the FAA at: 800 Independence Ave. SW., Washington, DC 20591, Attn: Information Collection Clearance Officer, AES–200.

#### (h) Related Information

Refer to MCAI European Aviation Safety Agency (EASA) AD No.: 2015–0052R1, dated

November 19, 2015, for related information. You may examine the MCAI on the Internet at <https://www.regulations.gov/#!documentDetail;D=FAA-2015-1130-0002>.

#### (i) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(3) The following service information was approved for IBR on June 6, 2016.

(i) Solo Kleinmotoren GmbH Technische Mitteilung (English translation: Service Bulletin) Nr. 4603–17, Ausgabe (English translation: Dated) July 15, 2015.

**Note 3 to paragraphs (i)(3)(i) and (i)(3)(ii) of this AD:** This service information contains German to English translation. The EASA used the English translation in referencing the document. For enforceability purposes, we will refer to the Solo Kleinmotoren service information and the DG Flugzeugbau GmbH as it appears on the document.

(ii) DG Flugzeugbau GmbH Technical note No. 1000/26, dated September 23, 2015, with 10M072 titled Propellermontage nach TM 1000–26 (English translation: Propeller assembly TN 1000–26), dated July 14, 2015.

(4) The following service information was approved for IBR on May 26, 2015 (80 FR 25591, May 5, 2015).

(i) Solo Kleinmotoren GmbH Anleitung zur Inspektion (English translation: Inspection Instruction), Nr. 4603–1, Ausgabe (English translation: Dated) March 26, 2015.

**Note 4 to paragraph (i)(4)(i) of this AD:** This service information contains German to English translation. The EASA used the English translation in referencing the document. For enforceability purposes, we will refer to the Solo Kleinmotoren service information as it appears on the document.

(ii) Reserved.

(5) For service information identified in this AD, contact Solo Kleinmotoren GmbH, Postfach 600152, 71050 Sindelfingen, Germany; telephone: +49 7031 301–0; fax: +49 7031 301–136; email: [aircraft@solo-germany.com](mailto:aircraft@solo-germany.com); Internet: <http://aircraft.solo-online.com/com>.

(6) You may view this service information at FAA, Small Airplane Directorate, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329–4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2015–1130.

(7) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on April 11, 2016.

**Melvin Johnson,**

*Acting Manager, Small Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016–08961 Filed 4–29–16; 8:45 am]

**BILLING CODE 4910–13–P**

## RAILROAD RETIREMENT BOARD

### 20 CFR Part 356

#### RIN 3220–AB68

### Civil Monetary Penalty Inflation Adjustment

**AGENCY:** Railroad Retirement Board.

**ACTION:** Interim final rule.

**SUMMARY:** As required by Section 701 of the Bipartisan Budget Act of 2015, entitled the Federal Civil Penalties Inflation Adjustment Act Improvements Act of 2015, the Railroad Retirement Board (Board) hereby amends its regulations to provide for adjustments in the minimum and maximum amounts of civil monetary penalties under the Board's jurisdiction. The amendment will increase the amount of penalties to adjust for inflation since the Board last adjusted its penalty amounts, and will provide the formula to be used for required annual adjustments in the penalty amounts.

**DATES:** Effective August 1, 2016.

Comments must be received on or before July 1, 2016.

**ADDRESSES:** You may submit comments, identified by RIN 3220–AB68, by any of the following methods:

1. *Internet*—Send comments via email to [SecretarytotheBoard@rrb.gov](mailto:SecretarytotheBoard@rrb.gov).
2. *Fax*—(312) 751–3336.
3. *Mail*—Secretary to the Board,

Railroad Retirement Board, 844 N. Rush Street, Chicago, Illinois 60611–2092.

Do not submit the same comments multiple times or by more than one method. Regardless of which method you choose, please state that your comments refer to RIN 3220–AB68.

**Caution:** You should be careful to include in your comments only information that you wish to make publicly available as comments are posted without change, with any personal information provided. The Board strongly urges you not to include in your comments any personal information, such as Social Security numbers or medical information.

**FOR FURTHER INFORMATION CONTACT:** Marguerite P. Dadabo, Assistant General Counsel, Railroad Retirement Board, 844 North Rush Street, Chicago, IL 60611–2092, (312) 751–4945, TTD (312) 751–4701.