

Issued in Renton, Washington, on April 20, 2016.

John P. Piccola, Jr.,

*Acting Manager, Transport Airplane
Directorate, Aircraft Certification Service.*

[FR Doc. 2016-09800 Filed 4-29-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-4814; Directorate Identifier 2015-NM-105-AD; Amendment 39-18502; AD 2016-09-04]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for certain Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes. This AD was prompted by the discovery of a number of incorrectly calibrated angle of attack (AOA) transducers installed in the stall protection system. This AD requires replacement of incorrectly calibrated AOA transducers. We are issuing this AD to detect and replace incorrectly calibrated AOA transducers; incorrect calibration of the transducers could result in late activation of the stick pusher.

DATES: This AD is effective June 6, 2016. The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of June 6, 2016.

ADDRESSES: For service information identified in this final rule, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-4814.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-4814; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

www.regulations.gov by searching for and locating Docket No. FAA-2015-4814; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York Aircraft Certification Office (ACO), 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7318; fax 516-794-5531.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100&440) airplanes. The NPRM published in the **Federal Register** on November 17, 2015 (80 FR 71749) (“the NPRM”). The NPRM was prompted by the discovery of a number of incorrectly calibrated AOA transducers installed in the stall protection system. The NPRM proposed to require replacement of incorrectly calibrated AOA transducers. We are issuing this AD to detect and replace incorrectly calibrated AOA transducers; incorrect calibration of the transducers could result in late activation of the stick pusher.

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian AD CF-2015-17, effective July 16, 2015 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes. The MCAI states:

It was discovered that a number of [angle of attack] AOA transducers installed on Bombardier CL-600-2B19 aeroplanes were incorrectly calibrated due to a quality control problem at both the production and repair facilities. Incorrect calibration of the AOA transducer could result in a late activation of the stick pusher.

This [Canadian] AD mandates the replacement of the incorrectly calibrated AOA transducer.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-4814.

Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD as proposed, except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 1 CFR Part 51

We reviewed Bombardier Service Bulletin 601R-27-164, dated March 30, 2015. The service information describes procedures for replacement of incorrectly calibrated AOA transducers. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

Costs of Compliance

We estimate that this AD affects 575 airplanes of U.S. registry.

We also estimate that it would take about 4 work-hours per product to comply with the basic requirements of this AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$10,000 per product. Based on these figures, we estimate the cost of this AD on U.S. operators to be \$5,945,500, or \$10,340 per product.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations

for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2016-09-04 Bombardier, Inc.: Amendment 39-18502; Docket No. FAA-2015-4814; Directorate Identifier 2015-NM-105-AD.

(a) Effective Date

This AD is effective June 6, 2016.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc. Model CL-600-2B19 (Regional Jet Series 100 & 440) airplanes, certificated in any category, serial

numbers 7003 through 7067 inclusive, 7069 through 7990 inclusive, and 8000 through 8999 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight Controls.

(e) Reason

This AD was prompted by the discovery of a number of incorrectly calibrated angle of attack (AOA) transducers installed in the stall protection system. We are issuing this AD to detect and replace incorrectly calibrated AOA transducers; incorrect calibration of the transducers could result in late activation of the stick pusher.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Replacement

For AOA transducers identified in paragraph 1.A., "Effectivity," of Bombardier Service Bulletin 601R-27-164, dated March 30, 2015: Within 2,500 flight hours or 12 months, whichever occurs first after the effective date of this AD, replace the AOA transducers with correctly calibrated AOA transducers, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 601R-27-164, dated March 30, 2015.

(h) Parts Installation Prohibition

As of the effective date of this AD, no person may install, on any airplane, an AOA transducer having a part number or serial number listed in paragraph 1.A., "Effectivity," of Bombardier Service Bulletin 601R-27-164, dated March 30, 2015.

(i) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, New York Aircraft Certification Office (ACO), ANE-170, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO, ANE-170, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(j) Related Information

For more information about this AD, contact Cesar Gomez, Aerospace Engineer, Airframe and Mechanical Systems Branch, ANE-171, FAA, New York ACO, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7318; fax 516-794-5531.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Bombardier Service Bulletin 601R-27-164, dated March 30, 2015.

(ii) Reserved.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>.

(4) You may view this service information at FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on April 20, 2016.

John P. Piccola, Jr.,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2016-09791 Filed 4-29-16; 8:45 am]

BILLING CODE 4910-13-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-3970; Directorate Identifier 2015-SW-006-AD; Amendment 39-18497; AD 2016-08-20]

RIN 2120-AA64

Airworthiness Directives; Airbus Helicopters (Previously Eurocopter France)

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are superseding airworthiness directive (AD) 2014-12-51 for Airbus Helicopters (previously Eurocopter France) Model EC130B4 and