

comment period to provide for a 90 day total comment period. (AGA/APGA, No. 232 at p. 1; Spire, No. 234 at p. 14; APGA, No. 235 at p. 2; Lennox, No. 245 at pp. 1–2; Heating, Air-conditioning, and Refrigeration Distributors International and Air-Conditioning Contractors of America, No. 251 at p. 1; APGA, SNOPR Public Meeting Transcript, No. 243 at p. 31) Some commenters subsequently submitted requests for an even longer extension, equivalent to a total 120 day comment period. (Spire, No. 241 at pp. 1–2; AGA/APGA, No. 242 at pp. 1–2; AHRI, No. 244 at p. 1; Carrier, No. 250 at p. 1) Spire submitted an additional comment that a 90-day comment period would be acceptable, and AGA requested that DOE issue a written response to the comment period extension requests. (Spire, No. 247 at p.1; AGA, No. 249 at p.1) In general, commenters suggested that the quantity of supplemental information supporting the rulemaking analysis warranted additional time for review. The National Resource Defense Council (NRDC) suggested that DOE's extension from the 30-day comment period in the pre-publication notice to the 60-day period at publication represented a delay, and recommended that DOE not extend the comment period any further. (NRDC, SNOPR Public Meeting Transcript, No. 243 at p. 50)

In view of the requests for an additional comment period extension for the September 2016 SNOPR, DOE has determined that a reopening of the public comment period and a 45-day extension to January 6, 2017 for the September 2016 SNOPR is appropriate. The comment period is reopened until January 6, 2017. DOE further notes that any submissions of comments or other information submitted between the original comment end date and January 6, 2017 will be deemed timely filed.

Issued in Washington, DC, on November 21, 2016.

**Kathleen B. Hogan,**

*Deputy Assistant Secretary for Energy Efficiency, Energy Efficiency and Renewable Energy.*

[FR Doc. 2016–29080 Filed 12–2–16; 8:45 am]

**BILLING CODE 6450–01–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2016–9432; Directorate Identifier 2016–NM–116–AD]

RIN 2120–AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 737–800, –900, and –900ER series airplanes. This proposed AD was prompted by reports indicating in-flight valve failure of the left temperature control valve and control cabin trim air modulating valve. This proposed AD would require replacing the left temperature control valve and control cabin trim air modulating valve. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by January 19, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202–493–2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; Internet <https://www.myboeingfleet.com>.

You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–9432.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–9432; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Stanley Chen, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM–150S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057–3356; phone: 425–917–6585; fax: 425–917–6590; email: [stanley.chen@faa.gov](mailto:stanley.chen@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include “Docket No. FAA–2016–9432; Directorate Identifier 2016–NM–116–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

##### Discussion

We have received reports indicating in-flight valve failure of the left temperature control valve and control cabin trim air modulating valve. These valves can fail in their open positions causing elevated temperatures in the flight deck or the passenger cabin during cruise. Operators have reported events where they were unable to control the flight deck and passenger cabin temperatures during cruise. This condition, if not corrected, could result in temperatures in excess of 100 degrees Fahrenheit in the flight deck or the passenger cabin during cruise, which

could lead to the impairment of the flightcrew and consequent risk of loss of continued safe flight and landing. Such elevated temperatures could result in diverted flights since the flight deck door cannot be opened for an extended time during cruise. Airplanes on extended operation routes are most at risk because they can be 3 hours away from the nearest airport.

#### Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 737-21A1203, dated June 8, 2016. The service information describes procedures for replacing the left

temperature control valve and control cabin trim air modulating valve, part number 398908-4, with new part number 398908-3 or 398908-5. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

#### FAA's Determination

We are proposing this AD because we evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design.

#### Proposed AD Requirements

This proposed AD would require accomplishing the actions specified in the service information described previously. For information on the procedures and compliance times, see this service information at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9432.

#### Costs of Compliance

We estimate that this proposed AD affects 319 airplanes of U.S. registry. We estimate the following costs to comply with this proposed AD:

#### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement of valves ..	9 work-hours × \$85 per hour = \$765 per replacement.	\$4,800	\$5,565 per replacement	\$1,775,235 per replacement.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and

Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**The Boeing Company:** Docket No. FAA-2016-9432; Directorate Identifier 2016-NM-116-AD.

#### (a) Comments Due Date

We must receive comments by January 19, 2017.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to The Boeing Company Model 737-800, -900, and -900ER series airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin 737-21A1203, dated June 8, 2016.

#### (d) Subject

Air Transport Association (ATA) of America Code 21, Air conditioning.

#### (e) Unsafe Condition

This AD was prompted by reports indicating in-flight valve failure of the left temperature control valve and control cabin trim air modulating valve. We are issuing this AD to prevent temperatures in excess of 100 degrees Fahrenheit in the flight deck or the passenger cabin during cruise, which could lead to the impairment of the flightcrew and consequent risk of loss of continued safe flight and landing.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Replacement of the Left Temperature Control Valve and Control Cabin Trim Air Modulating Valve

Within 60 months after the effective date of this AD, replace the left temperature control valve and control cabin trim air modulating valve, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin 737-21A1203, dated June 8, 2016.

#### (h) Parts Installation Prohibition

As of the effective date of this AD, no person may install a temperature control valve, part number 398908-4, on either the left temperature control valve location or the control cabin trim air modulating valve location on any Model 737-800, -900, or -900ER airplane.

**(i) Exception to the Service Information**

Where paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 737-21A1203, dated June 8, 2016, specifies a compliance time "after the original issue date of this service bulletin," this AD requires compliance within the specified compliance time after the effective date of this AD.

**(j) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (k)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (j)(4)(i) and (j)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(k) Related Information**

(1) For more information about this AD, contact: Stanley Chen, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6585; fax: 425-917-6590; email: [stanley.chen@faa.gov](mailto:stanley.chen@faa.gov).

(2) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data

Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on November 17, 2016.

**Phil Forde,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2016-28631 Filed 12-2-16; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2016-9434; Directorate Identifier 2016-NM-136-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain The Boeing Company Model 737-600, -700, -700C, -800, and -900 series airplanes. This proposed AD was prompted by an evaluation by the design approval holder (DAH) indicating that the web lap splices in the aft pressure bulkhead are subject to widespread fatigue damage (WFD). This proposed AD would require repetitive inspections of the web lap splices in the aft pressure bulkhead for cracking of the fastener holes, and repair if necessary. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by January 19, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5

p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9434.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9434; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Alan Pohl, Aerospace Engineer, Airframe Branch, ANM-120S, FAA, Seattle Aircraft Certification Office (ACO), 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6450; fax: 425-917-6590; email: [alan.pohl@faa.gov](mailto:alan.pohl@faa.gov).

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9434; Directorate Identifier 2016-NM-136-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We