

<http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–6893.

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (m)(3) and (m)(4) of this AD.

**(m) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Airbus Service Bulletin A320–53–1298, Revision 01, including Appendixes 01 through 03, dated June 9, 2016.

(ii) Airbus Service Bulletin A320–53–1299, Revision 01, including Appendixes 01 through 03, dated June 9, 2016.

(3) For service information identified in this AD, contact Airbus, Airworthiness Office—EIAS, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 44 51; email [account.airworth-eas@airbus.com](mailto:account.airworth-eas@airbus.com); Internet: <http://www.airbus.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on February 16, 2017.

Thomas Groves,

Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.

[FR Doc. 2017–03972 Filed 3–2–17; 8:45 am]

BILLING CODE 4910–13–P

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2016–7423; Directorate Identifier 2016–NM–034–AD; Amendment 39–18816; AD 2017–05–06]

RIN 2120–AA64

#### Airworthiness Directives; The Boeing Company Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for all The Boeing Company Model 767–200 and –300 series airplanes. This AD was prompted by an evaluation by the

design approval holder (DAH) indicating that the frame-to-floor-beam joints and frames common to shear ties at certain locations of fuselage structure are subject to widespread fatigue damage (WFD). This AD requires inspections for cracking of certain frame inner chords and webs common to the floor beam joint and at frames common to the shear ties at certain sections, and corrective action if necessary. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective April 7, 2017.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of April 7, 2017.

**ADDRESSES:** For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425–227–1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7423.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2016–7423; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800–647–5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE., Washington, DC 20590.

#### FOR FURTHER INFORMATION CONTACT:

Wayne Lockett, Aerospace Engineer, Airframe Branch, ANM–120S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057 3356; phone: 425–917–6447; fax: 425–917–6590; email: [wayne.lockett@faa.gov](mailto:wayne.lockett@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to all The Boeing Company Model 767–200 and –300 series airplanes. The NPRM published in the **Federal Register** on July 7, 2016 (81 FR 44246). The NPRM was prompted by an evaluation by the DAH indicating that the frame-to-floor-beam joints and frames common to shear ties at certain locations of fuselage structure are subject to WFD. The NPRM proposed to require repetitive inspections for cracking of the frame inner chords and webs common to the floor beam joint and at frames common to the shear ties at certain sections on the left and right fuselage sides, and corrective action if necessary. We are issuing this AD to detect and correct cracking of the frame inner chords and webs common to the floor beam joint and at frames common to the shear ties at certain sections on the left and right fuselage sides, which could result in reduced structural integrity of the airplane.

#### Comments

We gave the public the opportunity to participate in developing this AD. The following presents the comments received on the NPRM and the FAA’s response to each comment.

#### Support for the NPRM

Boeing and United Airlines expressed support for the NPRM.

#### Effect of Winglets on Accomplishment of the Proposed Actions

Aviation Partners Boeing stated that accomplishing the Supplemental Type Certificate (STC) ST01920SE does not affect the ability to accomplish the actions specified in the NPRM.

We concur with the commenter. We have redesignated paragraph (c) of the proposed AD as (c)(1) and added paragraph (c)(2) to this AD to state that installation of STC ST01920SE does not affect the ability to accomplish the actions required by this final rule. Therefore, for airplanes on which STC ST01920SE is installed, a “change in product” alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

#### Conclusion

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this AD with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and

- Do not add any additional burden upon the public than was already proposed in the NPRM.

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this AD.

#### Related Service Information Under 1 CFR Part 51

We reviewed Boeing Alert Service Bulletin 767–53A0265, Revision 1, dated March 18, 2016. The service information describes procedures for doing a detailed inspection and a surface high frequency eddy current (HFEC) inspection for cracking of the frame inner chord and web common to the floor beam joint in sections 41 and 43 on the left and right sides, a detailed inspection and a surface HFEC

inspection for cracking of the section 43 and 46 frames common to the shear ties on the left and right sides, and repair. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### Costs of Compliance

We estimate that this AD affects 306 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

#### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspections .....	Up to 350 work-hours × \$85 per hour = \$29,750 per inspection cycle.	\$0	Up to \$29,750 per inspection cycle	Up to \$9,103,500 per inspection cycle.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

#### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

(1) Is not a "significant regulatory action" under Executive Order 12866,

(2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),

(3) Will not affect intrastate aviation in Alaska, and

(4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2017–05–06 The Boeing Company:**  
Amendment 39–18816; Docket No. FAA–2016–7423; Directorate Identifier 2016–NM–034–AD.

##### (a) Effective Date

This AD is effective April 7, 2017.

##### (b) Affected ADs

None.

#### (c) Applicability

(1) This AD applies to all The Boeing Company Model 767–200 and –300 series airplanes, certificated in any category.

(2) Installation of Supplemental Type Certificate (STC) ST01920SE ([http://rgl.faa.gov/Regulatory\\_and\\_Guidance\\_Library/rstc.nsf/0/59027f43b9a7486e86257b1d006591ee/\\$FILE/ST01920SE.pdf](http://rgl.faa.gov/Regulatory_and_Guidance_Library/rstc.nsf/0/59027f43b9a7486e86257b1d006591ee/$FILE/ST01920SE.pdf)) does not affect the ability to accomplish the actions required by this AD. Therefore, for airplanes on which STC ST01920SE is installed, a "change in product" alternative method of compliance (AMOC) approval request is not necessary to comply with the requirements of 14 CFR 39.17.

#### (d) Subject

Air Transport Association (ATA) of America Code 53; Fuselage.

#### (e) Unsafe Condition

This AD was prompted by an evaluation by the design approval holder (DAH) indicating that the frame-to-floor-beam joints and frames common to shear ties at certain locations of fuselage structure are subject to widespread fatigue damage (WFD). We are issuing this AD to detect and correct cracking of the frame inner chords and webs common to the floor beam joint and at frames common to the shear ties at certain sections on the left and right fuselage sides, which could result in reduced structural integrity of the airplane.

#### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Inspections and Corrective Actions

Except as provided by paragraph (h) of this AD, at the applicable time specified in paragraph 1.E., "Compliance," of Boeing Alert Service Bulletin 767–53A0265, Revision 1, dated March 18, 2016 ("ASB 767–53A0265, R1"): Do the actions required in paragraphs (g)(1) and (g)(2) of this AD, and

do all applicable corrective actions, in accordance with the Accomplishment Instructions of ASB 767-53A0265, R1. Do all applicable corrective actions before further flight. Repeat the inspections specified in paragraphs (g)(1) and (g)(2) of this AD thereafter at the applicable intervals specified in paragraph 1.E., "Compliance," of ASB 767-53A0265, R1.

(1) Do a detailed inspection and a surface high frequency eddy current (HFEC) inspection for cracking of the frame inner chord and web common to the floor beam joint in sections 41 and 43 on the left and right sides.

(2) Do a detailed inspection and a surface HFEC inspection for cracking of the section 43 and 46 frames common to the shear ties on the left and right sides.

#### (h) Service Information Exception

Where ASB 767-53A0265, R1 specifies a compliance time "after the original issue date of this service bulletin," this AD requires compliance within the specified compliance time after the effective date of this AD.

#### (i) Credit for Previous Actions

This paragraph provides credit for the actions specified in paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Boeing Alert Service Bulletin 767-53A0265, dated March 18, 2015.

#### (j) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to the attention of the person identified in paragraph (k)(1) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (j)(4)(i) and (j)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled "RC Exempt," then the RC

requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

#### (k) Related Information

(1) For more information about this AD, contact Wayne Lockett, Aerospace Engineer, Airframe Branch, ANM-120S, Seattle ACO, FAA, 1601 Lind Avenue SW., Renton, WA 98057 3356; phone: 425-917-6447; fax: 425-917-6590; email: [wayne.lockett@faa.gov](mailto:wayne.lockett@faa.gov).

(2) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (l)(3) and (l)(4) of this AD.

#### (l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Alert Service Bulletin 767-53A0265, Revision 1, dated March 18, 2016.

(ii) Reserved.

(3) For Boeing service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110-SK57, Seal Beach, CA 90740-5600; telephone 562-797-1717; Internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on February 17, 2017.

**Michael Kaszycki,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2017-03964 Filed 3-2-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF HOMELAND SECURITY

### Coast Guard

#### 33 CFR Part 100

[Docket Number USCG-2017-0034]

RIN 1625-AA08

#### Special Local Regulation; Black Warrior River; Tuscaloosa, AL

**AGENCY:** Coast Guard, DHS.

**ACTION:** Temporary final rule.

**SUMMARY:** The Coast Guard is establishing a temporary special local regulation on the Black Warrior River extending the entire width of the river from mile marker 338.5 to mile marker 339.5 in Tuscaloosa, AL. The special local regulation is needed to protect the persons participating in the USA Triathlon Collegiate National Championships marine event. This rulemaking restricts transit into, through and within the regulated area unless specifically authorized by the Captain of the Port Mobile.

**DATES:** This rule is effective from 5 a.m. on April 21, 2017 until 6 p.m. on April 22, 2017.

**ADDRESSES:** To view documents mentioned in this preamble as being available in the docket, go to <http://www.regulations.gov>, type USCG-2017-0034 in the "SEARCH" box and click "SEARCH." Click on Open Docket Folder on the line associated with this rule.

**FOR FURTHER INFORMATION CONTACT:** If you have questions on this rule, call or email LT Fannie L. Wilks, Sector Mobile, Waterways Management Division, U.S. Coast Guard; telephone 251-441-5940, email [Fannie.L.Wilks@uscg.mil](mailto:Fannie.L.Wilks@uscg.mil).

#### SUPPLEMENTARY INFORMATION:

##### I. Table of Abbreviations

CFR Code of Federal Regulations  
DHS Department of Homeland Security  
FR Federal Register  
NPRM Notice of proposed rulemaking  
PATCOM Patrol Commander  
§ Section  
U.S.C. United States Code

##### II. Background Information and Regulatory History

The Coast Guard is issuing this temporary rule without prior notice and opportunity to comment pursuant to authority under section 4(a) of the Administrative Procedure Act (APA) (5 U.S.C. 553(b)). This provision authorizes an agency to issue a rule without prior notice and opportunity to