

**(d) Comments Due Date**

We must receive comments by June 2, 2017.

**(e) Compliance**

You are responsible for performing each action required by this AD within the specified compliance time unless it has already been accomplished prior to that time.

**(f) Required Actions**

(1) Within 100 hours time-in-service (TIS), and thereafter at intervals not to exceed 100 hours TIS:

(i) Inspect the fillet seal around each flexbeam bolthole to determine whether it adheres properly to the hub or bushing or is missing. Indications of an improperly adhered seal include lifting, bubbling, peeling away, drying out, or cracking. If the fillet seal is not properly adhered or is missing, before further flight, replace the fillet seal with sealant C232 or equivalent by following the Accomplishment Instructions, paragraphs 2.D.(2) through 2.D.(5) and Figure 1, of MD Helicopters Service Bulletin SB900-125, dated February 19, 2016 (SB900-125).

(ii) Using a light and a 10X or higher power magnifying glass, inspect the area outside of the fillet seal around each flexbeam bolthole on the top of the upper hub assembly for a crack. If there is a crack, before further flight, replace the upper hub assembly.

(2) Within 12 months, and thereafter at intervals not to exceed 12 months:

(i) Remove the paint and primer from the area around each flexbeam bolthole on top of the upper hub. Remove the fillet seal from the mating surface of each bushing and the top of the upper hub.

(ii) Using a light and a 10X or higher power magnifying glass, inspect the area around each flexbeam bolthole for a crack. If there is a crack, before further flight, replace the upper hub assembly.

(iii) Inspect each lead leg shim and bushing for corrosion around the flexbeam boltholes on the bottom of the upper hub in the flexbeam pockets. If there is corrosion, before further flight:

(A) Remove the lead leg shim from the flexbeam pocket and clean the area adjacent to the flexbeam bolthole to remove any corrosion within maximum repair damage limits. If the corrosion exceeds maximum repair damage limits, replace the upper hub assembly.

(B) Using a light and a 10X or higher power magnifying glass, inspect the area around the flexbeam bolthole for a crack. If there is a crack, before further flight, replace the upper hub assembly.

(iv) Replace the fillet seal as described in paragraph (f)(1)(i) of this AD.

(3) Within 1,000 hours TIS, and thereafter at intervals not to exceed 1,000 hours TIS:

(i) Eddy current inspect the areas adjacent to each flexbeam bolthole, top and bottom, for a crack. This eddy current inspection must be performed by a Level II or higher technician with the American Society for Nondestructive Testing ASNT-TC-1A, European Committee for Standardization CEN EN 4179, Military Standard MIL-STD-410, National Aerospace Standard NAS410, or equivalent certification who has

performed an eddy current inspection within the last 12 months. If there is a crack, before further flight, replace the upper hub assembly.

(ii) Replace the fillet seal as described in paragraph (f)(1)(i) of this AD.

**(g) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Los Angeles Aircraft Certification Office, FAA, may approve AMOCs for this AD. Send your proposal to: Eric Schrieber, Aviation Safety Engineer, Los Angeles Aircraft Certification Office, Transport Airplane Directorate, FAA, 3960 Paramount Blvd., Lakewood, California 90712; telephone (562) 627-5348; email [9-ANM-LAACO-AMOC-REQUESTS@faa.gov](mailto:9-ANM-LAACO-AMOC-REQUESTS@faa.gov).

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office before operating any aircraft complying with this AD through an AMOC.

**(h) Subject**

Joint Aircraft Service Component (JASC)  
Code: 6220 Main Rotor Head.

Issued in Fort Worth, Texas, on March 27, 2017.

**Scott A. Horn,**

*Acting Manager, Rotorcraft Directorate,  
Aircraft Certification Service.*

[FR Doc. 2017-06460 Filed 3-31-17; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2017-0165; Airspace  
Docket No. 17-ACE-1]

**Proposed Amendment of Class E  
Airspace, for West Plains, MO**

**AGENCY:** Federal Aviation  
Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking  
(NPRM).

**SUMMARY:** This action proposes to modify Class E airspace extending up to 700 feet above the surface at West Plains Regional Airport, West Plains, MO, to accommodate new standard instrument approach procedures for instrument flight rules (IFR) operations at the airport. This action is necessary due to the decommissioning of the Hutton (HUW) Very High Frequency Omnidirectional Range (VOR), and cancellation of VOR approach, and would enhance the safety and management of IFR operations at the airport. The airport's name also would be updated.

**DATES:** Comments must be received on or before May 18, 2017.

**ADDRESSES:** Send comments on this proposal to the U.S. Department of Transportation, Docket Operations, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590; telephone (202) 366-9826, or 1-800-647-5527. You must identify FAA Docket No. FAA-2017-0165/Airspace Docket No. 17-ACE-1, at the beginning of your comments. You may also submit comments through the Internet at <http://www.regulations.gov>. You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office between 9:00 a.m. and 5:00 p.m., Monday through Friday, except Federal holidays.

FAA Order 7400.11A, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: 202-267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11A at NARA, call 202-741-6030, or go to [http://www.archives.gov/federal-register/code\\_of\\_federal-regulations/ibr\\_locations.html](http://www.archives.gov/federal-register/code_of_federal-regulations/ibr_locations.html).

FAA Order 7400.11A, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:** Ron Laster, Federal Aviation Administration, Contract Support, Operations Support Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX 76177; telephone (817) 222-5879.

**SUPPLEMENTARY INFORMATION:****Authority for This Rulemaking**

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the

scope of that authority as it would amend controlled airspace in Class E.

### Comments Invited

Interested parties are invited to participate in this proposed rulemaking by submitting such written data, views, or arguments, as they may desire. Comments that provide the factual basis supporting the views and suggestions presented are particularly helpful in developing reasoned regulatory decisions on the proposal. Comments are specifically invited on the overall regulatory, aeronautical, economic, environmental, and energy-related aspects of the proposal.

Communications should identify both docket numbers and be submitted in triplicate to the address listed above. Commenters wishing the FAA to acknowledge receipt of their comments on this notice must submit with those comments a self-addressed, stamped postcard on which the following statement is made: "Comments to Docket No. FAA-2017-0165/Airspace Docket No. 17-ACE-1." The postcard will be date/time stamped and returned to the commenter.

All communications received before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal contained in this notice may be changed in light of the comments received. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

### Availability of NPRMs

An electronic copy of this document may be downloaded through the Internet at <http://www.regulations.gov>. Recently published rulemaking documents can also be accessed through the FAA's Web page at [http://www.faa.gov/air\\_traffic/publications/airspace\\_amendments/](http://www.faa.gov/air_traffic/publications/airspace_amendments/).

You may review the public docket containing the proposal, any comments received, and any final disposition in person in the Dockets Office (see the **ADDRESSES** section for the address and phone number) between 9:00 a.m. and 5:00 p.m., Monday through Friday, except federal holidays. An informal docket may also be examined during normal business hours at the Federal Aviation Administration, Air Traffic Organization, Central Service Center, Operations Support Group, 10101 Hillwood Parkway, Fort Worth, TX 76177.

All communications received before the specified closing date for comments will be considered before taking action on the proposed rule. The proposal

contained in this notice may be changed in light of the comments received. A report summarizing each substantive public contact with FAA personnel concerned with this rulemaking will be filed in the docket.

### Availability and Summary of Documents Proposed for Incorporation by Reference

This document would amend FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016. FAA Order 7400.11A is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.11A lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.

### The Proposal

The FAA is proposing an amendment to Title 14 Code of Federal Regulations (14 CFR) Part 71 by modifying Class E airspace extending upward from 700 feet above the surface within a 6.9-mile radius of West Plains Municipal Airport and 8 miles west and 4 miles east of the 196° radial of the Hutton VOR/DME extending from the Hutton VOR/DME to 10 miles south of the Hutton VOR/DME would be removed due to the decommissioning of the VOR, cancellation of the VOR approach. This action would enhance the safety and management of the standard instrument approach procedures for IFR operations at the airport.

Class E airspace designations are published in paragraph 6005 of FAA Order 7400.11A, dated August 3, 2016, and effective September 15, 2016, which is incorporated by reference in 14 CFR 71.1. The Class E airspace designations listed in this document will be published subsequently in the Order.

### Regulatory Notices and Analyses

The FAA has determined that this regulation only involves an established body of technical regulations for which frequent and routine amendments are necessary to keep them operationally current, is non-controversial and unlikely to result in adverse or negative comments. It, therefore: (1) Is not a "significant regulatory action" under Executive Order 12866; (2) is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034; February 26, 1979); and (3) does not warrant preparation of a regulatory evaluation as the anticipated impact is so minimal. Since this is a routine matter that will only affect air traffic procedures and air navigation, it is certified that this rule, when promulgated, would not have a

significant economic impact on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### Environmental Review

This proposal will be subject to an environmental analysis in accordance with FAA Order 1050.1F, "Environmental Impacts: Policies and Procedures" prior to any FAA final regulatory action.

### List of Subjects in 14 CFR Part 71

Airspace, Incorporation by reference, Navigation (air).

### The Proposed Amendment

Accordingly, pursuant to the authority delegated to me, the Federal Aviation Administration proposes to amend 14 CFR part 71 as follows:

### PART 71—DESIGNATION OF CLASS A, B, C, D, AND E AIRSPACE AREAS; AIR TRAFFIC SERVICE ROUTES; AND REPORTING POINTS

■ 1. The authority citation for 14 CFR Part 71 continues to read as follows:

**Authority:** 49 U.S.C. 106(f), 106(g); 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959–1963 Comp., p. 389.

#### § 71.1 [Amended]

■ 2. The incorporation by reference in 14 CFR 71.1 of FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016, is amended as follows:

*Paragraph 6005 Class E Airspace Areas Extending Upward From 700 Feet or More Above the Surface of the Earth.*

\* \* \* \* \*

#### ACE MO E5 West Plains, MO

West Plains Municipal Airport, MO  
(Lat. 36°52'42" N., long. 91°54'10" W.)

That airspace extending upward from 700 feet above the surface within a 6.5-mile radius of West Plains Municipal Airport.

Issued in Fort Worth, Texas on March 22, 2017.

#### Walter Tweedy,

*Acting Manager, Operations Support Group, ATO Central Service Center.*

[FR Doc. 2017-06508 Filed 3-31-17; 8:45 am]

**BILLING CODE 4910-13-P**