

# Rules and Regulations

Federal Register

Vol. 82, No. 134

Friday, July 14, 2017

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

## OFFICE OF SPECIAL COUNSEL

### 5 CFR Part 1800

[OMB Control No. 3255-0005]

#### Filing of Complaints of Prohibited Personnel Practices or Other Prohibited Activities and Filing Disclosures of Information

**AGENCY:** U.S. Office of Special Counsel.

**ACTION:** Final rule; delay of effective date.

**SUMMARY:** This document delays the effective date of the final rule and information collection activity published in the June 9, 2017 issue of the **Federal Register**. The U.S. Office of Special Counsel (OSC) will issue a new effective date in due course.

**DATES:** As of July 14, 2017, the effective date of the final rule published at 82 FR 26739 on June 9, 2017, is delayed indefinitely.

**FOR FURTHER INFORMATION CONTACT:** Susan K. Ullman, General Counsel, U.S. Office of Special Counsel, by telephone at 202-254-3600, by facsimile at (202) 254-3711, or by email at [sullman@osc.gov](mailto:sullman@osc.gov).

**SUPPLEMENTARY INFORMATION:** On June 9, 2017 (82 FR 26739), OSC published a final rule revising its regulations regarding the filing of complaints and disclosures with OSC and updating OSC's prohibited personnel practice provisions. This document indefinitely delays the effective date of that final rule.

Dated: July 11, 2017.

**Bruce Gipe,**

*Chief Operating Officer.*

[FR Doc. 2017-14814 Filed 7-13-17; 8:45 am]

**BILLING CODE 7405-01-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2016-9592; Directorate Identifier 2016-NE-30-AD; Amendment 39-18952; AD 2017-14-08]

RIN 2120-AA64

#### Airworthiness Directives; CFM International S.A. Turbofan Engines

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain CFM International S.A. (CFM) CFM56-3, -3B, and -3C turbofan engines. This AD was prompted by a report of dual-engine loss of thrust control (LOTC) that resulted in an air turn back. This AD requires initial and repetitive checks of the variable stator vane (VSV) actuation system in the high-pressure compressor (HPC). We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective August 18, 2017.

**ADDRESSES:** For service information identified in this final rule, contact CFM International Inc., Aviation Operations Center, 1 Neumann Way, M/D Room 285, Cincinnati, OH 45125; phone: 877-432-3272; fax: 877-432-3329; email: [aviation.fleetsupport@ge.com](mailto:aviation.fleetsupport@ge.com). You may view this service information at the FAA, Engine & Propeller Directorate, 1200 District Avenue, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9592.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9592; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is

Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** David Bethka, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 1200 District Avenue, Burlington, MA 01803; phone: 781-238-7129; fax: 781-238-7199; email: [david.bethka@faa.gov](mailto:david.bethka@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain CFM CFM56-3, -3B, and -3C turbofan engines. The NPRM published in the **Federal Register** on March 9, 2017 (82 FR 13077). The NPRM was prompted by a report of dual-engine LOTC that resulted in an air turn back. The NPRM proposed to require initial and repetitive checks of the VSV actuation system in the HPC. We are issuing this AD to maintain the actuators ability to fully reach commanded position, and prevent LOTC and reduced control of the airplane.

##### Comments

We gave the public the opportunity to participate in developing this final rule. The following presents the comments received on the NPRM and the FAA's response to each comment.

#### Request To Change Applicability

CFM, Boeing, Anonymous, and Jet2.com requested that the Applicability paragraph be limited to engines operating in the tropical regions specified in CFM Service Bulletin (SB) CFM56-3 S/B 72-1169, rather than fleet-wide. A change of applicability to specific regions would avoid unnecessary burden for operators that do not fly in tropical zones and do not fly less than 150 hours per month.

We disagree. Operators may experience high moisture environments outside of the specified tropical zone that is described in CFM SB CFM56-3 S/B 72-1169. Operators that are outside of the specified tropical zone have experienced restricted VSV movement events. We did not change this AD.

**Request To Change Service Information**

Milan Pavlovic requested that we include the CFM CFM56-3 Engine Shop Manual (ESM) 72-32-00 procedure for VSV pull force checks, as an acceptable method of compliance, in paragraph (f)(2) of this AD. The change is requested to allow the pull force check at the modular level, using the ESM procedure.

We partially agree. We agree that performing the pull force check of the VSV system per the ESM is acceptable. We disagree with including a statement in paragraph (f)(2) because paragraph (f)(2) does not refer to any service information.

**Request To Change Compliance**

Milan Pavlovic requested that we allow the replacement of an affected stator case with an HPC stator case (that passes the pull force check) in lieu of a repaired case. The proposed Compliance paragraph (f)(2)(i) states: "If any stage requires more than 100 lbs. force to move the actuation ring, ream the VSV bores and apply anti-corrosion coating to stage 1, 2 and 3, prior to further flight." This statement is interpreted as incorporation of CFM CFM56-3 ESM 72-32-01, Repair 031 is the mandated action and therefore the only acceptable action to satisfy the AD compliance requirements. Would replacement of the stator case assembly with a serviceable stator case assembly, that has not had CFM CFM56-3 ESM 72-32-01, Repair 031 performed, be considered an acceptable alternate action providing the pull force check is performed on the replacement stator case assembly and is found to be less than 75 lbs. in each stage?

The commenter feels that replacement with a stator case that passes the pull force check is an additional action that would satisfy the AD requirements. The replacement case would be subject to the repetitive checks specified in paragraph (f)(3).

We partially agree. We disagree that using any specific service information to comply this AD is mandated. We agree that the installation of a replacement HPC stator case that passes the VSV pull force check with measurements of 75 lbs. or less is acceptable. We changed paragraph (f)(2)(i) of this AD accordingly.

**Request To Change Service Information Date**

CFM requested that we cite the latest revision date of CFM SB CFM56-3 S/B 72-1169, Revision 01, in the Service Information section.

We agree. The NPRM included an earlier revision date. This AD now

references CFM SB CFM56-3 S/B 72-1169, Revision 01, dated November 4, 2016.

**Request To Change Service Information Date**

CFM requested that we refer to the latest revision of CFM CFM56-3 ESM 72-32-01, Repair 031, in the Service Information section. The latest CFM CFM56-3 ESM 72-32-01, Repair 031, revision is dated December 15, 2016.

We agree. The NPRM referenced an out of date ESM repair. This AD now references CFM CFM56-3 ESM 72-32-01, Repair 031, dated December 15, 2016.

**Request To Change Applicability**

CFM and Milan Pavlovic noted that early configurations of the CFM56-3 engines were released with titanium HPC stator cases, which are not susceptible to corrosion in VSV bores. An additional commenter asks if the AD should affect steel stator cases only. CFM recommends applicability be noted as CFM56-3 engines with steel HPC cases with P/Ns 1499M30G01, 1499M30G02, 1499M30G03, or 1676M88G01. CFM's experience indicates that the titanium HPC cases do not experience VSV bore corrosion, and therefore do not experience restricted VSV movement due to bore corrosion.

We agree. Titanium HPC cases do not experience restricted VSV movement due to VSV bore corrosion. We changed this AD to specify that it is applicable to CFM56-3, -3B, and -3C turbofan engines with steel HPC stator cases, P/Ns 1499M30G01, 1499M30G02, 1499M30G03, or 1676M88G01, installed.

**Request To Change the Unsafe Condition Paragraph**

CFM proposes that we change the language in the Discussion section to state that the VSV resistance due to the corrosion may lead to an inability of the actuator to fully reach commanded position. The description should more accurately describe the problem. VSV actuators do not fail due to corrosion, but do exhibit limited range of movement.

We agree. The statement of "failure of VSV actuators" is an incomplete description of the problem. We revised the Discussion section and paragraph (e) of this AD to clarify.

**Request To Change Related Service Information**

CFM requested that we change the Related Service Information section, which highlights that CFM SB CFM56-3 S/B 72-1169, Revision 01, dated

November 4, 2016, describes a procedure to examine the VSV bore on the inside of the HPC case. While this is correct, CFM proposes that this section highlight that CFM SB CFM56-3 S/B 72-1169 describes a procedure to check the resistance of the VSV system as this portion of the SB is most relevant.

We agree. This AD requires a pull force check of VSV actuators. We changed the Related Service Information section to state that CFM SB CFM56-3 S/B 72-1169, Revision 01, dated November 4, 2016 describes a procedure to check the resistance of the VSV system.

**Request To Allow Special Flight Permits**

Boeing recommends allowing a ferry flight instead of requiring repair prior to further flight, if a pull force check exceeds 100 lb on one engine. They stated that a ferry flight should be allowed if take-off rated thrust can be achieved during a ground run, and the sister engine is within SB VSV pull force limits.

We partially agree. We agree with allowing special flight permits because a dual engine LOTC due to VSV restricted movement is unlikely to occur if the sister engine is within the pull force limit. We disagree with changing this AD, because as written, this AD does not limit or prohibit special flight permits. Special flight permits are allowed under 14 CFR 39.23. We did not change this AD.

**Request To Change Applicability**

A commenter asked why the Bahrain region is not listed as an affected zone for applicability of CFM SB CFM56-3 S/B 72-1169, Revision 01, dated November 4, 2016. The commenter stated that regions other than tropical climate zones listed in the SB may also expose an engine to humid environments.

We agree. We recognize that operation in more than one climate zone may contribute to VSV bore corrosion. However, this AD is applicable to all CFM56-3, -3B, and -3C turbofan engines with a steel HPC stator case, part numbers (P/Ns) 1499M30G01, 1499M30G02, 1499M30G03, or 1676M88G01, installed, regardless of their operating environment. We did not change this AD.

**Support for the NPRM**

The Air Line Pilots Association expressed support for the NPRM as written.

**Conclusion**

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this final rule with the changes described previously. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and

- Do not add any additional burden upon the public than was already proposed in the NPRM.

We also determined that these changes will not increase the economic burden on any operator or increase the scope of this final rule.

**Related Service Information**

We reviewed CFM SB CFM56-3 S/B 72-1169, Revision 01, dated November 4, 2016. This SB describes a procedure to check the resistance of the VSV

system. We also reviewed CFM CFM56-3 ESM 72-32-01, Repair 031, dated December 15, 2016. This ESM repair describes procedures for reaming and applying anti-corrosion paint to the VSV bores.

**Costs of Compliance**

We estimate that this AD affects 460 engines installed on airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

**ESTIMATED COSTS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Inspection of the HPC VSV actuation system ....	2 work-hours × \$85 per hour = \$170 .....	\$0	\$170	\$78,200

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction, and
- (4) Will not have a significant economic impact, positive or negative,

on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2017-14-08 CFM International S.A.:**  
Amendment 39-18952; Docket No. FAA-2016-9592; Directorate Identifier 2016-NE-30-AD.

**(a) Effective Date**

This AD is effective August 18, 2017.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to CFM International S.A. (CFM) CFM56-3, -3B, and -3C turbofan engines with steel high-pressure compressor (HPC) stator case, part numbers (P/ Ns)1499M30G01, 1499M30G02, 1499M30G03, or 1676M88G01, installed.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 7230, Turbine Engine Compressor Section.

**(e) Unsafe Condition**

This AD was prompted by a report of dual engine loss of thrust control (LOTC) that resulted in an air turn back. We are issuing this AD to maintain the actuators ability to fully reach commanded position, and prevent LOTC and reduced control of the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done. Within 12 months after the effective date of this AD:

- (1) Inspect the affected engines to determine if the compressor front stator case is marked with “RP031” adjacent to the part number. If the case is marked with “RP031,” no further action is required. If the case is not marked with “RP031,” follow the remaining steps in paragraph (f) of this AD.

- (2) Perform an initial pull force check of stage 1, stage 2, and stage 3 of the compressor variable stator vane (VSV) actuation system.

(i) If any stage requires more than 100 lb force to move the actuation ring, ream the VSV bores and apply anti-corrosion coating to stages 1, 2, and 3, prior to further flight, or replace with an HPC stator case that is eligible for installation and passes the VSV pull force check with measurements of 75 lb or less.

(ii) If any stage requires more than 75 lb, but less than or equal to 100 lb force to move the actuation ring, repeat the inspection within 3 months since last inspection.

(iii) If all stages require 75 lb force or less to move the actuation rings, repeat the inspection within 12 months since last inspection.

- (3) Thereafter, continue to perform repetitive pull force checks of stages 1, 2, and 3 of the compressor VSV actuation system and disposition as specified in paragraphs (2)(i) through (iii) of this AD.

**(g) Optional Terminating Action**

Reaming the VSV bores and applying anti-corrosion coating, as specified in paragraph

(f)(2)(i) of this AD, is terminating action to the repetitive inspections required by paragraph (f)(3) of this AD.

#### (h) Alternative Methods of Compliance (AMOCs)

The Manager, Engine Certification Office, FAA, may approve AMOCs for this AD. Use the procedures found in 14 CFR 39.19 to make your request. You may email your request to: [ANE-AD-AMOC@faa.gov](mailto:ANE-AD-AMOC@faa.gov).

#### (i) Related Information

(1) For more information about this AD, contact David Bethka, Aerospace Engineer, Engine Certification Office, FAA, Engine & Propeller Directorate, 1200 District Avenue, Burlington, MA 01803; phone: 781-238-7129; fax: 781-238-7199; email: [david.bethka@faa.gov](mailto:david.bethka@faa.gov).

(2) CFM Service Bulletin CFM56-3 S/B 72-1169, Revision 01, dated November 4, 2016; and CFM CFM56-3 Engine Shop Manual 72-32-01, Repair 031, dated December 15, 2016, can be obtained from CFM using the contact information in paragraph (i)(3) of this proposed AD.

(3) For service information identified in this AD, contact CFM International Inc., Aviation Operations Center, 1 Neumann Way, M/D Room 285, Cincinnati, OH 45125; phone: 877-432-3272; fax: 877-432-3329; email: [aviation.fleetsupport@ge.com](mailto:aviation.fleetsupport@ge.com).

(4) You may view this service information at the FAA, Engine & Propeller Directorate, 1200 District Avenue, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

Issued in Burlington, Massachusetts, on July 6, 2017.

**Robert J. Ganley,**

*Acting Manager, Engine & Propeller Directorate, Aircraft Certification Service.*

[FR Doc. 2017-14545 Filed 7-13-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 71

[Docket No. FAA-2016-9544; Airspace Docket No. 16-ASW-22]

### Amendment of Class D and E Airspace for the Following Texas Towns; Sherman, TX; and Temple, TX, and Establishment of Class E Airspace, Temple, TX

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** This action: Amends Class D airspace at North Texas Regional Airport/Perrin Field, Sherman, TX; amends Class E airspace designated as a surface area at Draughon-Miller Central Texas Regional Airport, Temple, TX; amends Class E airspace extending upward from 700 feet above the surface

at North Texas Regional Airport/Perrin Field, and Draughon-Miller Central Texas Regional Airport; and establishes Class E airspace designated as an extension at Draughon-Miller Central Texas Regional Airport. Cancellation of standard instrument approach procedures at these airports has made this action necessary for the safety and management of Instrument Flight Rules (IFR) operations at these airports. Additionally, geographic coordinates, names of airports, and a navigation aid are being adjusted to coincide with the FAA's aeronautical database.

**DATES:** Effective 0901 UTC, October 12, 2017. The Director of the Federal Register approves this incorporation by reference action under Title 1, Code of Federal Regulations, part 51, subject to the annual revision of FAA Order 7400.11 and publication of conforming amendments.

**ADDRESSES:** FAA Order 7400.11A, Airspace Designations and Reporting Points, and subsequent amendments can be viewed online at [http://www.faa.gov/air\\_traffic/publications/](http://www.faa.gov/air_traffic/publications/). For further information, you can contact the Airspace Policy Group, Federal Aviation Administration, 800 Independence Avenue SW., Washington, DC 20591; telephone: (202) 267-8783. The Order is also available for inspection at the National Archives and Records Administration (NARA). For information on the availability of FAA Order 7400.11A at NARA, call (202) 741-6030, or go to [http://www.archives.gov/federal\\_register/code\\_of\\_federal-regulations/ibr\\_locations.html](http://www.archives.gov/federal_register/code_of_federal-regulations/ibr_locations.html).

FAA Order 7400.11, Airspace Designations and Reporting Points, is published yearly and effective on September 15.

**FOR FURTHER INFORMATION CONTACT:** Jeffrey Claypool, Federal Aviation Administration, Operations Support Group, Central Service Center, 10101 Hillwood Parkway, Fort Worth, TX 76177; telephone (817) 222-5711.

#### SUPPLEMENTARY INFORMATION:

##### Authority for This Rulemaking

The FAA's authority to issue rules regarding aviation safety is found in Title 49 of the United States Code. Subtitle I, Section 106 describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the agency's authority. This rulemaking is promulgated under the authority described in Subtitle VII, Part A, Subpart I, Section 40103. Under that section, the FAA is charged with prescribing regulations to assign the use

of airspace necessary to ensure the safety of aircraft and the efficient use of airspace. This regulation is within the scope of that authority as it amends Class D airspace at North Texas Regional Airport/Perrin Field, Sherman, TX; Class E airspace designated as a surface area at Draughon-Miller Central Texas Regional Airport, Temple, TX; Class E airspace extending upward from 700 feet above the surface at North Texas Regional Airport/Perrin Field and Draughon-Miller Central Texas Regional Airport; and establishes Class E airspace designated as an extension at Draughon-Miller Central Texas Regional Airport, in support IFR operations at these airports.

#### History

On April 20, 2017, the FAA published in the **Federal Register** (82 FR 18596) Docket No. FAA-2016-9544, a notice of proposed rulemaking (NPRM) to amend Class D airspace at North Texas Regional Airport/Perrin Field, Sherman, TX; amend Class E airspace designated as a surface area at Draughon-Miller Central Texas Regional Airport, Temple, TX; amend Class E airspace extending upward from 700 feet above the surface at North Texas Regional Airport/Perrin Field and Draughon-Miller Central Texas Regional Airport; and establish Class E airspace designated as an extension at Draughon-Miller Central Texas Regional Airport. Interested parties were invited to participate in this rulemaking effort by submitting written comments on the proposal to the FAA. No comments were received.

Class D and E airspace designations are published in paragraph 5000, 6002, 6004, and 6005, respectively, of FAA Order 7400.11A, dated August 3, 2016, and effective September 15, 2016, which is incorporated by reference in 14 CFR 71.1. The Class D and E airspace designations listed in this document will be published subsequently in the Order.

#### Availability and Summary of Documents for Incorporation by Reference

This document amends FAA Order 7400.11A, Airspace Designations and Reporting Points, dated August 3, 2016, and effective September 15, 2016. FAA Order 7400.11A is publicly available as listed in the **ADDRESSES** section of this document. FAA Order 7400.11A lists Class A, B, C, D, and E airspace areas, air traffic service routes, and reporting points.