

Havilland Way, Sidney, British Columbia V8L 5V5, Canada; telephone +1-250-656-7227; fax +1-250-656-0673; email [acs-technical.publications@vikingair.com](mailto:acs-technical.publications@vikingair.com); Internet <http://www.vikingair.com>.

(6) You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(7) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on August 16, 2017.

**Jeffrey E. Duven,**

*Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2017-17838 Filed 9-5-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2017-0638; Product Identifier 2017-CE-018-AD; Amendment 39-19019; AD 2017-18-10]

RIN 2120-AA64

#### Airworthiness Directives; Diamond Aircraft Industries GmbH Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Diamond Aircraft Industries GmbH Models DA 42, DA 42 M-NG, and DA 42 NG airplanes. This AD results from mandatory continuing airworthiness information (MCAI) issued by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as crack formation on the flap bell crank, which could cause the flap bell crank to fail. We are issuing this AD to require actions to address the unsafe condition on these products.

**DATES:** This AD is effective October 11, 2017.

The Director of the Federal Register approved the incorporation by reference of certain publications listed in this AD as of October 11, 2017.

**ADDRESSES:** You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for

and locating Docket No. FAA-2017-0638; or in person at Document Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

For service information identified in this AD, contact Diamond Aircraft Industries GmbH, N.A. Otto-Straße 5, A-2700 Wiener Neustadt, Austria, telephone: +43 2622 26700; fax: +43 2622 26780; email: [office@diamond-air.at](mailto:office@diamond-air.at); Internet: <http://www.diamondaircraft.com>. You may view this referenced service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. It is also available on the Internet at <http://www.regulations.gov> by searching for Docket No. FAA-2017-0638.

**FOR FURTHER INFORMATION CONTACT:** Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov).

#### SUPPLEMENTARY INFORMATION:

##### Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Diamond Aircraft Industries GmbH Models DA 42, DA 42 M-NG, and DA 42 NG airplanes. The NPRM was published in the **Federal Register** on June 23, 2017 (82 FR 28594). The NPRM proposed to correct an unsafe condition for the specified products and was based on mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country. The MCAI states:

Cracks and deformation have been found on the flap bell crank Part Number (P/N) D60-2757-11-00. Frequent high load conditions have been identified as the root cause.

This condition, if not detected and corrected, could lead to failure of the flap bell crank and consequent reduced control of the aeroplane.

To address this potential unsafe condition, Diamond Aircraft Industries (DAI) issued Mandatory Service Bulletin (MSB) 42-126/MSB 42NG-066 and the corresponding Work Instruction (WI) MSB 42-126/WI-MSB 42NG-066 (single document), hereafter referred to as "the applicable MSB" in this [EASA] AD, providing inspection and modification instructions.

For the reason described above, this [EASA] AD requires modification of the flap control system by installing two spacers to

replace a single long spacer, repetitive inspections of the flap bell crank, and, depending on findings, replacement of the flap bell crank with an improved part. Installation of an improved flap bell crank constitutes terminating action for the repetitive inspections required by this [EASA] AD.

The MCAI can be found in the AD docket on the Internet at <https://www.regulations.gov/document?D=FAA-2017-0638-0002>.

#### Comments

We gave the public the opportunity to participate in developing this AD. We received no comments on the NPRM or on the determination of the cost to the public.

#### Conclusion

We reviewed the relevant data and determined that air safety and the public interest require adopting this AD as proposed except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for correcting the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

#### Related Service Information Under 14 CFR Part 51

We reviewed Diamond Aircraft Industries GmbH Mandatory Service Bulletin MSB 42-126 MSB/42NG-066, dated March 27, 2017 (single document), and Work Instruction WI-MSB 42-126/WI-MSB 42NG-066, dated March 27, 2017 (single document). In combination, this service information describes procedures for repetitively inspecting the flap bell crank for cracks, replacing the flap bell crank if cracks are found, and modification of the flap control system. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section of this AD.

#### Costs of Compliance

We estimate that this AD will affect 190 products of U.S. registry. We also estimate that it will take about 4 work-hours per product to comply with the initial inspection requirement of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the initial inspection requirement of this AD on U.S. operators to be \$64,000, or \$340 per product.

We also estimate that it will take about 2 work-hours per product to

comply with the repetitive inspection requirement of this AD. The average labor rate is \$85 per work-hour.

Based on these figures, we estimate the cost of the repetitive inspection requirement of this AD on U.S. operators to be \$32,300, or \$170 per product.

In addition, we estimate that any necessary replacement action will take about 1 work-hour and require parts costing \$430, for a cost of \$515 per product. We have no way of determining the number of products that may need these actions.

According to the manufacturer, some of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all costs in our cost estimate.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to small airplanes and domestic business jet transport airplanes to the Director of the Policy and Innovation Division.

#### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between

the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0638; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains the NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new AD:

**2017-18-10 Diamond Aircraft Industries GmbH:** Amendment 39-19019; Docket No. FAA-2017-0638; Product Identifier 2017-CE-018-AD.

#### (a) Effective Date

This airworthiness directive (AD) becomes effective October 11, 2017.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Diamond Aircraft Industries GmbH Models DA 42, DA 42 M-NG, and DA 42 NG airplanes, serial numbers 42.004 through 42.427, 42.AC001 through 42.AC151, 42.M001 through 42.M026, 42.N001 through 42.N067, 42.N100 through 42.N129, 42.NC001 through 42.NC008, and 42.MN001 through 42.MN033, certificated in any category.

#### (d) Subject

Air Transport Association of America (ATA) Code 27: Flight Controls.

#### (e) Reason

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as crack formation on the flap bell crank. We are issuing this AD to prevent failure of the flap bell crank, which could result in reduced control.

#### (f) Actions and Compliance

Unless already done, do the following actions:

- (1) Inspect the flap bell crank, part number (P/N) D60-2757-11-00, and modify the flap control system by installing two spacers, P/N DS BU2-10-06-0065-C, where the flap actuator rod end bearing is connected to the flap bell crank, following the Instructions section in Diamond Aircraft Industries GmbH (DAI) Work Instruction WI-MSB 42-126/WI-MSB 42NG-066, dated March 27, 2017 (single document), as specified in DAI Mandatory Service Bulletin MSB 42-126/MSB 42NG-066, dated March 27, 2017 (single document), at whichever of the following compliance times occurs later:
  - (i) Before exceeding 600 hours time-in-service (TIS), and repetitively thereafter at intervals not to exceed 200 hours TIS.
  - (ii) Within the next 100 hours TIS after October 11, 2017 (the effective date of this AD) or within the next 6 months after October 11, 2017 (the effective date of this AD), whichever occurs first, and repetitively thereafter at intervals not to exceed 200 hours TIS.

(2) If any discrepancies are found during any inspection required in paragraph (f)(1) of this AD, before further flight, replace the flap bell crank with an improved part, P/N D60-2757-11-00\_01, following the Instructions section in DAI Work Instruction WI-MSB 42-126/WI-MSB 42NG-066, dated March 27, 2017 (single document), as specified in DAI Mandatory Service Bulletin MSB 42-126/MSB 42NG-066, dated March 27, 2017 (single document). Installing P/N D60-2757-11-00\_01 terminates the repetitive inspections required in paragraph (f)(1) of this AD. This installation as terminating action may be done in lieu of the inspections required in paragraph (f)(1) of this AD.

(g) **Other FAA AD Provisions**

The following provisions also apply to this AD:

- (1) *Alternative Methods of Compliance (AMOCs):* The Manager, Small Airplane

Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, Small Airplane Standards Branch, FAA 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, Small Airplane Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or if there is a delegated foreign airworthiness authority Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (h) Related Information

Refer to MCAI European Aviation Safety Agency (EASA) AD No. 2017-0074, dated April 28, 2017. You may examine the MCAI on the Internet at <https://www.regulations.gov/document?D=FAA-2017-0638-0002>.

#### (i) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Diamond Aircraft Industries GmbH Mandatory Service Bulletin MSB 42-126/MSB 42NG-066, dated March 27, 2017 (single document).

(ii) Diamond Aircraft Industries GmbH Work Instruction WI-MSB 42-126/WI-MSB 42NG-066, dated March 27, 2017 (single document).

(3) For Diamond Aircraft Industries GmbH service information identified in this AD, contact Diamond Aircraft Industries GmbH, N.A. Otto-Straße 5, A-2700 Wiener Neustadt, Austria, telephone: +43 2622 26700; fax: +43 2622 26780; email: [office@diamond-air.at](mailto:office@diamond-air.at); Internet: <http://www.diamondaircraft.com>.

(4) You may view this service information at the FAA, Policy and Innovation Division, 901 Locust, Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148. In addition, you can access this service information on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0638.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Kansas City, Missouri, on August 28, 2017.

**Melvin Johnson,**

*Deputy Director, Policy and Innovation Division, Aircraft Certification Service.*

[FR Doc. 2017-18624 Filed 9-5-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF HEALTH AND HUMAN SERVICES

### Food and Drug Administration

#### 21 CFR Part 112

[Docket No. FDA-2011-N-0921]

#### Standards for the Growing, Harvesting, Packing, and Holding of Produce for Human Consumption: What You Need To Know About the Food and Drug Administration Regulation; Small Entity Compliance Guide; Availability

**AGENCY:** Food and Drug Administration, HHS.

**ACTION:** Notification of availability.

**SUMMARY:** The Food and Drug Administration (FDA, the Agency, or we) is announcing the availability of a guidance for industry entitled “Standards for the Growing, Harvesting, Packing, and Holding of Produce for Human Consumption: What You Need to Know About the FDA Regulation: Small Entity Compliance Guide.” The small entity compliance guide (SECG) is intended to help small entities comply with the final rule entitled “Standards for the Growing, Harvesting, Packing, and Holding of Produce for Human Consumption.”

**DATES:** The announcement of the guidance is published in the **Federal Register** on September 6, 2017.

**ADDRESSES:** You may submit either electronic or written comments on Agency guidances at any time as follows:

#### Electronic Submissions

Submit electronic comments in the following way:

- **Federal eRulemaking Portal:** <https://www.regulations.gov>. Follow the instructions for submitting comments. Comments submitted electronically, including attachments, to <https://www.regulations.gov> will be posted to the docket unchanged. Because your comment will be made public, you are solely responsible for ensuring that your comment does not include any confidential information that you or a third party may not wish to be posted, such as medical information, your or anyone else’s Social Security number, or

confidential business information, such as a manufacturing process. Please note that if you include your name, contact information, or other information that identifies you in the body of your comments, that information will be posted on <https://www.regulations.gov>.

- If you want to submit a comment with confidential information that you do not wish to be made available to the public, submit the comment as a written/paper submission and in the manner detailed (see “Written/Paper Submissions” and “Instructions”).

#### Written/Paper Submissions

Submit written/paper submissions as follows:

- **Mail/Hand delivery/Courier (for written/paper submissions):** Dockets Management Staff (HFA-305), Food and Drug Administration, 5630 Fishers Lane, Rm. 1061, Rockville, MD 20852.

- For written/paper comments submitted to the Dockets Management Staff Office, FDA will post your comment, as well as any attachments, except for information submitted, marked and identified, as confidential, if submitted as detailed in “Instructions.”

**Instructions:** All submissions received must include the Docket No. FDA-2011-N-0921 for “What You Need to Know About the FDA Regulation: Standards for the Growing, Harvesting, Packing, and Holding of Produce for Human Consumption—Small Entity Compliance Guide.” Received comments will be placed in the docket and, except for those submitted as “Confidential Submissions,” publicly viewable at <https://www.regulations.gov> or at the Dockets Management Staff Office between 9 a.m. and 4 p.m., Monday through Friday.

- **Confidential Submissions—**To submit a comment with confidential information that you do not wish to be made publicly available, submit your comments only as a written/paper submission. You should submit two copies total. One copy will include the information you claim to be confidential with a heading or cover note that states “THIS DOCUMENT CONTAINS CONFIDENTIAL INFORMATION.” The Agency will review this copy, including the claimed confidential information, in its consideration of comments. The second copy, which will have the claimed confidential information redacted/blacked out, will be available for public viewing and posted on <https://www.regulations.gov>. Submit both copies to the Dockets Management Staff. If you do not wish your name and contact information to be made publicly available, you can provide this