

the effective date of this AD, whichever occurs first, inspect, and if required, install protective sleeves on the bonding jumper wires of affected galleys and lavatories, in accordance with Part F of the Accomplishment Instructions of Bombardier Service Bulletin 670BA-25-101, Revision B, dated January 12, 2017.

#### (h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7300; fax: 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

#### (i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2016-20R1, dated February 3, 2017, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0810.

(2) For more information about this AD, contact Assata Dessaline, Aerospace Engineer, Avionics and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7301; fax: 516-794-5531.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone: 1-866-538-1247 or direct-dial telephone: 1-514-855-2999; fax: 514-855-7401; email: [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); Internet: <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 31, 2017.

**Dionne Palermo**,

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2017-19304 Filed 9-12-17; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA-2017-0811; Product Identifier 2017-NM-068-AD]**

**RIN 2120-AA64**

#### **Airworthiness Directives; Bombardier, Inc., Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes; Model CL-600-2D15 (Regional Jet Series 705) airplanes; Model CL-600-2D24 (Regional Jet Series 900) airplanes; and Model CL-600-2E25 (Regional Jet Series 1000) airplanes. This proposed AD was prompted by a report of rudder yoke components that had not been properly inspected at the supplier. This proposed AD would require replacement of the left and right rudder yoke assemblies. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by October 30, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., 400 Côte Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone: 1-866-

538-1247 or direct-dial telephone: 1-514-855-2999; fax: 514-855-7401; email: [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); Internet: <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0811; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Aziz Ahmed, Airframe and Mechanical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7329; fax: 516-794-5531.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2017-0811; Product Identifier 2017-NM-068-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

##### Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued Canadian AD CF-2017-10, dated February 27, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for certain Bombardier, Inc., Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes; Model

CL-600-2D15 (Regional Jet Series 705) airplanes; Model CL-600-2D24 (Regional Jet Series 900) airplanes; and Model CL-600-2E25 (Regional Jet Series 1000) airplanes. The MCAI states:

Bombardier Aerospace has informed Transport Canada that a number of rudder yoke components were received which had not been properly inspected at the supplier. The rudder yoke supplier discovered that the crack detection inspection was omitted following the manufacturing of some components. A cracked rudder yoke may affect rudder function on the affected side and could result in difficulties in maneuvering the aeroplane.

This [Canadian] AD was issued to mandate the replacement of the left and right rudder yoke assemblies.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for

and locating Docket No. FAA-2017-0811.

**Related Service Information Under 1 CFR Part 51**

Bombardier, Inc., has issued Bombardier Service Bulletin 670BA-27-073, dated November 23, 2016. This service information describes procedures for replacement of the left and right rudder yoke assemblies. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another

country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of these same type designs.

**Costs of Compliance**

We estimate that this proposed AD affects 48 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS**

| Action                                 | Labor cost                               | Parts cost       | Cost per product | Cost on U.S. operators |
|--|--|------------------|------------------|------------------------|
| Replacement of rudder yoke assemblies. | 51 work-hours × \$85 per hour = \$4,335. | Negligible ..... | \$4,335          | \$208,080              |

According to the manufacturer, some of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all available costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance

with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Bombardier, Inc.:** Docket No. FAA-2017-0811; Product Identifier 2017-NM-068-AD.

**(a) Comments Due Date**

We must receive comments by October 30, 2017.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to the airplanes identified in paragraphs (c)(1), (c)(2), and (c)(3) of this AD, certificated in any category.

(1) Bombardier, Inc., Model CL-600-2C10 (Regional Jet Series 700, 701, & 702) airplanes, serial number 10343.

(2) Bombardier, Inc., Model CL-600-2D15 (Regional Jet Series 705) airplanes and Model CL-600-2D24 (Regional Jet Series 900) airplanes, serial numbers 15326 through 15370 inclusive.

(3) Bombardier, Inc., Model CL-600-2E25 (Regional Jet Series 1000) airplanes, serial numbers 19041 and 19042.

**(d) Subject**

Air Transport Association (ATA) of America Code 27, Flight controls.

**(e) Reason**

This AD was prompted by a report of rudder yoke components that had not been properly inspected at the supplier. We are issuing this AD to prevent a cracked rudder yoke, which may affect rudder function on the affected side and could result in difficulties in maneuvering the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Replacement of Left and Right Rudder Yoke Assemblies**

Within 6,600 flight hours after the effective date of this AD, replace the left and right rudder yoke assemblies, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 670BA-27-073, dated November 23, 2016.

**(h) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ACO, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7300; fax: 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

**(i) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF-2017-10, dated February 27, 2017, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-0811.

(2) For more information about this AD, contact Aziz Ahmed, Aerospace Engineer, Airframe and Mechanical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone: 516-228-7329; fax: 516-794-5531.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte Vertu Road West, Dorval, Québec H4S 1Y9, Canada; Widebody Customer Response Center North America toll-free telephone: 1-866-538-1247 or direct-dial telephone: 1-514-855-2999; fax: 514-855-7401; email: [ac.yul@aero.bombardier.com](mailto:ac.yul@aero.bombardier.com); Internet: <http://www.bombardier.com>. You may view this service information at the FAA, Transport Standards Branch, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on August 31, 2017.

**Dionne Palermo,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2017-19306 Filed 9-12-17; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION**

**Federal Aviation Administration**

**14 CFR Part 39**

**[Docket No. FAA-2016-9450; Product Identifier 2016-NE-25-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Honeywell International Inc. Turboprop and Turboshift Engines**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Honeywell International Inc. TPE331 turboprop and TSE331 turboshift engines. This proposed AD was prompted by recent reports of failures of the direct drive fuel control gears and bearings in the hydraulic torque sensor gear assembly, part number (P/N) 3101726-3. This proposed AD would require initial and repetitive engine oil filter sampling and analysis of the affected engines. This proposed AD would also require inspection of hydraulic torque sensor gear assemblies that do not meet oil filter inspection requirements. This proposed AD would further require improved component overhaul procedures that would remove from service, by attrition, certain P/N hydraulic torque sensor gear assemblies. We are proposing this AD to correct the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by October 30, 2017.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.
- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Honeywell International Inc., 111 S 34th Street, Phoenix, AZ 85034-2802; phone: 800-601-3099; Internet: <https://myaerospace.honeywell.com/wps/portal>. You may view this service information at the FAA, Engine and Propeller Standards Branch, Policy and Innovation Division, 1200 District Avenue, Burlington, MA. For information on the availability of this material at the FAA, call 781-238-7125.

**Examining the AD Docket**

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2016-9450; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (phone: 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Joseph Costa, Aerospace Engineer, FAA, Los Angeles ACO Branch, Compliance and Airworthiness Division, 3960 Paramount Blvd., Lakewood, CA 90712-4137; phone: 562-627-5246; fax: 562-627-5210; email: [joseph.costa@faa.gov](mailto:joseph.costa@faa.gov).

**SUPPLEMENTARY INFORMATION:**

**Comments Invited**

We invite you to send any written relevant data, views, or arguments about this NPRM. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2016-9450; Directorate Identifier 2016-NE-25-AD" at the beginning of your comments. We specifically invite