

**(c) Applicability**

This AD applies to General Electric (GE) CF6–80A, –80A1, –80A2, and –80A3 turbofan engines with low-pressure turbine (LPT) stage 3 nozzles, part numbers (P/Ns) 9290M52P05 and 9290M52P06, installed.

**(d) Subject**

Joint Aircraft System Component (JASC) Code 7250, Turbine Section.

**(e) Unsafe Condition**

This AD was prompted by high cycle fatigue (HCF) cracking of the LPT stage 3 nozzles resulting in LPT uncontainment. We are issuing this AD to prevent cracking of the LPT stage 3 nozzles. The unsafe condition, if not addressed, could result in LPT uncontainment, damage to the engine, and damage to the airplane.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 36 months or during the next engine shop visit after the effective date of this AD, whichever occurs later, replace LPT stage 3 nozzles, P/Ns 9290M52P05 and 9290M52P06, with a part eligible for installation.

**(h) Definition**

(1) For the purpose of this AD, an engine shop visit is defined as the induction of an engine into the shop for maintenance involving the separation of any major mating engine flanges. The separation of engine flanges is not considered an engine shop visit for the following purposes:

- (i) Transportation of an engine not attached to an aircraft without subsequent engine maintenance.
- (ii) Removing the turbine rear frame (TRF) for repair of TRF cracking.
- (iii) Removing the top or bottom high-pressure compressor (HPC) case for HPC airfoil maintenance.
- (iv) Removing only the accessory gearbox and/or transfer gearbox.
- (2) Reserved.

**(i) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, ECO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the ECO Branch, send it to the attention of the person identified in paragraph (j) of this AD. You may email your request to: [ANE-AD-AMOC@faa.gov](mailto:ANE-AD-AMOC@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local Flight Standards District Office/ Certificate Holding District Office.

**(j) Related Information**

For more information about this AD, contact Herman Mak, Aerospace Engineer, ECO Branch, FAA, 1200 District Avenue,

Burlington, MA 01803; phone: 781–238–7147; fax: 781–238–7199; email: [herman.mak@faa.gov](mailto:herman.mak@faa.gov).

**(k) Material Incorporated by Reference**

None.

Issued in Burlington, Massachusetts, on March 29, 2018.

**Robert Ganley,**

*Manager, Engine and Propeller Standards Branch, Aircraft Certification Service.*

[FR Doc. 2018–06738 Filed 4–5–18; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA–2018–0268; Product Identifier 2017–NM–096–AD; Amendment 39–19242; AD 2018–07–11]**

**RIN 2120–AA64**

**Airworthiness Directives; Fokker Services B.V. Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Fokker Services B.V. Model F28 Mark 0100 airplanes. This AD requires contacting the FAA to obtain instructions for addressing the unsafe condition on these products, and doing the actions specified in those instructions. This AD was prompted by interference between certain passenger service unit (PSU) panels, when in the deployed/open position, and the nearby emergency exit door cover. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD becomes effective April 23, 2018.

We must receive comments on this AD by May 21, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- **Fax:** 202–493–2251.
- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

• **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE,

Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0268; or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone: 800–647–5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax: 206–231–3226.

**SUPPLEMENTARY INFORMATION:****Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2017–0113, dated June 28, 2017 (referred to after this as the Mandatory Continuing Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Fokker Services B.V. Model F28 Mark 0100 airplanes. The MCAI states:

A report was received of an occurrence involving interference between certain Passenger Service Unit (PSU) panels, Part Number (P/N) A546011–501 and P/N A546011–503, when in the deployed/open position, and the nearby emergency exit door cover.

This condition, if not detected and corrected, could prevent a complete opening of the overwing emergency exit door, possibly obstructing the evacuation of occupants in case of an emergency landing.

To address this potential unsafe condition, Fokker Services published Service Bulletin (SB) SBF100–25–131 (hereafter referred to as “the SB” in this AD) to provide inspection instructions.

For the reasons described above, this [EASA] AD requires a one-time inspection to verify that the overwing emergency exit doors can be fully operated with the PSU-panels in the deployed/opened position and, depending on findings, accomplishment of applicable corrective action(s). This [EASA] AD also requires the reporting of findings.

You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0268.

### FAA's Determination and Requirements of This AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI. We are issuing this AD because we evaluated all pertinent information and determined the unsafe condition exists and is likely to exist or develop on other products of these same type designs.

### FAA's Determination of the Effective Date

Since there are currently no domestic operators of this product, we find good cause that notice and opportunity for prior public comment are unnecessary.

In addition, for the reasons stated above, we find that good cause exists for making this amendment effective in less than 30 days.

### Comments Invited

This AD is a final rule that involves requirements affecting flight safety, and we did not precede it by notice and opportunity for public comment. We invite you to send any written relevant data, views, or arguments about this AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0268; Product Identifier 2017-NM-096-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this AD. We will consider all comments received by the closing date and may

amend this AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this AD.

### Costs of Compliance

Currently, there are no affected U.S.-registered airplanes. This AD requires contacting the FAA to obtain instructions for addressing the unsafe condition, and doing the actions specified in those instructions. Based on the actions specified in the MCAI AD, we are providing the following cost estimates for an affected airplane that is placed on the U.S. Register in the future:

### ESTIMATED COSTS

Action	Labor cost	Parts cost	Cost per product
Inspection .....	1 work-hour × \$85 per hour = \$85 .....	\$0	\$85
Reporting .....	1 work-hour × \$85 per hour = \$85 .....	0	85

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this AD.

### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. "Subtitle VII: Aviation Programs," describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in "Subtitle VII, Part A, Subpart III, Section 44701: General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition

period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

### Regulatory Findings

We determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2018-07-11 Fokker Services B.V.:**  
Amendment 39-19242; Docket No. FAA-2018-0268; Product Identifier 2017-NM-096-AD.

#### (a) Effective Date

This AD becomes effective April 23, 2018.

#### (b) Affected ADs

None.

#### (c) Applicability

This AD applies to Fokker Services B.V. Model F28 Mark 0100 airplanes, certificated in any category, serial numbers 11359, 11361, 11367, 11397, 11404, 11446, 11456, 11460, 11468, 11483, 11490, 11499, 11502, 11515 and 11520.

#### (d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

**(e) Reason**

This AD was prompted by a report of interference between certain passenger service unit (PSU) panels, when in the deployed/open position, and the nearby emergency exit door cover. We are issuing this AD to detect and correct interference between certain PSU panels and the nearby emergency exit door cover, which could prevent a complete opening of the overwing emergency exit door, and possibly obstruct the evacuation of occupants in case of an emergency landing.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 30 days after the effective date of this AD, request instructions from the Manager, International Section, Transport Standards Branch, FAA, to address the unsafe condition specified in paragraph (e) of this AD; and accomplish the actions at the times specified in, and in accordance with, those instructions. Guidance can be found in Mandatory Continuing Airworthiness Information (MCAI) European Aviation Safety Agency (EASA) AD 2017-0113, dated June 28, 2017.

**(h) Alternative Methods of Compliance (AMOCs)**

The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (i)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

**(i) Related Information**

(1) Refer to MCAI EASA AD 2017-0113, dated June 28, 2017, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0268.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax: 206-231-3226.

**(j) Material Incorporated by Reference**

None.

Issued in Des Moines, Washington, on March 22, 2018.

**Michael Kaszicki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-06822 Filed 4-5-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 71**

[Docket No. FAA-2017-0953; **Airspace**  
Docket No. 17-AEA-15]

**Amendment of Class E Airspace;  
Massena, NY**

**AGENCY:** Federal Aviation  
Administration (FAA), DOT.

**ACTION:** Final rule, withdrawal.

**SUMMARY:** This action withdraws the final rule published in the **Federal Register** on March 15, 2018. In that action, the FAA amended Class E surface airspace and Class E airspace extending upward from 700 feet above the surface at Massena, NY. The FAA has determined that withdrawal of the final rule is warranted since there has been a change in the date for the decommissioning of the Massena collocated VHF omnidirectional range tactical air navigation (VORTAC).

**DATES:** Effective 0901 UTC, April 6, 2018.

**FOR FURTHER INFORMATION CONTACT:** John Fornito, Operations Support Group, Eastern Service Center, Federal Aviation Administration, 1701 Columbia Avenue, College Park, Georgia 30337; telephone (404) 305-6364.

**SUPPLEMENTARY INFORMATION:****History**

The FAA published a final rule in the **Federal Register** for Docket No. FAA-2017-0953 (83 FR 11407, March 15, 2018) amending Title 14 Code of Federal Regulations (14 CFR) part 71 amending Class E Airspace at Massena International-Richards Field Airport, Massena, NY. The FAA found that the Massena collocated VORTAC navigation aid will not be decommissioned at this time. As a result, the final rule is being withdrawn.

**Lists of Subjects in 14 CFR Part 71**

Airspace, Incorporation by reference, Navigation (air).

**The Withdrawal**

■ In consideration of the foregoing, the final rule for Docket No. FAA-2017-0953 (83 FR 11407, March 15, 2018), FR Doc. 2018-05045, is hereby withdrawn.

**Authority:** 49 U.S.C. 106(f), 106(g); 40103, 40113, 40120; E.O. 10854, 24 FR 9565, 3 CFR, 1959-1963 Comp., p. 389.

Issued in College Park, Georgia, on March 29, 2018.

**Geoff Lelliott,**

*Acting Manager, Operations Support Group, Eastern Service Center, Air Traffic Organization.*

[FR Doc. 2018-06997 Filed 4-5-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF THE TREASURY****Alcohol and Tobacco Tax and Trade Bureau****27 CFR Part 9**

[Docket No. TTB-2016-0007; T.D. TTB-150;  
Ref: Notice No. 161]

**RIN 1513-AC26**

**Establishment of the Cape May  
Peninsula Viticultural Area**

**AGENCY:** Alcohol and Tobacco Tax and Trade Bureau, Treasury.

**ACTION:** Final rule; Treasury decision.

**SUMMARY:** The Alcohol and Tobacco Tax and Trade Bureau (TTB) establishes the approximately 126,635-acre “Cape May Peninsula” viticultural area in Cape May and Cumberland Counties, New Jersey. The viticultural area lies entirely within the established Outer Coastal Plain viticultural area. TTB designates viticultural areas to allow vintners to better describe the origin of their wines and to allow consumers to better identify wines they may purchase.

**DATES:** This final rule is effective May 7, 2018.

**FOR FURTHER INFORMATION CONTACT:** Kate M. Bresnahan, Regulations and Rulings Division, Alcohol and Tobacco Tax and Trade Bureau, 1310 G Street NW, Box 12, Washington, DC 20005; phone (202) 453-1039, ext. 151.

**SUPPLEMENTARY INFORMATION:****Background on Viticultural Areas****TTB Authority**

Section 105(e) of the Federal Alcohol Administration Act (FAA Act), 27 U.S.C. 205(e), authorizes the Secretary of the Treasury to prescribe regulations for the labeling of wine, distilled spirits, and malt beverages. The FAA Act provides that these regulations should, among other things, prohibit consumer deception and the use of misleading statements on labels and ensure that labels provide the consumer with adequate information as to the identity and quality of the product. The Alcohol and Tobacco Tax and Trade Bureau (TTB) administers the FAA Act pursuant to section 1111(d) of the