

**(e) Reason**

This AD was prompted by mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. We are issuing this proposed AD to prevent damage from the threads of the bolt on the internal bore of the cross tube hinge plate, which could result in reduced control.

**(f) Actions and Compliance**

Unless already done, do the following actions in paragraphs (f)(1) and (2) of this AD:

(1) Within the next 150 hours time-in-service after the effective date of this AD or within the next 12 months after the effective date of this AD, whichever occurs later, inspect the elevator bellcrank pivot joint to determine the length of the bolt installed. Do the inspection using the Inspection Instructions in Pacific Aerospace Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

(2) If an incorrect size bolt is found during the inspection required in paragraph (f)(1) of this AD, before further flight, take all necessary corrective actions using the Accomplishment Instructions in Pacific Aerospace Service Bulletin PACSB/XL/097, Issue 1, dated March 12, 2018.

**(g) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, Small Airplane Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Mike Kiesov, Aerospace Engineer, FAA, Small Airplane Standards Branch, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4144; fax: (816) 329-4090; email: [mike.kiesov@faa.gov](mailto:mike.kiesov@faa.gov). Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, Small Airplane Standards Branch, FAA; or the Civil Aviation Authority of New Zealand (CAA).

**(h) Related Information**

Refer to MCAI Civil Aviation Authority (CAA) AD DCA/750XL/28, dated March 22, 2018, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0385. For service information related to this AD, contact Pacific Aerospace Limited, Airport Road, Hamilton, Private Bag 3027, Hamilton 3240, New Zealand; phone: +64 7843 6144; fax: +64 843 6134; email: [pacific@aerospace.co.nz](mailto:pacific@aerospace.co.nz); internet: [www.aerospace.co.nz](http://www.aerospace.co.nz). You may review this referenced service information at the FAA, Policy and Innovation Division, 901 Locust,

Kansas City, Missouri 64106. For information on the availability of this material at the FAA, call (816) 329-4148.

Issued in Kansas City, Missouri, on May 4, 2018.

**Melvin J. Johnson,**

*Deputy Director, Policy & Innovation Division, Aircraft Certification Service.*

[FR Doc. 2018-10016 Filed 5-10-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2018-0394; Product Identifier 2018-NM-036-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Dassault Aviation Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Dassault Aviation Model MYSTERE-FALCON 50 airplanes. This proposed AD was prompted by a determination that more restrictive maintenance requirements and airworthiness limitations are necessary. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate new and more restrictive maintenance requirements and airworthiness limitations. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 25, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201-440-6700; internet

<http://www.dassaultfalcon.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0394; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206-231-3226.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0394; Product Identifier 2018-NM-036-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2018-0026, dated January 30, 2018 (referred to after this as the Mandatory Continuing Airworthiness Information, or "the MCAI"), to correct an unsafe condition for all Dassault Aviation Model MYSTERE-FALCON 50 airplanes. The MCAI states:

The airworthiness limitations and certification maintenance instructions for the

Dassault Mystère Falcon 50 aeroplanes, which are approved by EASA, are currently defined and published in the Dassault Mystère Falcon 50 Aircraft Maintenance Manual (AMM) chapter 5–40. These instructions have been identified as mandatory for continued airworthiness.

Failure to accomplish these instructions could result in an unsafe condition [i.e., reduced structural integrity of the airplane].

Consequently, EASA issued [EASA] AD 2016–0067 [which corresponds to FAA AD 2017–09–03 Amendment 39–18865 (82 FR 21467, May 9, 2017) (“AD 2017–09–03”)] to require accomplishment of the maintenance tasks, and implementation of the airworthiness limitations, as specified in Dassault Mystère Falcon 50 AMM chapter 5–40 Revision 23.

Since that [EASA] AD was issued, Dassault issued Revision 24 of the Dassault Mystère Falcon 50 AMM chapter 5–40, which introduces new and more restrictive maintenance requirements and/or airworthiness limitations.

For the reason described above, this [EASA] AD retains the requirements of EASA AD 2016–0067, which is superseded, and requires accomplishment of the actions specified in Revision 24 of the Dassault Mystère Falcon 50 AMM chapter 5–40 \* \* \*.

You may examine the MCAI in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0394.

#### **Relationship Between Proposed AD and Certain Other ADs**

This NPRM would not supersede AD 2017–09–03. Rather, we have determined that a stand-alone AD would be more appropriate to address the changes in the MCAI. This NPRM would require revising the maintenance or inspection program, as applicable, to incorporate the new maintenance requirements and airworthiness limitations. Accomplishment of the proposed actions would then terminate all requirements of AD 2017–09–03. Accomplishment of the proposed actions would also terminate all requirements of AD 2010–26–05, Amendment 39–16544 (75 FR 79952, December 21, 2010) (“AD 2010–26–05”) and AD 2012–02–18, Amendment 39–16941 (77 FR 12175, February 29, 2012) (“AD 2012–02–18”), for the Dassault Aviation Model MYSTÈRE–FALCON 50 aeroplanes specified in those ADs.

#### **Related Service Information Under 1 CFR Part 51**

Dassault Aviation has issued Chapter 5–40, Airworthiness Limitations, of the Dassault Falcon 50/50EX Maintenance Manual, Revision 24, dated July 2017. This service information describes instructions applicable to airworthiness and safe life limitations. This service information is reasonably available

because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### **FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type designs.

This proposed AD requires revisions to certain operator maintenance documents. Compliance with these revisions is required by 14 CFR 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by this proposed AD, the operator may not be able to accomplish the actions described in the revisions. In this situation, to comply with 14 CFR 91.403(c), the operator must request approval for an alternative method of compliance according to paragraph (j)(1) of this proposed AD. The request should include a description of changes to the required actions that will ensure the continued damage tolerance of the affected structure.

#### **Differences Between This Proposed AD and the MCAI or Service Information**

The MCAI specifies that if there are findings from the airworthiness limitations section (ALS) inspection tasks, corrective actions must be accomplished in accordance with Dassault Aviation maintenance documentation. However, this proposed AD does not include that requirement. Operators of U.S.-registered airplanes are required by general airworthiness and operational regulations to perform maintenance using methods that are acceptable to the FAA. We consider those methods to be adequate to address any corrective actions necessitated by the findings of ALS inspections required by this proposed AD.

#### **Costs of Compliance**

We estimate that this proposed AD affects 250 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

We have determined that revising the maintenance or inspection program takes an average of 90 work-hours per

operator, although we recognize that this number may vary from operator to operator. In the past, we have estimated that this action takes 1 work-hour per airplane. Since operators incorporate maintenance or inspection program changes for their affected fleet(s), we have determined that a per-operator estimate is more accurate than a per-airplane estimate. Therefore, we estimate the total cost per operator to be \$7,650 (90 work-hours × \$85 per work-hour).

#### **Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

#### **Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;

2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

##### § 39.13 [Amended]

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Dassault Aviation:** Docket No. FAA–2018–0394; Product Identifier 2018–NM–036–AD.

##### (a) Comments Due Date

We must receive comments by June 25, 2018.

##### (b) Affected ADs

This AD affects AD 2010–26–05, Amendment 39–16544 (75 FR 79952, December 21, 2010) (“AD 2010–26–05”); AD 2012–02–18, Amendment 39–16941 (77 FR 12175, February 29, 2012) (“AD 2012–02–18”); and AD 2017–09–03 Amendment 39–18865 (82 FR 21467, May 9, 2017) (“AD 2017–09–03”).

##### (c) Applicability

This AD applies to Dassault Aviation Model MYSTERE–FALCON 50 airplanes, certificated in any category, all manufacturer serial numbers.

##### (d) Subject

Air Transport Association (ATA) of America Code 05, Time limits/maintenance checks.

##### (e) Reason

This AD was prompted by a determination that more restrictive maintenance requirements and airworthiness limitations are necessary. We are issuing this AD to prevent reduced structural integrity of the airplane.

##### (f) Compliance

Comply with this AD within the compliance times specified, unless already done.

#### (g) Revision of Maintenance or Inspection Program

Within 90 days after the effective date of this AD, revise the maintenance or inspection program, as applicable, to incorporate the information specified in Chapter 5–40, Airworthiness Limitations, of the Dassault Falcon 50/50EX Maintenance Manual, Revision 24, dated July 2017. The initial compliance times for doing the tasks are at the time specified in Chapter 5–40, Airworthiness Limitations, of the Dassault Falcon 50/50EX Maintenance Manual, Revision 24, dated July 2017, or within 90 days after the effective date of this AD, whichever occurs later.

#### (h) No Alternative Actions or Intervals

After the maintenance or inspection program has been revised as required by paragraph (g) of this AD, no alternative actions (e.g., inspections), or intervals, may be used unless the actions, or intervals, are approved as an alternative method of compliance (AMOC) in accordance with the procedures specified in paragraph (j)(1) of this AD.

#### (i) Terminating Actions for Other ADs

(1) Accomplishing the actions required by paragraph (g) of this AD terminates all requirements of AD 2017–09–03.

(2) Accomplishing the actions required by paragraph (g) of this AD terminates all requirements of AD 2010–26–05 and AD 2012–02–18 for the Dassault Aviation Model MYSTERE–FALCON 50 airplanes specified in those ADs.

#### (j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (k)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Dassault Aviation’s EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

#### (k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI)

Airworthiness Directive 2018–0026, dated January 30, 2018, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0394.

(2) For more information about this AD, contact Tom Rodriguez, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th Street, Des Moines, WA 98198; telephone and fax 206–231–3226.

(3) For service information identified in this AD, contact Dassault Falcon Jet Corporation, Teterboro Airport, P.O. Box 2000, South Hackensack, NJ 07606; telephone 201–440–6700; internet <http://www.dassaultfalcon.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th Street, Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

Issued in Des Moines, Washington, on April 27, 2018.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018–09979 Filed 5–10–18; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA–2018–0390; Product Identifier 2017–NM–130–AD]

RIN 2120–AA64

#### Airworthiness Directives; Airbus Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for all Airbus Model A300 series airplanes. This proposed AD was prompted by a revision of an airworthiness limitation items (ALI) document. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate the specified maintenance requirements and airworthiness limitations. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by June 25, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.