

**(j) Other Acceptable Installation Method**

Installation of an HMCA SW standard approved after the effective date of this AD is acceptable for compliance with the corresponding actions required by paragraph (h) of this AD, provided the conditions required by paragraphs (j)(1) and (j)(2) of this AD are met.

(1) The HMCA SW standard must be approved by the Manager, International Section, Transport Standards Branch, FAA; the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(2) The installation must be accomplished in accordance with the modification instructions approved by the Manager, International Section, Transport Standards Branch, FAA; the EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

**(k) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (l)(2) of this AD. Information may be emailed to: [9-ANM-116-AMOC-REQUESTS@faa.gov](mailto:9-ANM-116-AMOC-REQUESTS@faa.gov). Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the EASA; or Airbus's EASA DOA. If approved by the DOA, the approval must include the DOA-authorized signature.

**(l) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2017-0200, dated October 10, 2017, for related information. You may examine the MCAI on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0505.

(2) For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [continued-airworthiness.a350@airbus.com](mailto:continued-airworthiness.a350@airbus.com);

internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on May 29, 2018.

**Jeffrey E. Duven,**

*Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-12230 Filed 6-8-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2018-0506; Product Identifier 2018-NM-045-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A350-941 airplanes. This proposed AD was prompted by the discovery of inadequate corrosion protection in certain areas of the horizontal stabilizer and the rear fuselage cone structure. This proposed AD would require application of sealant and protective treatment on the affected areas of the horizontal stabilizer and the rear fuselage cone structure and, for certain airplanes, modification of the trimmable horizontal stabilizer (THS) torsion box and re-identification of the elevator. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by July 26, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [continued-airworthiness.a350@airbus.com](mailto:continued-airworthiness.a350@airbus.com); internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0506; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218.

**SUPPLEMENTARY INFORMATION:****Comments Invited**

We invite you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2018-0506; Product Identifier 2018-NM-045-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this NPRM. We will consider all comments received by the closing date and may amend this NPRM based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this NPRM.

**Discussion**

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2018-0036, dated February 7, 2018 (referred to after this as the Mandatory Continuing

Airworthiness Information, or “the MCAI”), to correct an unsafe condition for certain Airbus Model A350–941 airplanes. The MCAI states:

In some areas of the Horizontal Tail Plane (HTP) [horizontal stabilizer] and fuselage Section (S) 19 [rear fuselage cone structure], the interfac sealant for multimaterial joints (hybrid joints) was only applied on the surface in direct contact with aluminium parts and not between all surfaces of the joint parts. This situation does not ensure full barrier properties. To avoid any risk of water ingress in multi-material-stacks involving aluminium, it is necessary to apply interfac sealant between all assembled parts, even between parts made of corrosion resistant material. This ensures a double barrier in the joint and prevents subsequent potential galvanic corrosion on the aluminum holes on top of the single barrier already applied in aluminium parts.

This condition, if not corrected, could reduce the structural integrity of the HTP and fuselage at S19.

To address this unsafe condition, Airbus developed production mod [Modification] 106695 for fuselage at S19 and mod 107824 for HTP to improve protection against corrosion, and issued [Airbus] SB [Service Bulletin] A350–53–P029 (Airbus mod

110281) and [Airbus] SB A350–55–P003 (Airbus mod 107877 and mod 108494) to provide modification instructions for in-service pre-mod aeroplanes.

For the reasons described above, this [EASA] AD requires application of sealant and protective treatment on the affected areas of the HTP and fuselage at S19 and, for certain aeroplanes, modification of the trimmable horizontal stabilizer (THS) torsion box [and re-identification of the elevator].

**Related Service Information Under 14 CFR Part 51**

Airbus has issued Service Bulletin A350–53–P029, dated November 17, 2017. This service information describes procedures to apply sealant and protective treatment on the affected areas of the rear fuselage cone structure.

Airbus has issued Service Bulletin A350–55–P003, dated November 6, 2017. This service information describes procedures to apply sealant and protective treatment on the affected areas of the horizontal stabilizer, modify the THS torsion box in zone 330 and 340, and re-identify the elevator in zone 335 and 345.

The service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**FAA’s Determination and Requirements of This Proposed AD**

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type designs.

**Costs of Compliance**

We estimate that this proposed AD affects 6 airplanes of U.S. registry.

We estimate the following costs to comply with this proposed AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Up to 57 work-hours × \$85 per hour = \$4,845 .....	Unavailable .....	Up to \$4,845 .....	Up to \$29,070.

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all known costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on

products identified in this rulemaking action.

This proposed AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes to the Director of the System Oversight Division.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;

2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);

3. Will not affect intrastate aviation in Alaska; and

4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**Airbus:** Docket No. FAA-2018-0506; Product Identifier 2018-NM-045-AD.

**(a) Comments Due Date**

We must receive comments by July 26, 2018.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to Airbus Model A350-941 airplanes certificated in any category, all manufacturer serial numbers, except those on which Airbus Modification 106695 (or retrofit Modification 110281) and Modification 107824 (or retrofit Modification 107877 and retrofit Modification 108494) have been embodied in production.

**(d) Subject**

Air Transport Association (ATA) of America Code 53, Fuselage; 55, Stabilizers.

**(e) Reason**

This AD was prompted by the discovery of inadequate corrosion protection in certain areas of the horizontal stabilizer and the rear fuselage cone structure. We are issuing this AD to prevent reduced structural integrity of the horizontal stabilizer and the rear fuselage cone structure.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Definitions**

(1) For the purpose of this AD, Group 1 airplanes are those with manufacturer serial numbers (MSNs) listed in Section 1.A., "Applicability" of Airbus Service Bulletin A350-53-P029, dated November 17, 2017.

(2) For the purpose of this AD, Group 2 airplanes are those with MSNs listed in Section 1.A., "Applicability" of Airbus Service Bulletin A350-55-P003, dated November 6, 2017.

**(h) Modification**

(1) For Group 1 airplanes: Before exceeding 36 months since the date of issuance of the original standard airworthiness certificate or date of issuance of the original export certificate of airworthiness, or within 90 days after the effective date of this AD, whichever occurs later, apply sealant and protective treatment on the affected areas of the rear fuselage cone structure, as defined in, and in accordance with the Accomplishment Instructions of Airbus Service Bulletin A350-53-P029, dated November 17, 2017.

(2) For Group 2 airplanes: Before exceeding 36 months since the date of issuance of the original standard airworthiness certificate or date of issuance of the original export certificate of airworthiness, or within 90 days after the effective date of this AD, whichever occurs later, accomplish concurrently the actions specified in paragraphs (h)(2)(i) and (h)(2)(ii) of this AD, in accordance with the

Accomplishment Instructions of Airbus Service Bulletin A350-55-P003, dated November 6, 2017.

(i) Apply sealant and protective treatment on the affected areas of the horizontal stabilizer, as defined in Airbus Service Bulletin A350-55-P003, dated November 6, 2017.

(ii) Modify the trimmable horizontal stabilizer (THS) torsion box in zone 330 and 340, and re-identify the elevator in zone 335 and 345.

**(i) Other FAA AD Provisions**

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs):* The Manager, International Section, Transport Standards Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Section, send it to the attention of the person identified in paragraph (j)(2) of this AD. Information may be emailed to: 9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Section, Transport Standards Branch, FAA; or the European Aviation Safety Agency (EASA); or Airbus's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC):* If any service information contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

**(j) Related Information**

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) EASA AD 2018-0036, dated February 7, 2018, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0506.

(2) For more information about this AD, contact Kathleen Arrigotti, Aerospace Engineer, International Section, Transport Standards Branch, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone and fax 206-231-3218.

(3) For service information identified in this AD, contact Airbus SAS, Airworthiness Office—EAL, 1 Rond Point Maurice Bellonte, 31707 Blagnac Cedex, France; telephone +33 5 61 93 36 96; fax +33 5 61 93 45 80; email [continued-airworthiness.a350@airbus.com](mailto:continued-airworthiness.a350@airbus.com); internet <http://www.airbus.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued in Des Moines, Washington, on May 25, 2018.

**Jeffrey E. Duven,**

*Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2018-12229 Filed 6-8-18; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

**[Docket No. FAA-2018-0508; Product Identifier 2018-NM-012-AD]**

**RIN 2120-AA64**

**Airworthiness Directives; Airbus Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Airbus Model A350-941 airplanes. This proposed AD was prompted by a determination that more restrictive maintenance requirements and airworthiness limitations are necessary. This proposed AD would require revising the maintenance or inspection program, as applicable, to incorporate new or more restrictive maintenance requirements and airworthiness limitations. We are proposing this AD to address the unsafe condition on these products.

**DATES:** We must receive comments on this proposed AD by July 26, 2018.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.
- *Fax:* 202-493-2251.
- *Mail:* U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* Deliver to Mail address above between 9 a.m. and 5