

using Bombardier Alert Service Bulletin 215–A558, Revision 1, dated January 10, 2014; or Bombardier Alert Service Bulletin 215–A558, Revision 2, dated January 17, 2014.

#### (k) No Reporting Requirement

Although Bombardier Alert Service Bulletin 215–A558, Revision 3, dated June 3, 2016, specifies to submit certain information to the manufacturer, this AD does not include that requirement.

#### (l) Other FAA AD Provisions

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or TCCA; or Viking Air Limited's TCCA DAO. If approved by the DAO, the approval must include the DAO-authorized signature.

#### (m) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) Canadian AD CF–2013–11R1, dated October 16, 2017, for related information. This MCAI may be found in the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0638.

(2) For more information about this AD, contact Andrea Jimenez, Aerospace Engineer, Airframe and Mechanical Systems Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516–228–7330; fax 516–794–5531.

(3) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (n)(3) and (n)(4) of this AD.

#### (n) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Alert Service Bulletin 215–A558, Revision 3, dated June 3, 2016.

(ii) [Reserved].

(3) For service information identified in this AD, contact Viking Air Limited, 1959 de Havilland Way, Sidney, British Columbia V8L 5V5, Canada; telephone +1–250–656–7227; fax +1–250–656–0673; email [acs-technical.publications@vikingair.com](mailto:acs-technical.publications@vikingair.com); internet <http://www.vikingair.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For

information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on February 1, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019–02162 Filed 2–14–19; 8:45 am]

**BILLING CODE 4910–13–P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

**[Docket No. FAA–2018–0581; Product Identifier 2018–NM–029–AD; Amendment 39–19547; AD 2019–01–08]**

**RIN 2120–AA64**

#### **Airworthiness Directives; The Boeing Company Airplanes**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes. This AD was prompted by a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations. The non-compliance could result in flight attendant seats failing in a high-G crash. This AD requires modifications for galley mounted seat fittings. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective March 22, 2019.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of March 22, 2019.

**ADDRESSES:** For service information identified in this final rule, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600; telephone 562–797–1717; internet <https://www.myboeingfleet.com>. You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0581.

#### **Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA–2018–0581; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any comments received, and other information. The address for Docket Operations (phone: 800–647–5527) is U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1200 New Jersey Avenue SE, Washington, DC 20590.

#### **FOR FURTHER INFORMATION CONTACT:**

Allison Buss, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3564; email: [Allison.Buss@faa.gov](mailto:Allison.Buss@faa.gov).

#### **SUPPLEMENTARY INFORMATION:**

##### **Discussion**

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes. The NPRM published in the **Federal Register** on July 6, 2018 (83 FR 31509). The NPRM was prompted by a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations. The NPRM proposed to require modifications for galley mounted seat fittings.

We are issuing this AD to address non-compliant flight attendant seats, which could fail in a high-G crash and result in potential injury to flight attendants and consequent inability of the flight attendants to assist with passenger evacuation in a timely manner.

##### **Comments**

We gave the public the opportunity to participate in developing this final rule. The following presents the comments received on the NPRM and the FAA's response to each comment.

##### **Support for the NPRM**

Boeing indicated its support for the NPRM.

**Request To Exclude Airplanes Without Affected Galleys**

United Airlines recommended adding a statement to explain that if a reconfigured airplane’s affected galley has been removed or replaced, and the associated manuals have been updated, then that airplane would not be affected by the AD.

We do not agree to add the statement. This AD applies to each airplane identified in the Effectivity section of Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017. However, for airplanes that have been modified, repaired, or altered so that accomplishment of that service information is affected, then under the provisions of paragraph (h) of this AD, we will consider requests for approval of an alternative method of compliance (AMOC). We have not changed this AD in this regard.

**Request To Include Updated Service Information**

Gary Chan, a private citizen, requested that the FAA review the expected revision of Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017. The commenter noted that Zodiac Aerospace Service Bulletin 1016G–25–34, referenced in that Boeing service

information, has been revised and it is expected that the Boeing service information will be updated accordingly. We infer that the commenter is also requesting that the FAA revise the NPRM to reference the updated service information.

We do not agree. We may not refer to any document that does not yet exist. In general terms, we are required by Office of the Federal Register (OFR) regulations for approval of materials “incorporated by reference,” as specified in 1 CFR 51.1(f), to either publish the service document contents as part of the actual AD language; or submit the service document to the OFR for approval as “referenced” material, in which case we may only refer to such material in the text of an AD. The AD may refer to the service document only if the OFR approved it for “incorporation by reference.” See 1 CFR part 51. We do not consider that delaying this action until release of the revised Boeing service information is warranted, since sufficient service information exists. However, under the provisions of paragraph (h) of this AD, we will consider requests for approval to use revised service information if sufficient data are submitted to substantiate that the change would provide an acceptable level of safety. We have not changed the AD in this regard.

**Conclusion**

We reviewed the relevant data, considered the comments received, and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

**Related Service Information Under 1 CFR Part 51**

We reviewed Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017. This service information describes procedures for modifications for galley mounted seat fittings. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

**Costs of Compliance**

We estimate that this AD affects 50 airplanes of U.S. registry. We estimate the following costs to comply with this AD:

**ESTIMATED COSTS FOR REQUIRED ACTIONS**

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Modification .....	7 work-hours × \$85 per hour = \$595 .....	\$0	\$595	\$29,750

According to the manufacturer, some or all of the costs of this AD may be covered under warranty, thereby reducing the cost impact on affected individuals. We do not control warranty coverage for affected individuals. As a result, we have included all known costs in our cost estimate.

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations

for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

This AD is issued in accordance with authority delegated by the Executive Director, Aircraft Certification Service, as authorized by FAA Order 8000.51C. In accordance with that order, issuance of ADs is normally a function of the Compliance and Airworthiness Division, but during this transition period, the Executive Director has delegated the authority to issue ADs applicable to transport category airplanes and associated appliances to the Director of the System Oversight Division.

**Regulatory Findings**

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**Adoption of the Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

■ 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

■ 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2019–01–08 The Boeing Company:**

Amendment 39–19547; Docket No. FAA–2018–0581; Product Identifier 2018–NM–029–AD.

**(a) Effective Date**

This AD is effective March 22, 2019.

**(b) Affected ADs**

None.

**(c) Applicability**

This AD applies to The Boeing Company Model 777–200, –200LR, –300, and –300ER series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017.

**(d) Subject**

Air Transport Association (ATA) of America Code 25, Equipment/furnishings.

**(e) Unsafe Condition**

This AD was prompted by a report that showed a non-compliance exists on some in-service galley attendant seat fitting installations. We are issuing this AD to address non-compliant flight attendant seats, which could fail in a high-G crash and result in potential injury to flight attendants and consequent inability of the flight attendants to assist with passenger evacuation in a timely manner.

**(f) Compliance**

Comply with this AD within the compliance times specified, unless already done.

**(g) Required Actions**

Within 6 years after the effective date of this AD, do all applicable actions identified as “RC” (required for compliance) in, and in accordance with, the Accomplishment Instructions of Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017.

**(h) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Seattle ACO Branch, FAA, has the authority to approve AMOCs

for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the certification office, send it to the attention of the person identified in paragraph (i) of this AD. Information may be emailed to: [9-ANM-Seattle-ACO-AMOC-Requests@faa.gov](mailto:9-ANM-Seattle-ACO-AMOC-Requests@faa.gov).

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) An AMOC that provides an acceptable level of safety may be used for any repair, modification, or alteration required by this AD if it is approved by the Boeing Commercial Airplanes Organization Designation Authorization (ODA) that has been authorized by the Manager, Seattle ACO Branch, FAA, to make those findings. To be approved, the repair method, modification deviation, or alteration deviation must meet the certification basis of the airplane, and the approval must specifically refer to this AD.

(4) For service information that contains steps that are labeled as RC, the provisions of paragraphs (h)(4)(i) and (h)(4)(ii) of this AD apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. If a step or substep is labeled “RC Exempt,” then the RC requirement is removed from that step or substep. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator’s maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition.

**(i) Related Information**

For more information about this AD, contact Allison Buss, Aerospace Engineer, Cabin Safety and Environmental Systems Section, FAA, Seattle ACO Branch, 2200 South 216th St., Des Moines, WA 98198; phone and fax: 206–231–3564; email: [Allison.Buss@faa.gov](mailto:Allison.Buss@faa.gov).

**(j) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Special Attention Service Bulletin 777–25–0649, Revision 1, dated October 6, 2017.

(ii) [Reserved]

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Contractual & Data Services (C&DS), 2600 Westminister Blvd., MC 110–SK57, Seal Beach, CA 90740–5600;

telephone 562–797–1717; internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Standards Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206–231–3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202–741–6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Des Moines, Washington, on January 28, 2019.

**Michael Kaszycki,**

*Acting Director, System Oversight Division, Aircraft Certification Service.*

[FR Doc. 2019–02159 Filed 2–14–19; 8:45 am]

**BILLING CODE 4910–13–P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA–2018–0826; Product Identifier 2018–NE–27; Amendment 39–19553; AD 2019–03–01]

**RIN 2120–AA64**

**Airworthiness Directives; Pratt & Whitney Division (PW) Turbofan Engines**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for certain Pratt & Whitney Division (PW) PW4074, PW4074D, PW4077, PW4077D, PW4084D, PW4090, and PW4090–3 turbofan engines. This AD was prompted by an in-flight failure of a 1st-stage low-pressure compressor (LPC) blade. This AD requires initial and repetitive thermal acoustic imaging (TAI) inspections for cracks in certain 1st-stage LPC blades and removal of those blades that fail inspection. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective March 22, 2019.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of March 22, 2019.

**ADDRESSES:** For service information identified in this final rule, contact Pratt & Whitney Division, 400 Main Street, East Hartford, CT, 06118; phone: 800–565–0140; fax: 860–565–5442; email: [help24@pw.utc.com](mailto:help24@pw.utc.com). You may view this