

# Rules and Regulations

Federal Register

Vol. 84, No. 97

Monday, May 20, 2019

This section of the FEDERAL REGISTER contains regulatory documents having general applicability and legal effect, most of which are keyed to and codified in the Code of Federal Regulations, which is published under 50 titles pursuant to 44 U.S.C. 1510.

The Code of Federal Regulations is sold by the Superintendent of Documents.

## OFFICE OF PERSONNEL MANAGEMENT

### 5 CFR Part 532

RIN 3206-AN76

#### Prevailing Rate Systems; Special Appropriated Fund Wage Schedules for U.S. Insular Areas

**AGENCY:** Office of Personnel Management.

**ACTION:** Final rule.

**SUMMARY:** This rule amends the special appropriated fund wage schedules for U.S. insular areas in OPM regulations to designate the Department of Defense (DOD) as the sole lead agency for American Samoa, the Commonwealth of the Northern Mariana Islands, Guam, Midway, and the U.S. Virgin Islands.

**DATES:** Effective June 19, 2019.

**FOR FURTHER INFORMATION CONTACT:** Madeline Gonzalez, by telephone at (202) 606-2838 or by email at [pay-leave-policy@opm.gov](mailto:pay-leave-policy@opm.gov).

**SUPPLEMENTARY INFORMATION:** On February 13, 2019, the Office of Personnel Management (OPM) issued a proposed rule (84 FR 3729) that amends the special appropriated fund wage schedules for U.S. insular areas in § 532.259(a) of title 5, Code of Federal Regulations, to designate DOD as the sole lead agency for American Samoa, the Commonwealth of the Northern Mariana Islands, Guam, Midway, and the U.S. Virgin Islands. The Federal Prevailing Rate Advisory Committee (FPRAC), the national labor-management committee responsible for advising OPM on matters concerning the pay of Federal Wage System employees, recommended by consensus that we adopt these changes. The 30-day comment period ended on March 15, 2019, during which OPM received no comments.

This rule is not significant under Executive Order (E.O.) 12866, "Regulatory Planning and Review;"

therefore, E.O. 13771, "Reducing Regulation and Controlling Regulatory Costs" does not apply.

#### List of Subjects in 5 CFR Part 532

Administrative practice and procedure, Freedom of information, Government employees, Reporting and recordkeeping requirements, Wages.

Office of Personnel Management.

**Alexys Stanley,**  
*Regulatory Affairs Analyst.*

Accordingly, the Office of Personnel Management amends 5 CFR part 532 as follows:

#### PART 532—PREVAILING RATE SYSTEMS

■ 1. The authority citation for part 532 continues to read as follows:

**Authority:** 5 U.S.C. 5343, 5346; § 532.707 also issued under 5 U.S.C. 552.

■ 2. Section 532.259 is amended by revising paragraph (a) to read as follows:

#### § 532.259 Special appropriated fund wage schedules for U.S. insular areas.

(a) The lead agency shall establish and issue special wage schedules for U.S. civil service wage employees in certain U.S. insular areas. The Department of Defense is the lead agency for American Samoa, the Commonwealth of the Northern Mariana Islands, Guam, Midway, and the U.S. Virgin Islands. These schedules shall provide rates of pay for nonsupervisory, leader, supervisory, and production facilitating employees.

\* \* \* \* \*

[FR Doc. 2019-10335 Filed 5-17-19; 8:45 am]

**BILLING CODE 6325-39-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2017-1124; Product Identifier 2017-SW-073-AD; Amendment 39-19637; AD 2019-09-03]

RIN 2120-AA64

#### Airworthiness Directives; Airbus Helicopters

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule.

**SUMMARY:** We are adopting a new airworthiness directive (AD) for Airbus Helicopters Model AS332C, AS332C1, AS332L, and AS332L1 helicopters. This AD requires inspecting the jettisoning mechanism of the left-hand (LH) and right-hand (RH) cabin sliding plug doors. This AD is prompted by a report that during a scheduled inspection a cabin door failed to jettison. The actions of this AD are intended to correct an unsafe condition on these products.

**DATES:** This AD is effective June 24, 2019.

The Director of the Federal Register approved the incorporation by reference of a certain document listed in this AD as of June 24, 2019.

**ADDRESSES:** For service information identified in this final rule, contact Airbus Helicopters, 2701 N Forum Drive, Grand Prairie, TX 75052; telephone (972) 641-0000 or (800) 232-0323; fax (972) 641-3775; or at [http://www.helicopters.airbus.com/website/en/ref/Technical-Support\\_73.html](http://www.helicopters.airbus.com/website/en/ref/Technical-Support_73.html). You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. It is also available on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1124.

#### Examining the AD Docket

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2017-1124; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the European Aviation Safety Agency (EASA) AD, any incorporated-by-reference service information, the economic evaluation, any comments received, and other information. The street address for Docket Operations (phone: 800-647-5527) is U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE Washington, DC 20590.

**FOR FURTHER INFORMATION CONTACT:** Matt Fuller, Senior Aviation Safety Engineer, Safety Management Section, Rotorcraft Standards Branch, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177;

telephone (817) 222-5110; email [matthew.fuller@faa.gov](mailto:matthew.fuller@faa.gov).

#### SUPPLEMENTARY INFORMATION:

#### Discussion

On May 8, 2018, at 83 FR 20751, the **Federal Register** published our notice of proposed rulemaking (NPRM), which proposed to amend 14 CFR part 39 by adding an AD that would apply to Airbus Helicopters Model AS332C, AS332C1, AS332L, and AS332L1 helicopters, with a cabin sliding plug door installed in accordance with Airbus Helicopters modification (MOD) 0722338, except helicopters with a plug door jettison system installed in accordance with MOD 0725366. The NPRM proposed to require inspecting the jettisoning mechanism of the LH and RH cabin sliding plug doors. The proposed requirements were intended to prevent the cabin sliding door from failing to jettison, which could prevent helicopter occupants from evacuating the helicopter during an emergency.

The NPRM was prompted by EASA AD No. 2017-0022, dated February 8, 2017, issued by EASA, which is the Technical Agent for the Member States of the European Union, to correct an unsafe condition for Airbus Helicopters (previously Eurocopter) Model AS332C, AS332C1, AS332L, and AS332L1 helicopters equipped with a cabin sliding plug door modified in accordance with MOD 0722338. Helicopters with Eurocopter MOD 0725366 are exempt from the EASA AD's requirements.

EASA advises that the emergency jettison test of a cabin lateral sliding plug door failed during a scheduled inspection and test of the door's jettison mechanism. According to EASA, an investigation revealed that the jettison handle cable interfered with the cable clamps. EASA states that this condition could lead to jamming of the door jettisoning mechanism, preventing jettisoning of the affected door during an emergency, possibly obstructing evacuation of the occupants. The EASA AD consequently requires repetitive inspections of the jettisoning mechanism of the LH and RH door, followed by corrective actions if needed.

#### Comments

We gave the public the opportunity to participate in developing this AD, but we received no comments on the NPRM.

#### FAA's Determination

These helicopters have been approved by EASA and are approved for operation in the United States. Pursuant to our bilateral agreement with the European Union, EASA has notified us

of the unsafe condition described in the EASA AD. We are issuing this AD because we evaluated all information provided by EASA and determined the unsafe condition exists and is likely to exist or develop on other helicopters of these same type designs and that air safety and the public interest require adopting the AD requirements as proposed.

#### Differences Between This AD and the EASA AD

The EASA AD requires that the initial inspection occur during the next jettisoning test of the doors or within 110 flight hours, whichever occurs first, and thereafter during certain maintenance tasks. This AD requires a one-time inspection within 110 hours TIS or prior to flying over water.

#### Related Service Information Under 14 CFR Part 51

We reviewed Airbus Helicopters Alert Service Bulletin No. AS332-52.00.56, Revision 0, dated January 30, 2017, which specifies pulling on the inner jettison handle to determine whether the cables come into contact with the cable clamps. If there is contact, this service information specifies changing the position of the cable clamps to prevent interference.

This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the **ADDRESSES** section.

#### Other Related Service Information

We also reviewed Eurocopter Service Bulletin No. 332-52.00.28, Revision 1, dated April 29, 1998, which contains procedures to improve the door jettison system. Eurocopter identifies compliance with this service information as MOD 0725366.

#### Costs of Compliance

We estimate that this AD affects 19 helicopters of U.S. Registry and that labor costs average \$85 per work-hour. Based on these estimates, we expect that inspecting the jettisoning mechanism and changing the orientation of the cable clamps, if necessary, requires 4 work-hours. No parts are required for a total cost of \$340 per helicopter and \$6,460 for the U.S. fleet.

#### Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more

detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on helicopters identified in this rulemaking action.

#### Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a "significant regulatory action" under Executive Order 12866;
- (2) Is not a "significant rule" under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
- (3) Will not affect intrastate aviation in Alaska to the extent that it justifies making a regulatory distinction; and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared an economic evaluation of the estimated costs to comply with this AD and placed it in the AD docket.

#### List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

#### Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

#### PART 39—AIRWORTHINESS DIRECTIVES

- 1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

#### § 39.13 [Amended]

- 2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

**2019-09-03 Airbus Helicopters:**

Amendment 39-19637; Docket No. FAA-2017-1124; Product Identifier 2017-SW-073-AD.

**(a) Applicability**

This AD applies to Airbus Helicopters Model AS332C, AS332C1, AS332L, and AS332L1 helicopters, certificated in any category, with a cabin sliding plug door installed in accordance with Airbus Helicopters modification (MOD) 0722338, except helicopters with a plug door jettison system installed in accordance with MOD 0725366.

**(b) Unsafe Condition**

This AD defines the unsafe condition as failure of a cabin sliding door to jettison, which could prevent helicopter occupants from evacuating the helicopter during an emergency.

**(c) Effective Date**

This AD becomes effective June 24, 2019.

**(d) Compliance**

You are responsible for performing each action required by this AD within the specified compliance time unless it has already been accomplished prior to that time.

**(e) Required Actions**

Within 110 hours time-in-service (TIS) or before the next operation over water, whichever occurs first, inspect the jettisoning mechanism of the left-hand and right-hand cabin doors for correct operation:

(1) Pull the jettisoning handle and determine whether the cable clamp contacts the top or bottom horizontal cables, using as a reference the photographs under paragraph 3.B.2 of Airbus Helicopters Alert Service Bulletin ASB No. AS332-52.00.56, Revision 0, dated January 30, 2017 (ASB).

(2) If there is contact between a cable clamp and a horizontal cable, before further flight, install both cable clamps as depicted in the bottom photograph under paragraph 3.B.2 of the ASB.

**(f) Alternative Methods of Compliance (AMOCs)**

(1) The Manager, Safety Management Section, Rotorcraft Standards Branch, FAA, may approve AMOCs for this AD. Send your proposal to: Matt Fuller, Senior Aviation Safety Engineer, Safety Management Section, Rotorcraft Standards Branch, FAA, 10101 Hillwood Pkwy., Fort Worth, TX 76177; telephone (817) 222-5110; email [9-ASW-FTW-AMOC-Requests@faa.gov](mailto:9-ASW-FTW-AMOC-Requests@faa.gov).

(2) For operations conducted under a 14 CFR part 119 operating certificate or under 14 CFR part 91, subpart K, we suggest that you notify your principal inspector, or lacking a principal inspector, the manager of the local flight standards district office or certificate holding district office, before operating any aircraft complying with this AD through an AMOC.

**(g) Additional Information**

(1) Eurocopter Service Bulletin No. 332-52.00.28, Revision 1, dated April 29, 1998, which is not incorporated by reference, contains additional information about the

subject of this AD. For service information identified in this AD, contact Airbus Helicopters, 2701 N Forum Drive, Grand Prairie, TX 75052; telephone (972) 641-0000 or (800) 232-0323; fax (972) 641-3775; or at [http://www.helicopters.airbus.com/website/en/ref/Technical-Support\\_73.html](http://www.helicopters.airbus.com/website/en/ref/Technical-Support_73.html). You may review the referenced service information at the FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177.

(2) The subject of this AD is addressed in European Aviation Safety Agency (EASA) AD No. 2017-0022, dated February 8, 2017. You may view the EASA AD on the internet at <http://www.regulations.gov> in Docket No. FAA-2017-1124.

**(h) Subject**

Joint Aircraft Service Component (JASC) Code: 5200, Doors.

**(i) Material Incorporated by Reference**

(1) The Director of the Federal Register approved the incorporation by reference of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Airbus Helicopters Alert Service Bulletin ASB No. AS332-52.00.56, Revision 0, dated January 30, 2017.

(ii) [Reserved]

(3) For Airbus Helicopters service information identified in this AD, contact Airbus Helicopters, 2701 N Forum Drive, Grand Prairie, TX 75052; telephone (972) 641-0000 or (800) 232-0323; fax (972) 641-3775; or at [http://www.helicopters.airbus.com/website/en/ref/Technical-Support\\_73.html](http://www.helicopters.airbus.com/website/en/ref/Technical-Support_73.html).

(4) You may view this service information at FAA, Office of the Regional Counsel, Southwest Region, 10101 Hillwood Pkwy., Room 6N-321, Fort Worth, TX 76177. For information on the availability of this material at the FAA, call (817) 222-5110.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call (202) 741-6030, or go to: <http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Fort Worth, Texas, on May 1, 2019.

**Lance T. Gant,**

*Director, Compliance & Airworthiness Division, Aircraft Certification Service.*

[FR Doc. 2019-10307 Filed 5-17-19; 8:45 am]

**BILLING CODE 4910-13-P**

**DEPARTMENT OF TRANSPORTATION****Federal Aviation Administration****14 CFR Part 39**

[Docket No. FAA-2018-0953; Product Identifier 2018-SW-079-AD; Amendment 39-19636; AD 2019-09-02]

RIN 2120-AA64

**Airworthiness Directives; Bell Helicopter Textron, Inc. (Bell) Helicopters**

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Final rule; request for comments.

**SUMMARY:** We are superseding Airworthiness Directive (AD) 2018-17-01 for Bell Model 212, 412, 412CF, and 412EP helicopters. AD 2018-17-01 required replacing certain oil and fuel check valves and prohibited installing these valves on any helicopter. This AD retains the requirements of AD 2018-17-01 but expands those requirements for all model helicopters. This AD was prompted by the discovery that we omitted a helicopter model from one of the required actions. We are issuing this AD to address the unsafe condition on these products.

**DATES:** This AD is effective June 4, 2019.

We must receive any comments on this AD by July 5, 2019.

**ADDRESSES:** You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

**Examining the AD Docket**

You may examine the AD docket on the internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2018-0953; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, the regulatory evaluation, any